

DEVELOPMENT OF A THEORETICAL MODEL FOR COAL CLEANING PROCESSES


A Thesis Submitted
in Partial Fulfilment of the Requirements
for the Degree of
MASTER OF TECHNOLOGY

By
M. TAMILMANI

Approved

to the

DEPARTMENT OF METALLURGICAL ENGINEERING
INDIAN INSTITUTE OF TECHNOLOGY KANPUR
APRIL, 1980

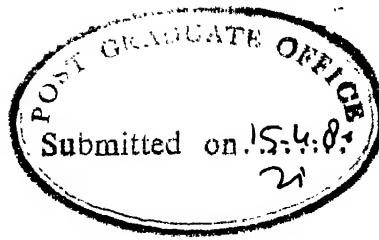

CERTIFICATE

This is to certify that the present work 'DEVELOPMENT OF A THEORETICAL MODEL FOR COAL CLEANING PROCESSES' by Mr. M. Tamilmani has been carried out under my supervision and has not been submitted elsewhere for a degree.

Date: April 15, 1980


[P.C. Kapur]

Professor
Department of Metallurgical Engineering
Indian Institute of Technology,
Kanpur-208016, U.P.

POST GRADUATE OFFICE

This thesis has been approved
for the award of the degree of
Master of Technology (M.Tech.)
in accordance with the
regulations of the Indian
Institute of Technology, Kanpur

Dated. 9.5.80 2

I.I.T KANPUR
CENTRAL LIBRARY
Acc. No. 1 62328

26 MAY 1980

ME - 1980 - M - TAM - DEV

ACKNOWLEDGEMENTS

I am extremely grateful to my guide Professor Dr. P.C. Kapur who proposed the model investigated in this thesis, gave invaluable guidance and constant encouragement throughout this work.

I am thankful to my friend Mr. V.R. Sankar in the Department of Mechanical Engineering for his help at various stages of this work. I am also grateful to my friends Mr. S. Narayanan and Mr. S. Srinivasan for their cooperation in completion of this work.

I am thankful to Mr. B.S. Pandey for his excellent typing.

Author

CONTENTS

	List of Tables	vi
	List of Figures	vii
	Synopsis	ix
CHAPTER		
1	INTRODUCTION	1
2	LITERATURE REVIEW	3
	2.1 Need for coal cleaning	3
	2.2 Coal cleaning processes	6
	2.3 The performance criterion	10
	2.4 Types of performance criterion	11
	2.5 Distribution or Separation (Tromp) curve	13
	2.6 Generalized (self preserving) Distribution curve	16
	2.7 Mathematical form of distribution curve	18
3	OBJECTIVE	25
4	MODEL	26
5	METHODOLOGY	36
6	RESULTS	48
7	ANALYSIS	62
	7.1 Dense medium vessel	62
	7.2 Baum jig	62
	7.3 Dense medium cyclone	63

7.4 Hydro cyclone	64
7.5 Concentrating table	64
7.6 Generalized Probable error	65
8 CONCLUSION	66
REFERENCES	67
APPENDICES	70
Appendix 1: Box-Complex Method	70
2: Rosenbrock Hill Climb Method	80
3: Effect of Sharpness Index (n) on Distribution Curves Using Basic Equation	
$f(\bar{d}) = \frac{1}{1 + \bar{d}^n}$	
and Effect of n and \bar{d}_1 on Distribution Curves Using 2-Parameter model	
$f(\bar{d}) = \frac{1}{1 + (\frac{\bar{d} - \bar{d}_1}{1 - \bar{d}_1})^n}$	89
4: List of parameter values of our model	96
5: Comparison of our model with Gottfried's Equation	98

LIST OF TABLES

TABLE	Page
5.1 Generalized distribution data [13]	37
5.2 Selection of 4-parameter model	42
5.3 Selection of best weight to the washed coal recovery per cent in the objective function	44
5.4 Selection of absolute error criterion	45
5.5 Selection of range of importance for washed coal recovery per cent	46
5.6 Selection of Rosenbrock Hill Climb Method	47

LIST OF FIGURES

FIGURE		Page
2.1	Density of separation as a probability phenomenon	21
2.2	Distribution curve with error area to probable error	22
2.3	Conventional distribution curves	23
2.4	Generalized distribution curve	24
4.1	Schematic diagram for coal cleaning	26
4.2	Effect of sharpness index on distribution curves $f(\bar{d}) = \frac{1}{1+(\bar{d})^n}$	33
4.3	Effect of limiting density, \bar{d}_1 on distribution curves	34
4.4	Representation of distribution curve by 4-parameter model	35
	Comparison of our model and Gottfried equation on distribution curves	
6.1	Dense medium vessel	50
6.2	Baum jig	51
6.3	Dense medium cyclone	52
6.4	Hydrocyclone	53
6.5	Concentrating table	54

FIGURE	Page
	Variation of sharpness index, n with feed sizes
6.6	Dense medium vessel ... 55
6.7	Baum jig ... 56
6.8	Baum jig (log-log plot) 57
6.9	Dense medium cyclone ... 58
6.10	Hydro cyclone ... 59
6.11	Concentrating table ... 60
6.12	Sharpness Index, n vs Generalized Probable error ... 61

SYNOPSIS

A number of coal cleaning processes which are based on the float-sink principle are in use to clean a wide variety of coal changing both in quality and size consist. For selecting a suitable process for a particular run-of-mine coal and forecasting the cleaning results, one needs performance criterion. Generally distribution (Tromp) curve which is obtained when the per cent of feed reporting to clean coal is plotted against density is used for this purpose. A formal model for coal cleaning processes that will result in distribution curve has been developed. The values of the parameters in the model are estimated using non-linear optimisation techniques namely Box-Complex method and Rosenbrock Hill Climb method. The variation of parameters with feed size gives a better insight into the performance of different coal cleaning equipments.

CHAPTER 1

INTRODUCTION

Coal is the most abundant fossil fuel resource of energy. Raw coal is always associated with impurities. Gradual depletion of the high quality coal seams and increasing use of mechanised mining methods has led to the substantial increase in the impurity content of the raw coal. Frequently the raw coal is not acceptable for power-plants, metallurgical or other uses. A thorough cleaning of coal, to reduce the ash and sulphur impurities is now almost mandatory for coal utilisation. Because of the wide variations in the nature of coal, ash content, size fractions, etc., coal cleaning is performed by various processes. For the selection of the optimum process and its monitoring, for a particular type and size of coal, some performance criterion is needed.

Of the many performance criteria available for this purpose, distribution (Tromp) curve is most commonly used. In it the performance of various coal cleaning machines and the effect of control setting is given in terms of error area, probable error etc. The mathematical form of the Tromp curve is identical to the cumulative distribution function. However, the interpretation of the two are different. In particular, the frequency function of Tromp

curve has no physical meaning. Many attempts have been made to describe Tromp curves in terms of statistical cumulative distribution functions, including normal, log-normal and Weibull distributions. However, as of now a formal model for coal cleaning that will generate Tromp curve is not available.

In this thesis, we present a mathematical model of the coal cleaning process that generates a separation (Tromp) curve. The model is extended to incorporate the realistic case where the minimum density of coal is greater than zero, maximum coal fraction floated is less than one and minimum coal fraction in sink is greater than zero. It is shown that the model's separation curves are self preserving or self-similar in terms of a dimensionless density, $\frac{d}{d_{0.5}}$, in conformity with the results in literature. In the model, the sharpness of separation is quantified by a sharpness index n which is estimated using Box complex technique and Rosenbrock hill climb method. The variation of parameters with feed sizes in five different processes, dense medium cyclone, hydro cyclone, concentrating table, dense medium vessel and baum-jig has been determined and analyzed.

CHAPTER 2

LITERATURE REVIEW

2.1 NEED FOR COAL CLEANING

Coal is a mixture of combustible metamorphosed plant remains that vary in both physical properties and chemical composition. A number of components are present in the coal, depending on the nature of the original plant materials and the degree of coalification. In addition the coal coming from the pits and seams contain a significant amount of impurities, both ash forming mineral matter and sulphur contributing compounds. The origin, composition, properties and the distribution of impurities have been discussed by many authors [1-3]. Shale, Kaolin, sulphide, carbonate and chloride group species are the major mineral impurities. A number of minor minerals, quartz, feldspar, etc., are also present. The impurities are subdivided into 'inherent impurities', which are structurally a part of the coal itself and cannot be separated from it by any mechanical/physical means, and 'segregated impurities', that exist as individual, discrete particles, and can be removed by mechanical coal cleaning.

Yancey and Geer [4] have summarized the ill effects of impurities:

1. An economic loss is manifest in the handling, transportation, and storage of high-ash coal, for the inert impurities must be handled with the coal, yet contribute nothing in its use.

2. In combustion, the ash-forming impurities not only dilute the combustible content of the coal and thus reduce its calorific value but also lower the effective capacity of the burning equipment, reduce the plant flexibility, and impose added expense in handling of ash.

3. The fluctuations in ash content that characterize the high-ash coals render the control of combustion difficult.

4. Excessive ash content impairs the efficiency of combustion and increases the erosion/corrosion of the equipment.

5. High ash content in the coal decreases the yield of coke in terms of carbon content or thermal value, decreases the yield of by-products and gives a weaker coke and consequently higher percentage of breeze fraction.

6. Use of high-ash coke in blast furnace leads to an increase in the consumption of coke, requires more limestone for flux, reduces furnace capacity, and makes the temperature control more difficult.

7. Sulphur, the second impurity after ash is a deleterious impurity in virtually all the metallurgical products. For this reason, high - sulphur coal is unsuited for smelting

or heat-treating processes. For example, in blast furnace operation, the penalties exerted by high-sulphur coke are added slag volume, increased coke consumption, and greater difficulty in furnace control.

8. When coals containing more than about 0.05 per cent sodium chloride are coked, the refractory lining of the coke ovens suffers serious corrosion.

The said ill effects can be minimized to a lesser or greater extend by coal cleaning which is defined as a physical and/or chemical process for removing high-ash impurities including pyritic sulphur from raw coal. The attributes of cleaned coal are greater uniformity in composition and reduced impurity content. Zachar and Gilbert [5] have discussed the economics of coal preparation in detail. According to them, the removal of free impurities from raw coal to upgrade the product in order to make it salable is an expensive process employed only through necessity:

1. to increase its net income per ton of product, and
2. to provide a steady outlet for its products.

Mechanization and the use of continuous mining equipment invariably produce raw coal containing more impurities. Coal preparation therefore permits rapid, full-seam mining. Also the amount of impurities in fine coal tends to be high, which again calls for appropriate coal cleaning facilities.

2.2 COAL CLEANING PROCESSES

Most of the coal cleaning processes depend on the density difference between coal and its associated impurities. Coal ranges in apparent density from 1.2 to 1.7, depending on its rank, moisture content, and percentage of ash. Shale, clay, and sandstone range from about 2.0 to 2.6 in density, depending on their degree of purity; pyrite ranges from 2.4 to 4.9; and calcite and gypsum have a density of 2.7 and 2.3, respectively. All removable impurities associated with coals are higher in density than the coal. The two major difficulties, that have influenced the development of a number of coal cleaning processes are:

1. The raw coal contains middlings of a wide range of intermediate ash contents; and
2. The relative behaviour of the coal particles of different sizes.

The classification of the coal cleaning equipments and the principles underlying them have been dealt by many authors [6-9]. A simple classification of the more important wet, gravity concentration methods/equipments is:

1. Dense medium vessels
2. Jig washers
3. Dense medium cyclones
4. Hydrocyclone
5. Concentrating Tables.

Dense medium vessels and jig washers are normally used for the concentration of coarse coal. Palowitch and Deurbrouck [9a] have described the dense medium process, the separator design, the various kinds of equipment available and the advantages of dense medium processes over other coal cleaning processes. A major portion of the coals is washed by dense medium processes, because of the following characteristics of this process:

1. Ability to handle a wide range of sizes
2. Ability to make sharp separations at any density within the normal range, even in the presence of high percentages of the feed in the range of ± 0.1 density units.

A major disadvantage is that the fine sizes cannot be treated, because they decrease the density of the medium and cannot be recovered from the sand (suspension material) by screening.

The unit operation of jigging, the different types of jigs used and the design of Baum-jig have been given by Lovell [9b]. Jigs are employed to clean either sized or unsized coal; in a few instances they have been used to treat in one operation all sizes from dust up to 6 or even 8 inches. When such a wide size range is employed, the cleaned product may meet the market requirements, but the efficiency with which some of the individual sizes are treated, is

necessarily limited. Jig cleaning efficiency tends to decrease with the smaller sizes and tends to clean best at higher densities as size decreases. When a very broad size range is cleaned by a jig, the efficiency of separation decreases with a decrease in average size. According to Yancey and Geer, the recovery efficiency was nearly as good as attained with heavy media process.

The cyclones and concentrating tables are mainly used for cleaning of fine coal. Sokaski, Geer and Yancey [9c] have described the theory, flowsheet, description and performance of dense medium cyclones and hydrocyclone. In general, the dense medium cyclone effects a sharper separation between coal and impurity than can be obtained in other types of cleaners handling the same size range.

As of now, cyclones are used to treat a comparatively narrow size range, typically 3/8 or 1/4 inch to 1/2 mm. Therefore, little information on how various sizes behave in the cyclone is available. It would be however expected that coarse coal would be separated more sharply than fine coal. When cleaning is performed at a high density setting, the superior sharpness of separation accomplished in the cyclone does not greatly improve the recovery efficiency and the economics of the operation. However, if the separation must be carried out at a low density, cyclone alone can produce washed coal of required sulphur or ash content, at higher efficiency.

The separations obtained in a hydrocyclone are not nearly as sharp as those that are characteristic of the dense medium cyclone. Consequently hydrocyclones are not applicable for difficult to clean coals or separation at low density. The hydrocyclone could especially be suited for treating minus 28-mesh coal, more so if the coal is not amenable to flotation. The hydrocyclone is reported to be superior to flotation for lowering the sulphur content of the washed coal, if iron pyrite is present in the feed.

Deurbrouck and Palowitch [9d] have described the principle of tabling processes, operating conditions and their performance characteristics. The concentrating table cleans the fine particles much more efficiently than either hydrocyclones or the fine coal jig (feldspar jig). However, minus 200-mesh material was found not responding to upgrading by tabling.

Using the flow-sheet of Bhojudih washery, located in the eastern part of Jharia coal field, Gokale and Rao [10] have illustrated, how the different cleaning processes are combined in a coal washery. Here coal is crushed to minus 3-inch size and screened on 1-inch screen. The minus 3-inch plus 1-inch fraction is cleaned by heavy media separation and the minus 1-inch fraction is washed in baum jigs. The sinks of heavy media and the jigs are then crushed to minus 1/2 - inch and washed in dense media cyclones.

Based on the data for various schemes of washing in vogue at different washeries as compiled by Chakravarti and Moritra, Gokale and Rao observe the following points:

1. The accuracy of separation at any predetermined density within the range of 1.25 - 2.50 and continuous maintenance of preselected value of density within ± 0.005 of its value, are the salient features of dense medium processes. The additional qualifications of heavy media separation are its ability to separate at one or more predetermined densities and its capacity to treat a larger size range of coal, besides its low cost, flexibility, and accuracy of control.
2. Baum-jigs are employed where initial separation of shales from coals is required. The separation is effected at a density between 1.70 and 1.80.
3. High ash content and inferior coals require the flotation treatment.
4. The dense medium cyclones can take care of the finer size (less than 1.25 cms in size) coals of difficult washing characteristics, with an optimum recovery.

2.3 THE PERFORMANCE CRITERIA

It is evident that the selection of the best process flow for a given run-of-mine coal requires a careful study wherein many conflicting factors must be weighed. The cost of a detailed investigation is well repaid capital investment,

in higher recoveries, in flexibility, and in the ease of operation and maintenance. In order to compare the different cleaning operations, the performance of coal cleaning equipment or kinds of coal, and to forecast the cleaning results we need a suitable performance criterion.

2.4 TYPES OF PERFORMANCE CRITERIA

Geer and Yancey [11] have classified the various performance criteria according to the degree to which they are dependent on the density composition of the raw coal, namely directly dependent, indirectly dependent and independent criteria.

The yield and ash content of the washed coal are two performance factors of direct and immediate interest. These two factors are directly dependent on the density composition of the raw coal treated and the functioning of the equipment. The continuous variation in the amount of impurity in the raw coal makes it impossible to tell whether a reduction in yield or an increase in the ash content results from any malfunction or misadjustment of the cleaning equipment. As such these performance factors are not suitable for comparing the performance of different plants, because no two plant feeds are the same.

The important performance criteria, that are indirectly dependent on the density composition of raw coal are:

1. Efficiency formulas
2. Misplaced material concept, and
3. Ash error and Yield error.

The well known efficiency formula given by Fraser and Yancey is,

$$\text{Efficiency} = \frac{\text{Yield of washed coal}}{\text{Yield of float coal of same ash content}} \times 100$$

This type of efficiency formula has a drawback of giving a value of 100, when no impurity is removed. In pneumatic cleaning equipments impurities finer than 28-mesh size are not removed. So for such fine size raw coal, the efficiency becomes 100. To check such drawbacks, ash reduction must be considered along with efficiency. Satisfactory performance then necessitates both high efficiency and the required ash content in the washed coal. Also to account for the coal that is freed by degradation during the washing process, one has to use calculated feed in the efficiency formulas.

'Misplaced material' is the sum of the sink in the washed coal and the float in the refuse, generally expressed as a percentage of the raw coal. Although the 'misplaced material' concept is simple to understand, it does not take into account the quality of the misplaced material. It does not relate directly to the all important factors of yield and ash content.

Ash error is the numerical difference between the actual and theoretical ash contents of washed coal at the yield of washed coal obtained. It is a direct measurement of the impairment on account of ash content. Yield error is the difference between the yield of coal actually obtained and the theoretical yield at the ash content of the washed coal. It expresses the loss in yield. The authors [11] have given the general relationship between efficiency, misplaced material, ash error and yield error, in the form of a tabulated data. The restrictions on the applicability of these directly and indirectly dependent criteria are stated as follows:

'Equipments treating coals of substantially similar density compositions or operating at substantially same densities of separation alone can be compared on the basis of these criteria.'

2.5 DISTRIBUTION OR SEPARATION (TRONP) CURVE

The type of separation between coal and impurity obtained in actual practice is illustrated graphically in Fig. 2.1. Coal of low density and impurity of high density report largely or entirely to their proper products. As the density of separation is approached, more and more material reports to the improper product. The infinitesimal increment of density that is divided equally between the washed coal and refuse is defined as the density of separation.

Tromp observed that the curve in Fig.2.1, which has the shape of a crude Gaussian error distribution, is governed by the laws of probability. Also, if the percentage of recoveries of washed coal are plotted against the mean densities of the density fraction, the type of curve in Figure 2.2 is obtained. The curve in Figure 2.2 has many names such as Tromp curve, distribution curve, separation and recovery curve. The distribution curve in Figure 2.2 can also be obtained by rotating the left-hand limb of curve in Figure 2.1. by 180° , about the 50 percentage ordinate.

When the distribution curve is plotted on either log probability or arithmetic probability grid, one will occasionally get a straight line plot. The advantages inherent in a straight-line plot of this kind are:

1. The slope of the line is a measure of sharpness of separation. Steeper the slope, sharper is the classification.
2. The slope and the specific gravity of separation combine to characterize the complete curve.

However, in practice, many distribution curves do not exhibit a straight line throughout the full range on log normal or normal plot.

As stressed by Gottfried [12], distribution curve is a plot of the weight per cent of feed reporting to clean coal, $f(d)$, as a function of density, d . The yield of clean coal, Y is,

$$Y = \frac{\int_0^{d_1} f(d) m(d) dd}{\int_0^{d_1} m(d) dd}$$

Where $m(d)$ represents the feed rate of material having density d and d_1 represents the highest density value of the feed material.

The density of the material in the raw feed that is divided equally between the clean coal and refuse is defined as the density of separation, d_s . In otherwords, it is the value of density corresponding to $f(d) = 50$. By making appropriate physical adjustments in a coal washing machine, the value of the density of separation d_s can be increased or decreased, thus shifting the entire distribution curve to the right or left.

Gottfried and Jacobsen [13] have discussed the distribution curve for a theoretically perfect separation and an actual separation case as in Figure 2.2. The shaded area, called error area, in Figure 2.2 is a measure of the difference between the actual and theoretically perfect separation. The error area approaches zero as the actual distribution curve approaches the theoretical, perfect classification. Error area is dimensionless and ranges from as low as about 10 for good dense medium operation to over 100 for some inferior table and jig operation.

Another measure of the distribution curve called 'Probable error' also represent the sharpness with which the coal and impurity are separated. The quantity is equal to one-half the density difference between the 25 and 75 per cent ordinate values on the curve. The steeper the distribution curve, the lower the probable error. Figure 2.2 illustrates the relationship between probable error and the slope of the distribution curve.

Geer and Yancey [11] have compared the distribution data for four dense medium plants and concluded that within reasonable limits, the separation between coal and impurity is independent of the density composition of the feed. For other processes also the independent nature of the distribution curve has been established.

The size composition of the raw coal influences the distribution curve. In dense medium vessel and dense medium cyclone, coarse sizes are separated somewhat more sharply than the fine sizes. In jigs and tables this dependence is even more pronounced. The distribution curves for the coarse, intermediate and fine sizes of coal, cleaned on a concentrating table have been given by Geer and Yancey [11].

2.6 GENERALIZED (SELF PRESERVING) DISTRIBUTION CURVE:

For a given coal-cleaning equipment and a given size distribution of coal, different distribution curves as in Figure 2.3 are obtained for different settings of density of

separation. The shape of these different distribution curves are similar, because of the following factors.

For a given size distribution of coal and machine

1. Tromp curve is independent of density distribution of coal and
2. Tromp curve is independent of density of separation, $d_{0.5}$ setting.

A method for combining these different distribution curve into one generalized or self preserving curve, which will apply for any density of separation within the range of original data, is presented by Gottfried and Jacobsen [13]. Here the weight per cent of feed reporting to clean coal; $f(d)$, is plotted against the reduced density, \bar{d} . The reduced dimensionless density of separation is defined as the ratio of density to the density of separation.

$$\text{i.e. } \bar{d} = \frac{d}{d_{0.5}}$$

The resulting distribution curve is independent of the density of separation. They have shown, how the several conventional distribution curves of given coal-cleaning equipment treating particular size distribution of coal, can be represented by a single generalized distribution curve graphically. The significance of the generalized distribution curve is that it can be used with any density of separation, not only the density of separation corresponding to the given data.

The effect of size on the generalized distribution curve, the uses and range of applicability of generalized distribution curve have been well dealt by Gottfried and Jacobsen [13]. Figure 2.3 shows conventional distribution curves and Figure 2.4, the resulting generalized distribution curve.

2.7 MATHEMATICAL FORM OF DISTRIBUTION CURVE

The various attempts at mathematical representation of distribution curve have been dealt by Gottfried [12]. Tromp recognized the similarity between the distribution curve obtained for a coal cleaning device and a normal (Gaussian) distribution function. This normal distribution function is not suitable because.

1. The cumulative normal distribution function cannot be expressed in a closed form (that is, in terms of a simple algebraic formula). This is also true for log normal distribution.

2. Many coal -cleaning devices exhibit asymmetric distribution curves, whereas the normal distribution is perfectly symmetrical.

Gottfried [12] has suggested that the weibull function, an exponential type distribution function may turn out to be a better candidate for a mathematical representation of the generalized distribution curves.

1. Weibull function has several interesting characteristics, including a closed-form representation for the

cumulative (integrated) function.

2. With proper choice of parameters, it can provide a reasonably near closed-form approximation to the cumulative normal distribution function.

3. It can also be used to represent asymmetric distribution curves.

The cumulative (integrated) distribution form of Weibull frequency function is,

$$f(\bar{d}) = 100 \exp [-(\bar{d} - \bar{d}_1)^a/b] \quad (2.1)$$

Where \bar{d} is the reduced density, $f(\bar{d})$ is the per cent of feed of reduced density \bar{d} reporting to clean coal. a and b are constants. Equation (2.1) will approximate the generalized distribution curve. Since in actual practice of coal-cleaning, the maximum floated coal may not be 100 per cent but something like 98 or 99 per cent and the minimum floated may not be zero but as high as 30 or 40 per cent, equation (2.1) is modified as follows [12]:

$$f(\bar{d}) = 100 [f_0 + c \exp -(\bar{d} - \bar{d}_1)^a/b] \quad (2.2)$$

Where $f_0 + c$ is always less than or equal to 1. Applying the condition that $f(\bar{d}) = 50$, when $\bar{d} = 1$,

$$\bar{d}_1 = 1 - [b \log_e \frac{c}{0.5 - f_0}]^{1/a} \quad (2.3)$$

Hence, the number of independent parameters is 4, that is f_0 , a , b and c .

Equation (2.2) can be used to represent the generalized distribution curve, provided a, b, c and f_0 are determined for a given set of distribution data. By nonlinear regression technique Gottfried [12] computed the values of a, b, c and f_0 and tabulated them for several different cleaning vessels and a number of feed size fractions.

Although the fitted weibull functions represent the experimental data reasonably well, it has a number of disadvantages.

1. Many of the curves broke too sharply at the extreme points, that is at the knees of the curves.
2. The fitted curve often fall short of spanning the complete range namely 0-100 per cent. The disparity between the analytical and the tabular forms of the distribution data is quite severe in some curves.
3. The choice of the Weibull distribution is based on an adhoc assumption, and it is difficult to relate its 4 parameters to the underlying physical process of coal cleaning.

PERCENT TO WRONG PRODUCT

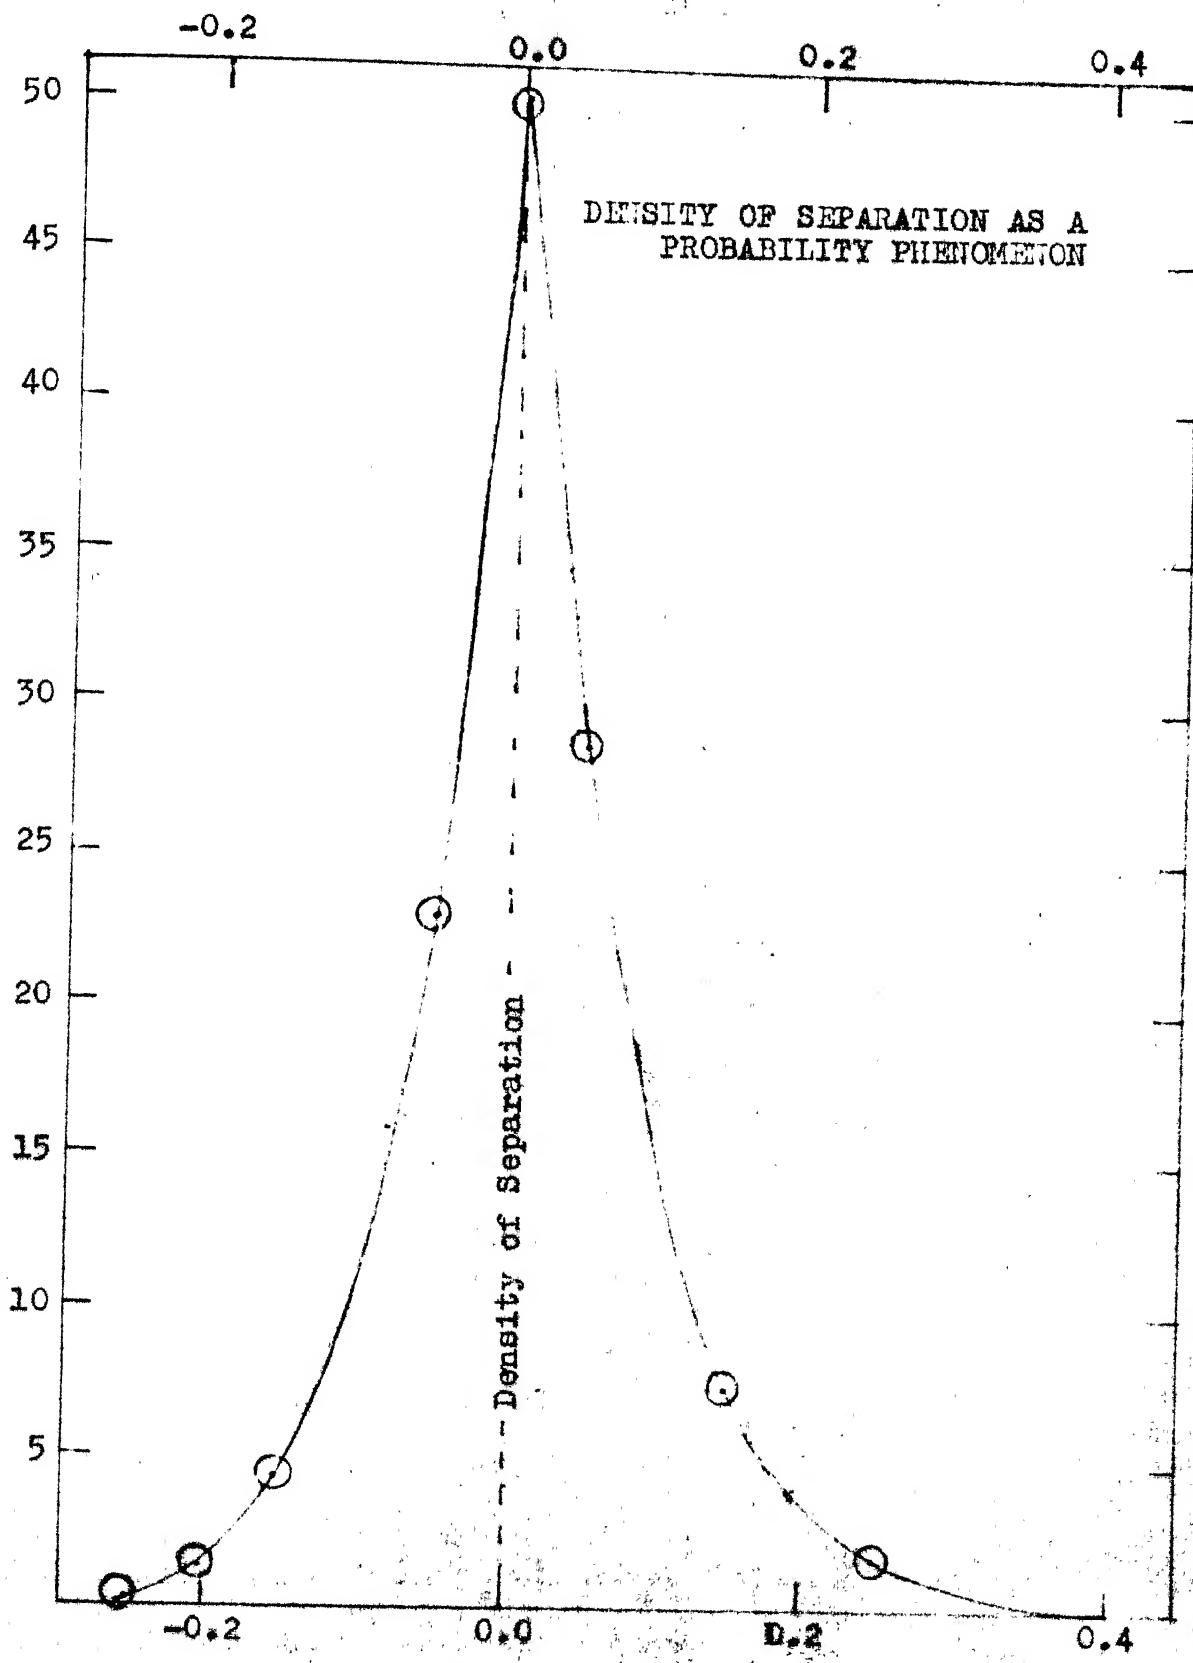


FIGURE 2.1

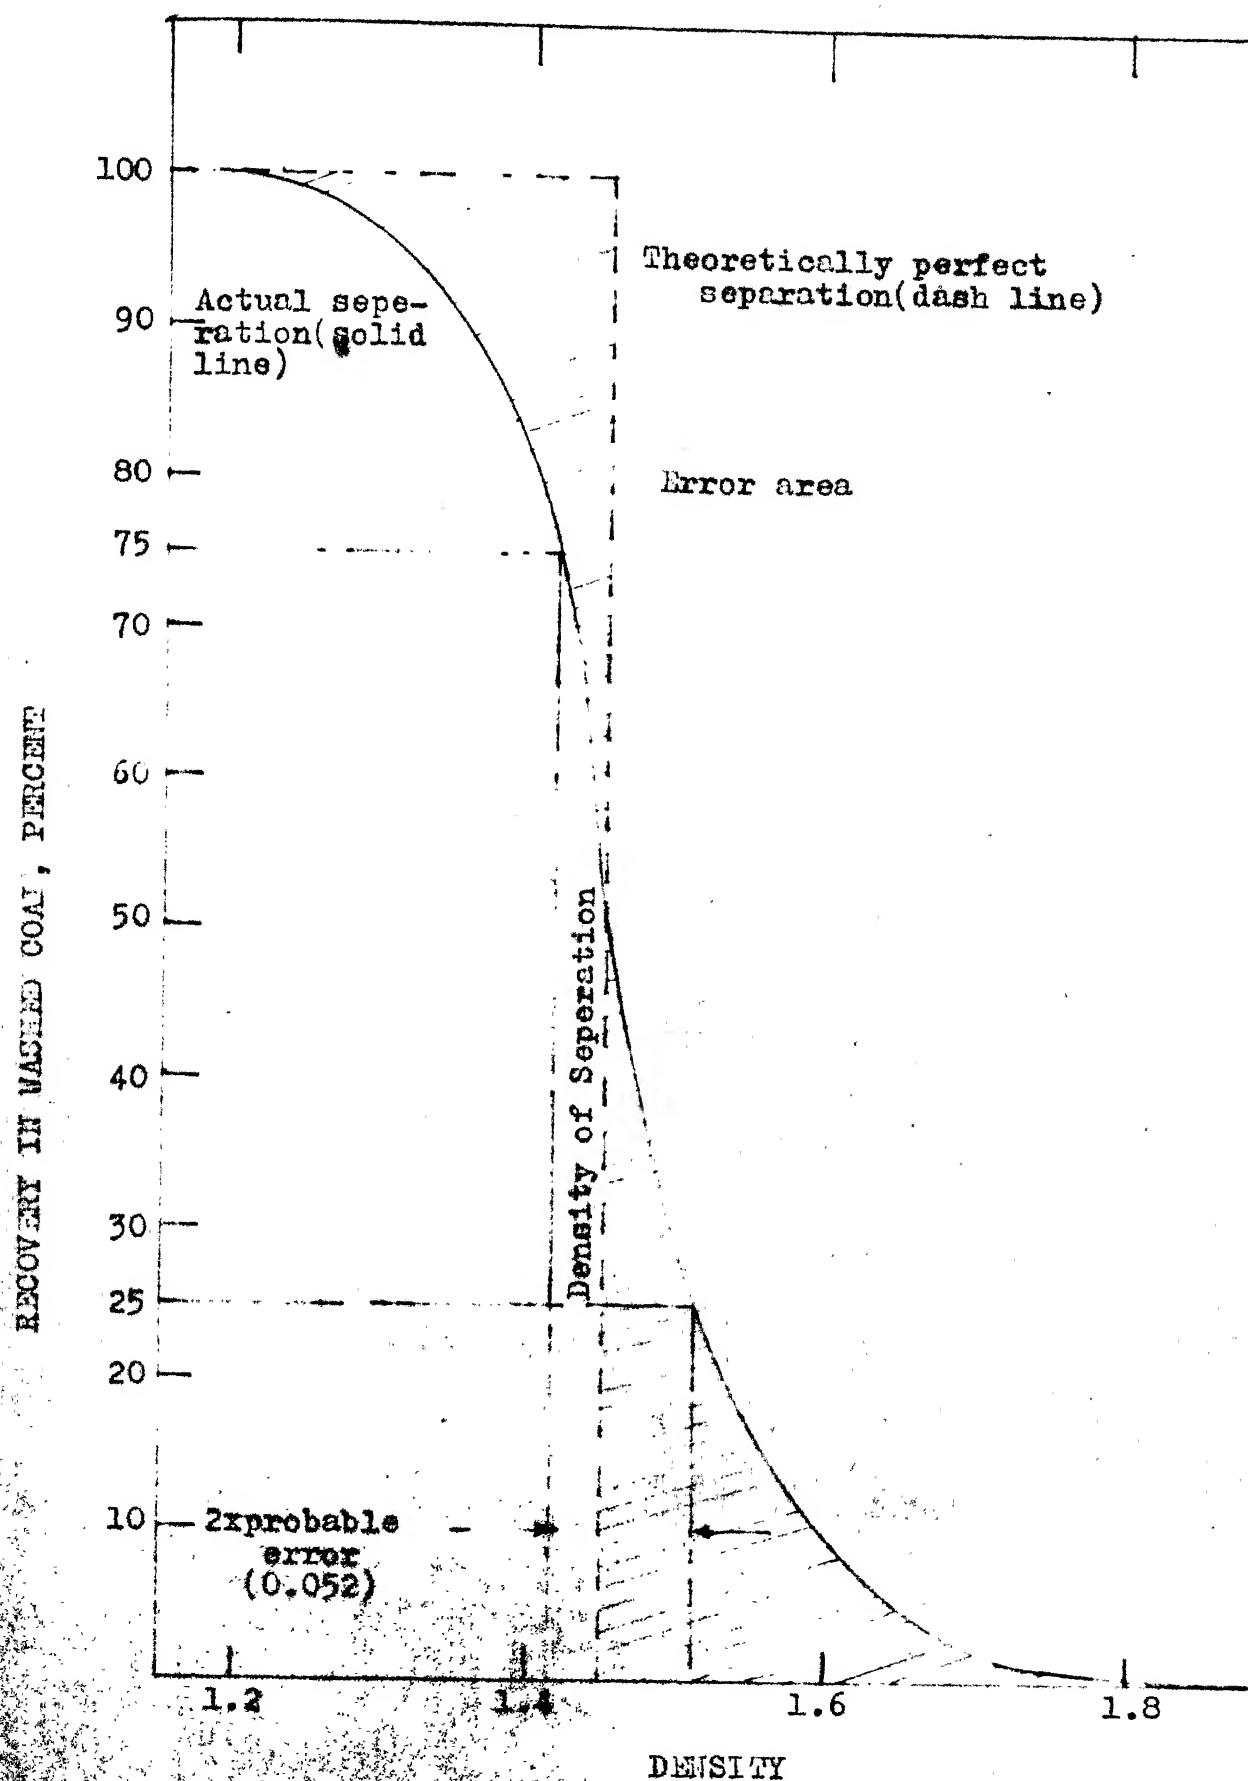


FIGURE 2.2

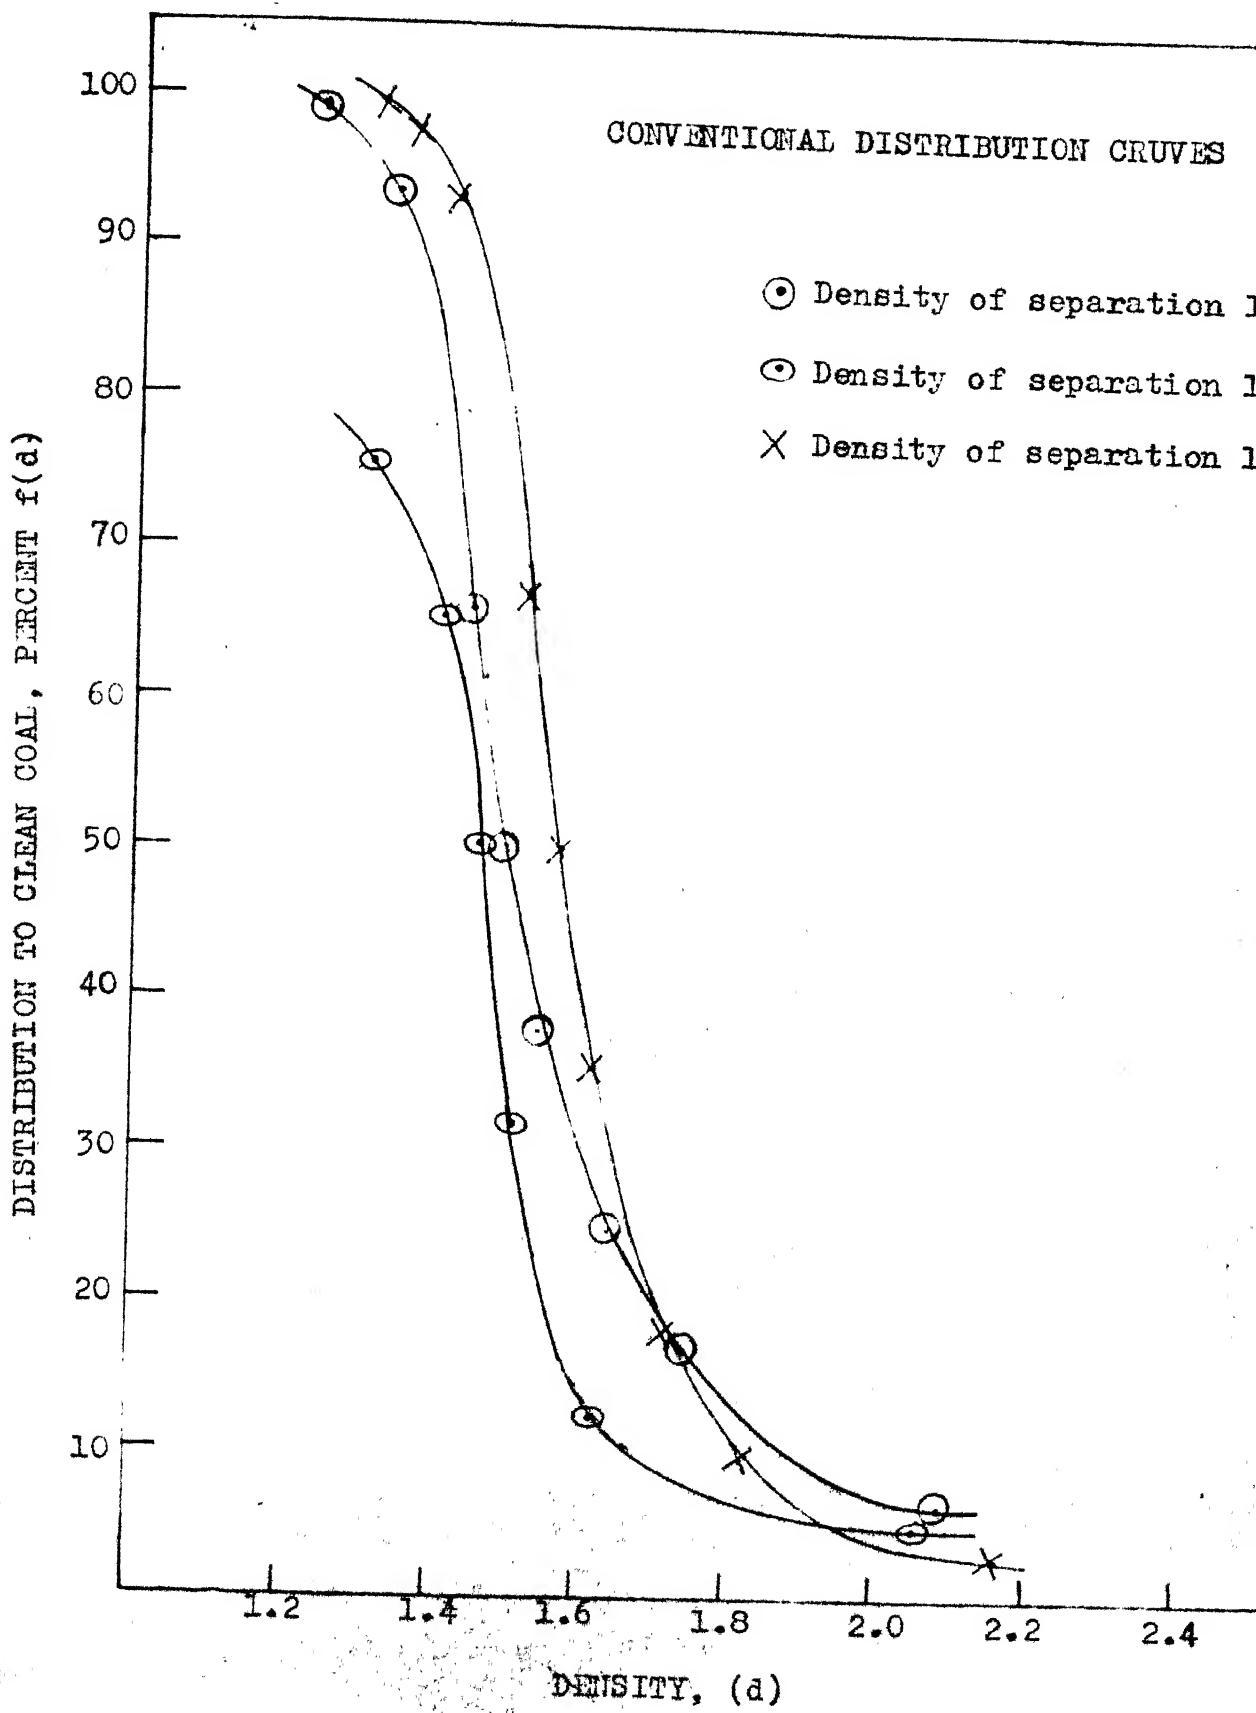


FIGURE 2.3

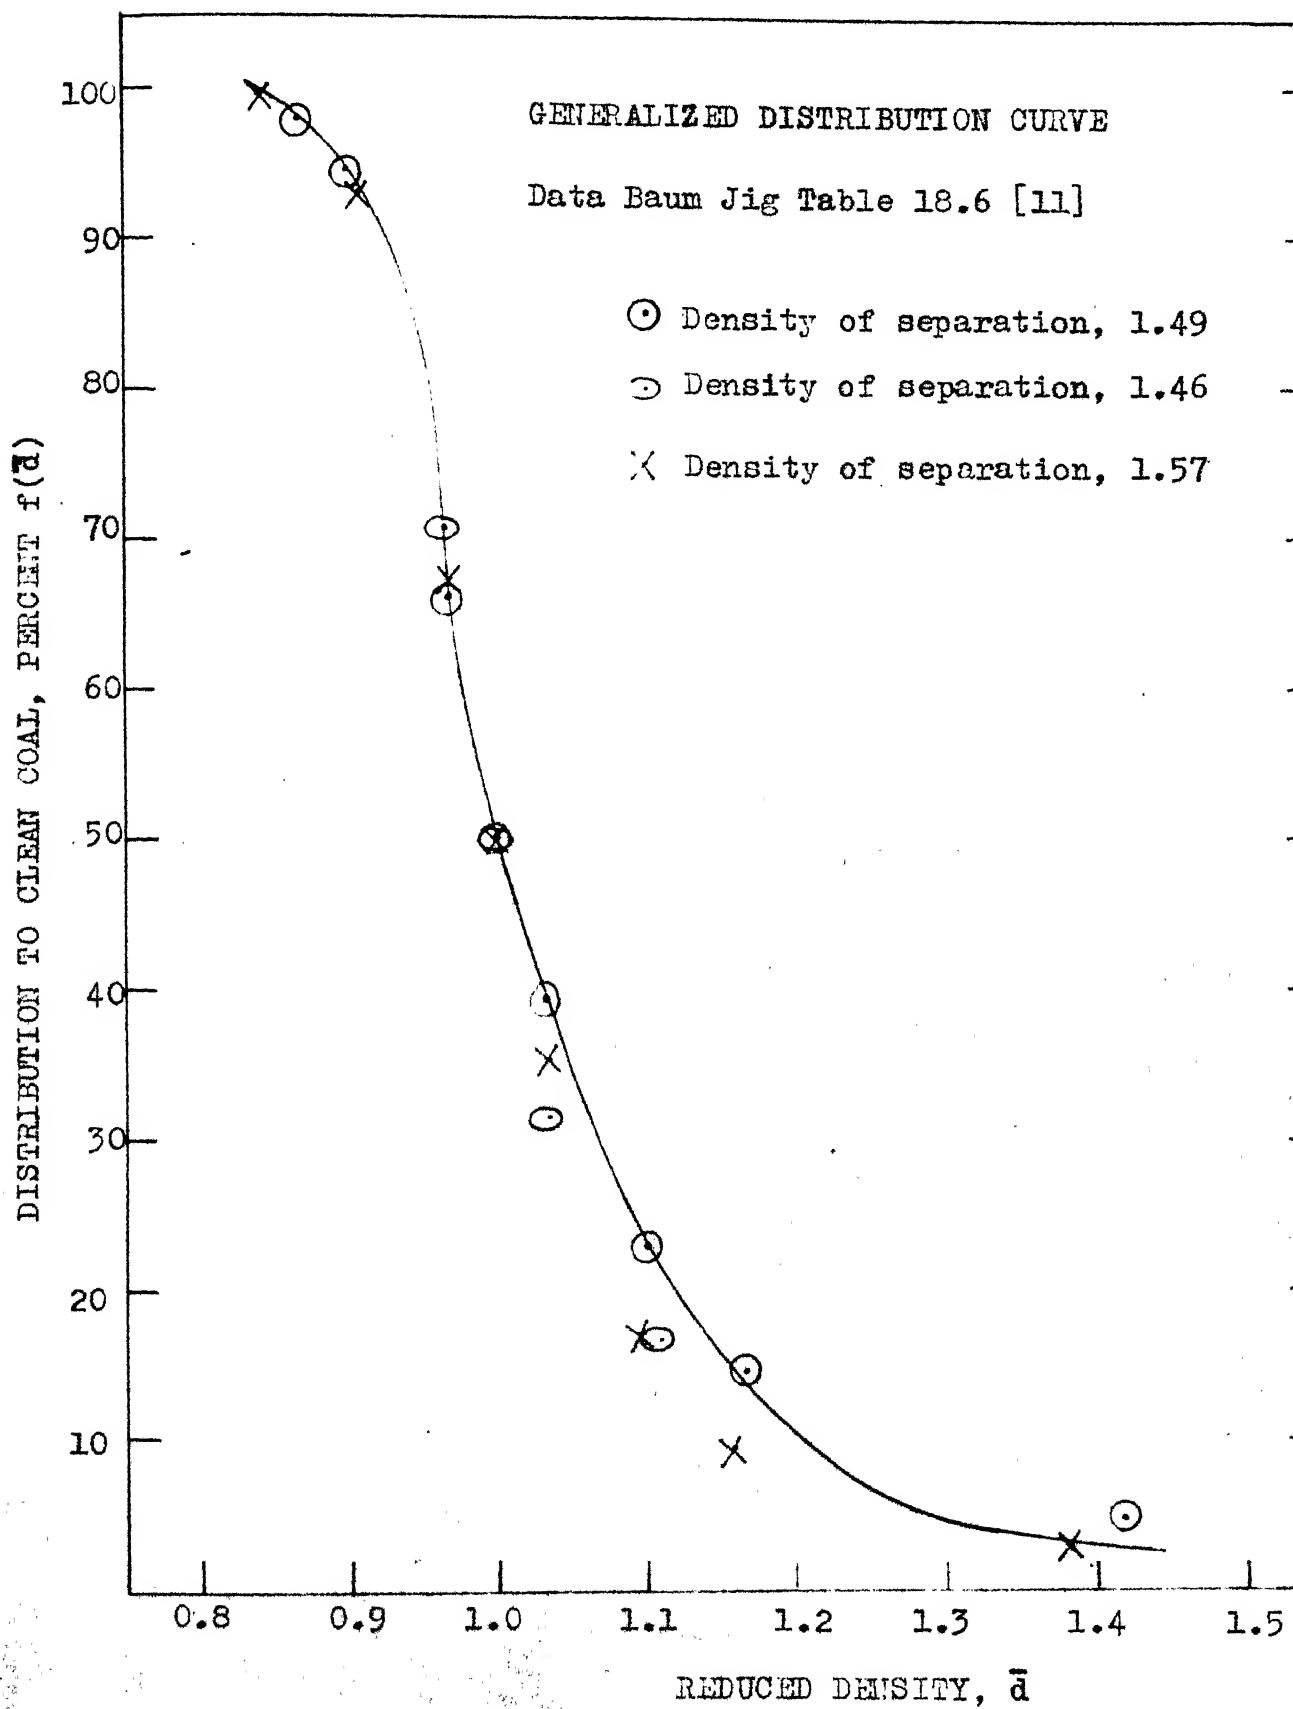


FIGURE 2.4

CHAPTER 3

OBJECTIVE

From the previous chapter on the literature review of this subject, we conclude that there is at present no formal model on coal cleaning processes that results in Tromp curve. Our objective in this work is to develop a model for a class of coal cleaning processes from a set of phenomenological concepts of the cleaning machines. We show that the model generates a distribution curve which is self-similar. That is, the separation is independent of the density composition of the raw coal feed and reduced density of separation, within reasonable limits. Further, the model is tested on computer using the rather extensive data provided by Geer and Yancey [11] and Gottfried and Jacobsen [13]. The sharpness index is estimated and analysed for five kinds of coal washing machines and a broad range of coal size fractions.

CHAPTER 4

MODEL

Most coal cleaning equipments employ a float-sink principle, based on the density difference between coal and associated impurities. Thus a typical piece of coal cleaning equipment will separate a given feed into a low density clean coal product and a high density refuse. The schematic diagram of a float-sink process is given in Figure 4.1.

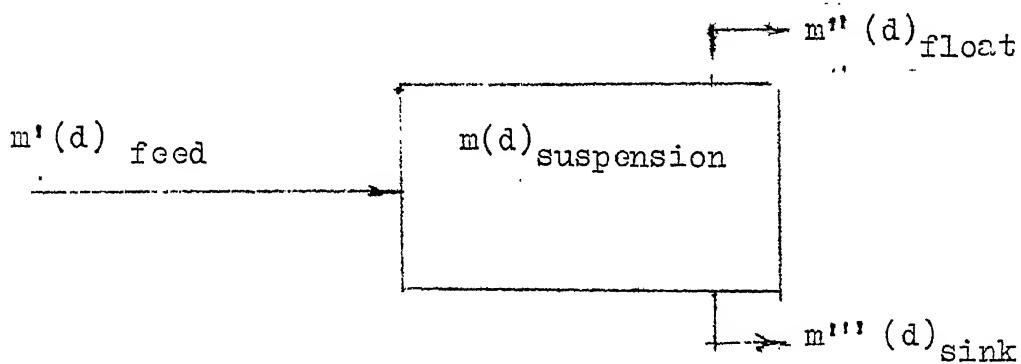


Figure 4.1

Let $m'(d)$ be the mass flow rate of the raw coal of density d that is fed into the cleaning equipment, $m''(d)$ be the mass flow rate of the washed coal, $m'''(d)$ be the mass flow rate of the impurity and $m(d)$ be the steady state mass of coal in the suspension in the machine.

Since the rate of flotation depends on (1) mass of coal that is present in the suspension (2) density of coal in the suspension and machine characteristics, we can write,

$$\begin{array}{lll} \text{Rate of float} & \propto & m(d) \\ & \propto & d^a \end{array}$$

$$\text{Therefore, Rate of float} = K^f d^a m(d)$$

Where a is some exponent and K^f is the machine constant.

Similar rate of sinking of impure material is,

$$\begin{array}{lll} \text{Rate of sink} & \propto & m(d) \\ & \propto & d^b \end{array}$$

$$\text{or, Rate of sink} = K^s m(d) d^b$$

Where K^s is also a machine constant.

At steady state, by mass balance,

Rate of feed = Rate of float + Rate of sink

$$\text{i.e. } m'(d) = K^f d^a m(d) + K^s d^b m(d)$$

$$\text{i.e. } m'(d) - K^f d^a m(d) - K^s d^b m(d) = 0 \quad (4.1)$$

$$\text{Therefore } m(d) = \frac{m'(d)_{\text{feed}}}{K^f d^a + K^s d^b} \quad (4.2)$$

$$\text{Since } m'(d)_{\text{float}} = K^f d^a m(d) \quad (4.3)$$

Substitution of equation (4.2) gives,

$$m'(d)_{\text{float}} = \frac{m'(d)_{\text{feed}}}{K^f d^a + K^s d^b} \cdot K^f d^a \quad (4.4)$$

Mass fraction recovered is,

$$f(d) = \frac{m'(d)_{\text{float}}}{m'(d)_{\text{feed}}} \quad (4.5)$$

Substituting the values of n (d)_{float}

$$f(d) = \frac{K' d^a}{K' d^a + K'' d^b} = \frac{1}{1 + K d^n} \quad (4.6)$$

where,

$$K = \frac{K''}{K'} \quad \text{and } n = b-a \quad (4.7)$$

We know at the split point, that is at the density of separation $d_{0.5}$, 50 per cent or 0.5 fraction will be recovered. That is $f(d_{0.5}) = 0.5$

Substituting this value of $f(d_{0.5})$ in the equation (4.6) we get,

$$0.5 = \frac{1}{1 + K d_{0.5}^n} \quad (4.8)$$

Therefore $K = \frac{1}{d_{0.5}^n}$ (4.9)

Substituting this value of K in equation (4.6) leads to

$$f(d) = \frac{1}{1 + \left(\frac{d}{d_{0.5}}\right)^n} \quad (4.10)$$

Let a dimensionless density \bar{d} be defined as $\bar{d} = \frac{d}{d_{0.5}}$, then equation (4.10) becomes,

$$f(\bar{d}) = \frac{1}{1 + \bar{d}^n} \quad (4.11)$$

This is the basic model of float-sink processes. Here $f(\bar{d})$ is the fraction that is recovered, which is a function of some dimensionless density \bar{d} and n is the sharpness index.

If the density of coal considered is zero, the reduced density \bar{d} is zero and the fraction recovered becomes 1; that

is all the feed will be floated. If the density considered is infinity, \bar{d} is also infinity and the fraction recovered becomes zero; that is nothing of infinite density will be floated. If the density of coal under consideration (d) is the same as that of density of separation, that is $d_{0.5}$, then $\bar{d} = \frac{d_{0.5}}{d_{0.5}} = 1$, and the fraction recovered will be 0.5.

Using the basic equation (4.11) of float-sink process, the nature of the distribution curves for various values of the sharpness index, n are determined, using the programme in Appendix 3. The computed values of $f(d)$ for different sharpness index, n are given in the same appendix. The same results have also been shown graphically in Figure 4.2. As the sharpness index, n , value increases, the distribution curve becomes steeper and approaches the ideal or theoretically perfect separation.

Note that n , the index of separation, is always greater than zero. For the case, n is infinity:

- (i) $d < d_{0.5}$, $\bar{d} < 1$ and $f(\bar{d}) = 1$
- (ii) $d > d_{0.5}$, $\bar{d} > 1$ and $f(\bar{d}) = 0$
- (iii) $d = d_{0.5}$, $\bar{d} = 1$ and $f(\bar{d}) = 0.5$

This is the ideal case for perfect separation shown in Figure 2.2.

The above basic model is based on:

- (1) Minimum density is zero,
- (2) Maximum float is 1, and

(3) Minimum float is zero.

But in actual practice the minimum density may have some value, d_1 , greater than zero, the maximum float f_u , may be less than 1, and the minimum float f_l , greater than zero (See Figure 4.4).

We now proceed to modify our model to extend its validity. First, still assuming $f_u = 1$, and $f_l = 0$, but $d_1 > 0$, we developed a 2-parameter model in the following manner.

We modify equation (4.1) as,

$$m'(d)_{\text{feed}} - K'(d-d_1)^a m(d) - K'' m(d) (d-d_1)^b = 0 \quad (4.12)$$

That is instead of considering d alone, we consider $(d-d_1)$. Hence equation (4.6) becomes

$$f(d) = \frac{1}{(1+K(d-d_1)^n)} \quad (4.13)$$

When $f(d) = 0.5$ and $d = d_{0.5}$

$$0.5 = \frac{1}{(1+K(d_{0.5}-d_1)^n)} \quad (4.14)$$

and equation (4.10) becomes

$$f(d) = \frac{1}{1 + \left(\frac{d-d_1}{d_{0.5}-d_1}\right)^n} \quad (4.15)$$

or

$$f(\bar{d}) = \frac{1}{1 + \left(\frac{\bar{d}-\bar{d}_1}{1-\bar{d}_1}\right)^n} \quad (4.16)$$

Let us note, in this 2-parameter model also fraction recovered $f(\bar{d})$ is a function of reduced density, \bar{d} and not of density d . Here also $f(\bar{d}) = 1$ when $\bar{d} = \bar{d}_1$, and $f(1) = 0.5$ and $f(\infty) = 0$.

Based on the 2-parameter model equation (4.16), the effect of variation of \bar{d}_1 , (the minimum reduced density of coal that will result in 100 per cent float) for a specific sharpness index, n is studied. The computed results for the above effect have been given in Appendix 3. The same results have been shown graphically in Figure 4.3. From Figure 4.3 it is evident that higher the \bar{d}_1 value, higher is the separation or cleaning of coal.

Now we come to the general case of a 4-parameter model, taking into account $f_u < 1$, $f_l > 0$ and $d_1 > 0$. For this purpose we make a transformation as follows:

$$\frac{f - f_l}{f_u - f_l} = \bar{f} \quad (4.17)$$

Here also $\bar{f} = 1$ when $f = f_u$ and $\bar{f} = 0$ when $f = f_l$.

Equation (4.13) becomes

$$\frac{f - f_l}{f_u - f_l} = \frac{1}{1+K(d-d_1)^n} \quad (4.18)$$

At the split point,

$$\frac{0.5 - f_l}{f_u - f_l} = \frac{1}{1+K(d_{0.5} - d_1)^n} \quad (4.19)$$

or $K = \left[\left(\frac{f_u - f_l}{0.5 - f_l} \right) - 1 \right] \frac{1}{(d_{0.5} - d_1)^n} \quad (4.20)$

Therefore equation (4.13) becomes

$$\frac{f - f_1}{f_u - f_1} = \frac{1}{1 + \left(\frac{f_u - 0.5}{0.5 - f_1} \right) \left(\frac{\bar{d} - \bar{d}_1}{1 - \bar{d}_1} \right)^n} \quad (4.21)$$

or

$$f = f(\bar{d}) = f_1 + \frac{f_u - f_1}{1 + \left(\frac{f_u - 0.5}{0.5 - f_1} \right) \left(\frac{\bar{d} - \bar{d}_1}{1 - \bar{d}_1} \right)^n} \quad (4.22)$$

Here also we note,

$$f(\bar{d}_1) = f_u$$

$$f(\infty) = f_1$$

$$f(1) = 0.5$$

and $f(\bar{d})$ depends on \bar{d} and not on d , that is the fraction recovered is a function of reduced density is never violated in the setting up of 2- and 4-parameter models.

A representation of 4 parameter model is given in Figure 4.4.

$$f(\bar{d}) = \frac{1}{1 + \bar{d}^n}$$

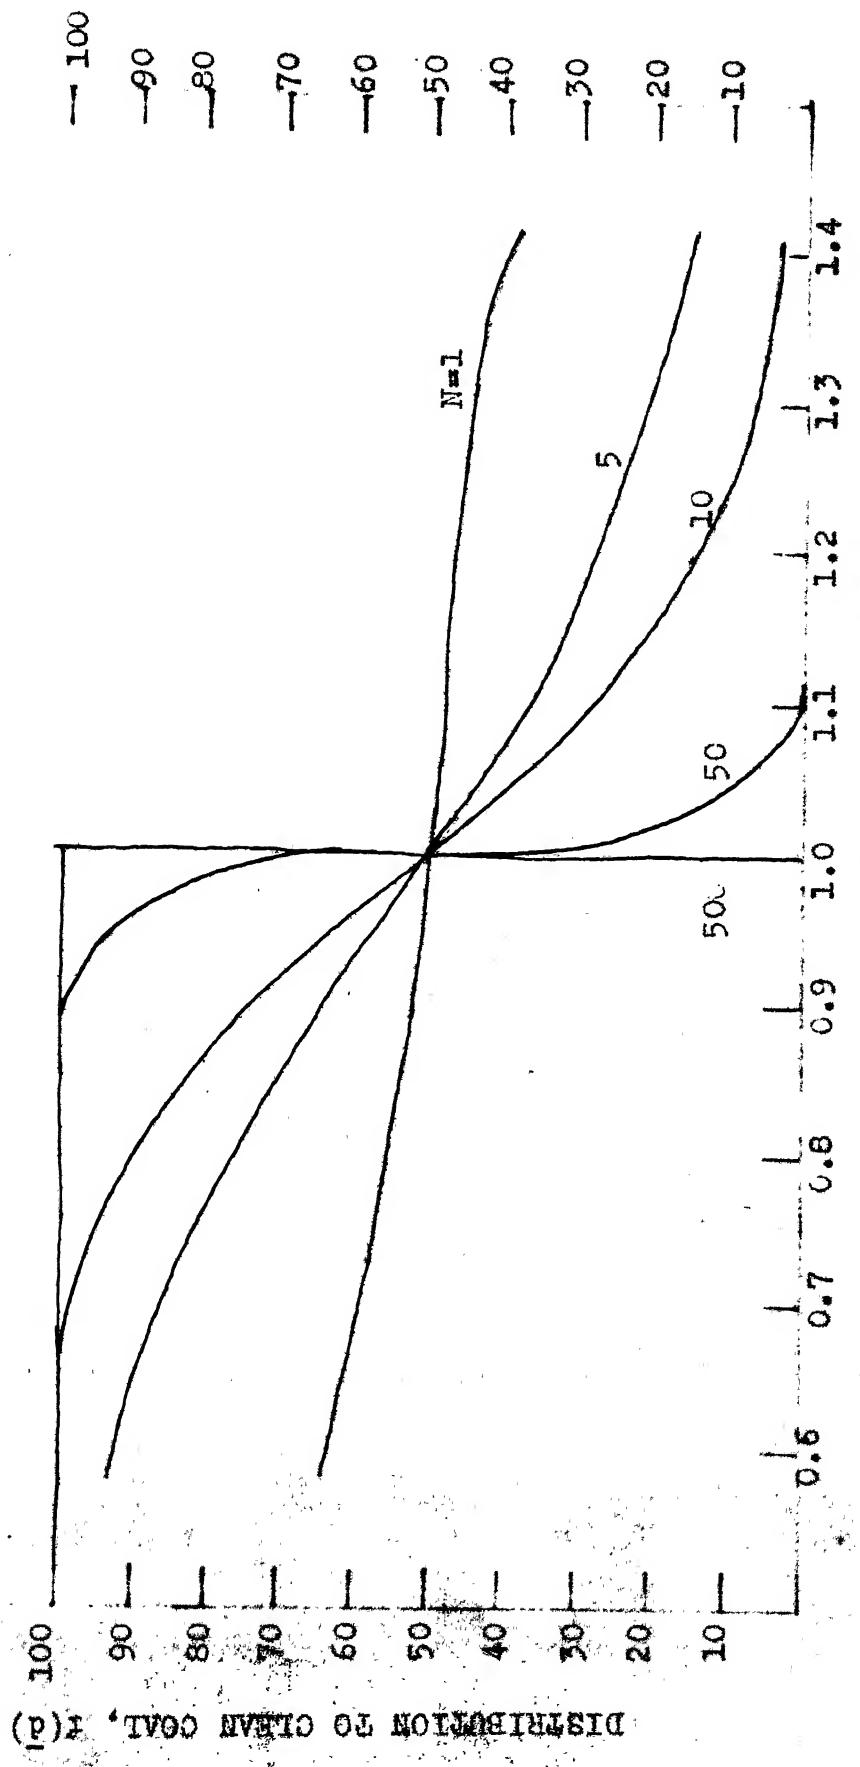


FIGURE 4.2

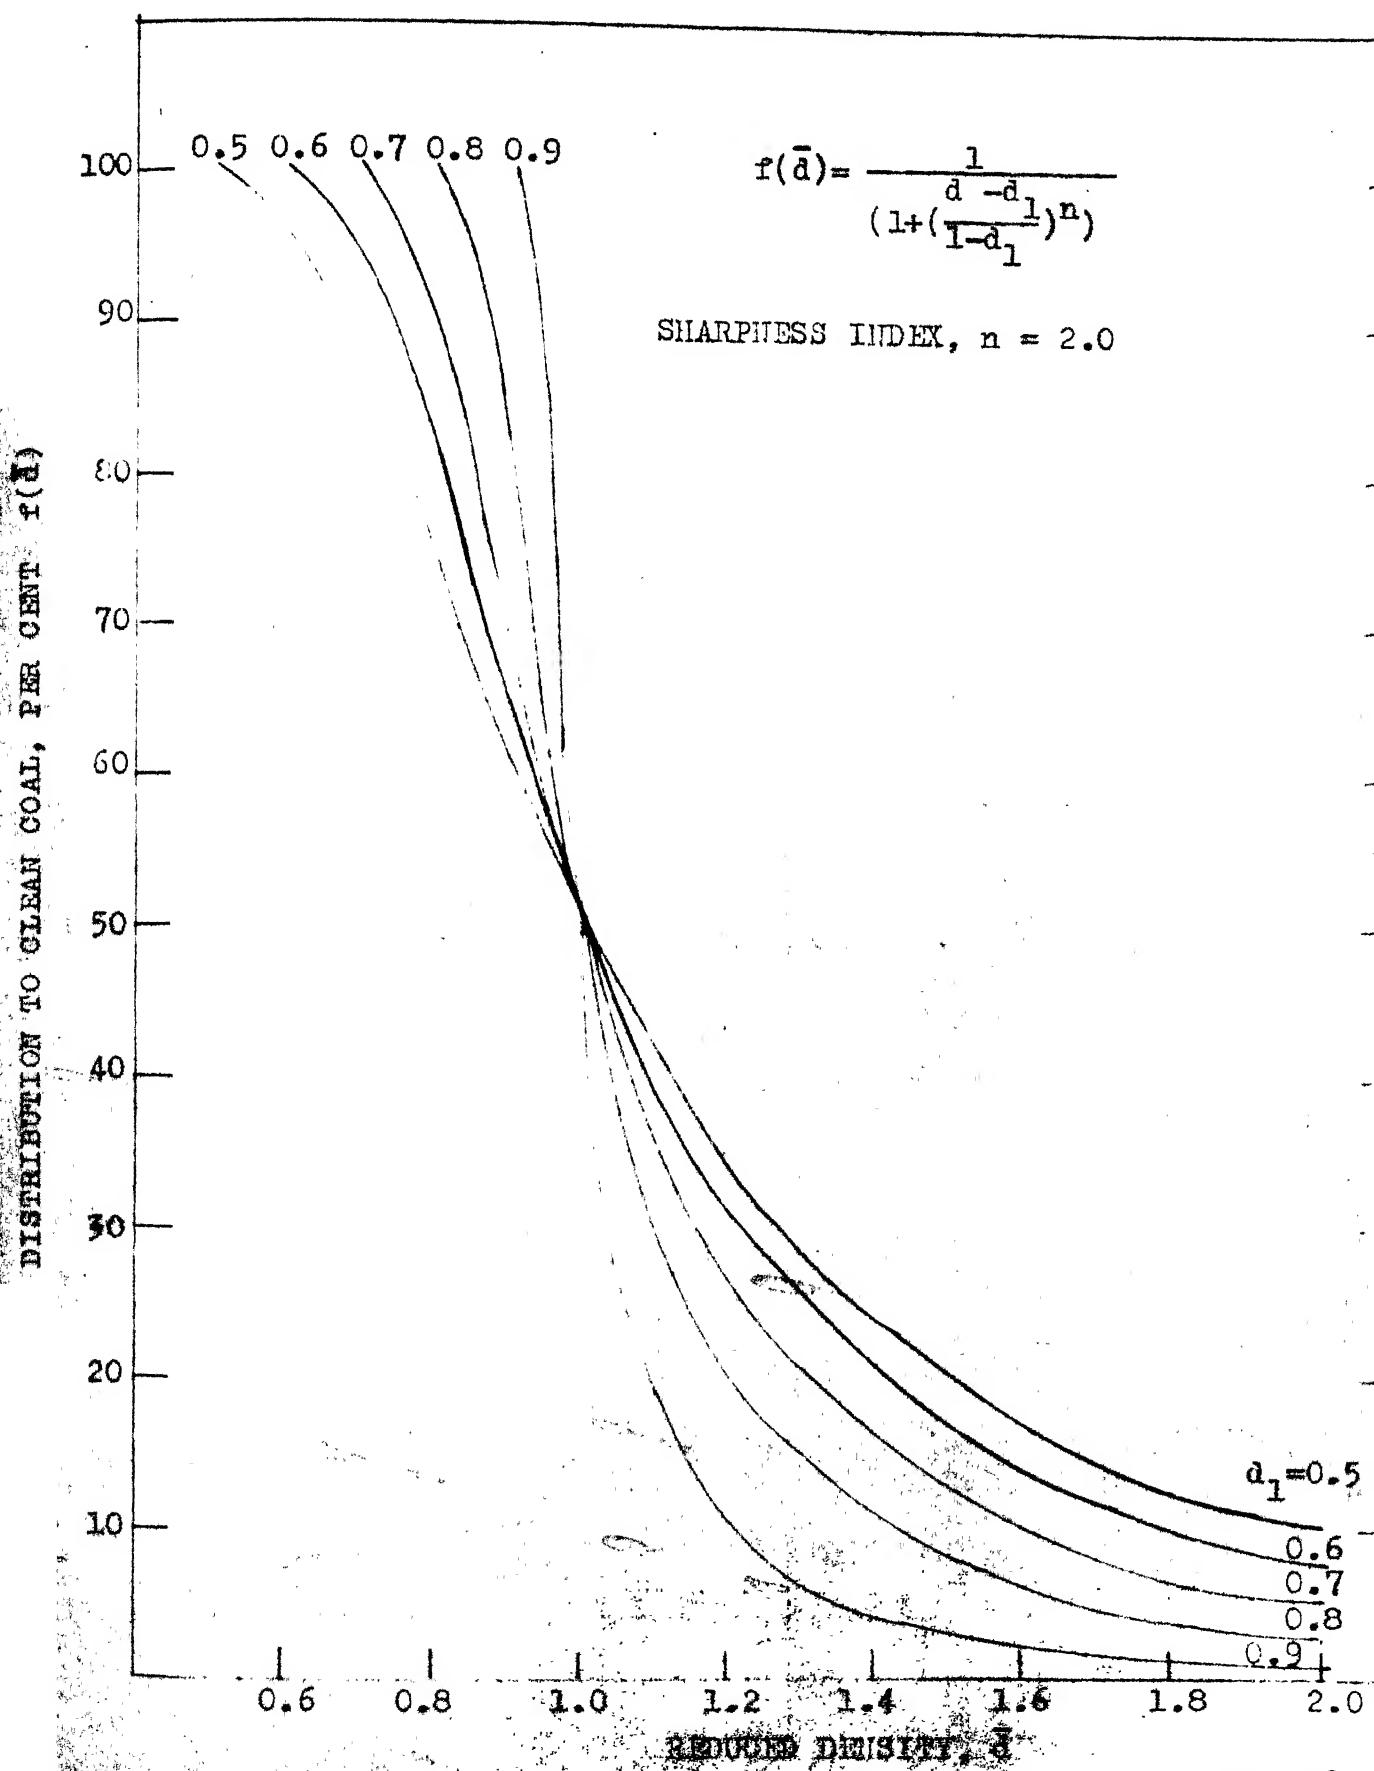


FIG.4.3

DISTRIBUTION TO CLEAN COAL, $f_u(\bar{d})$

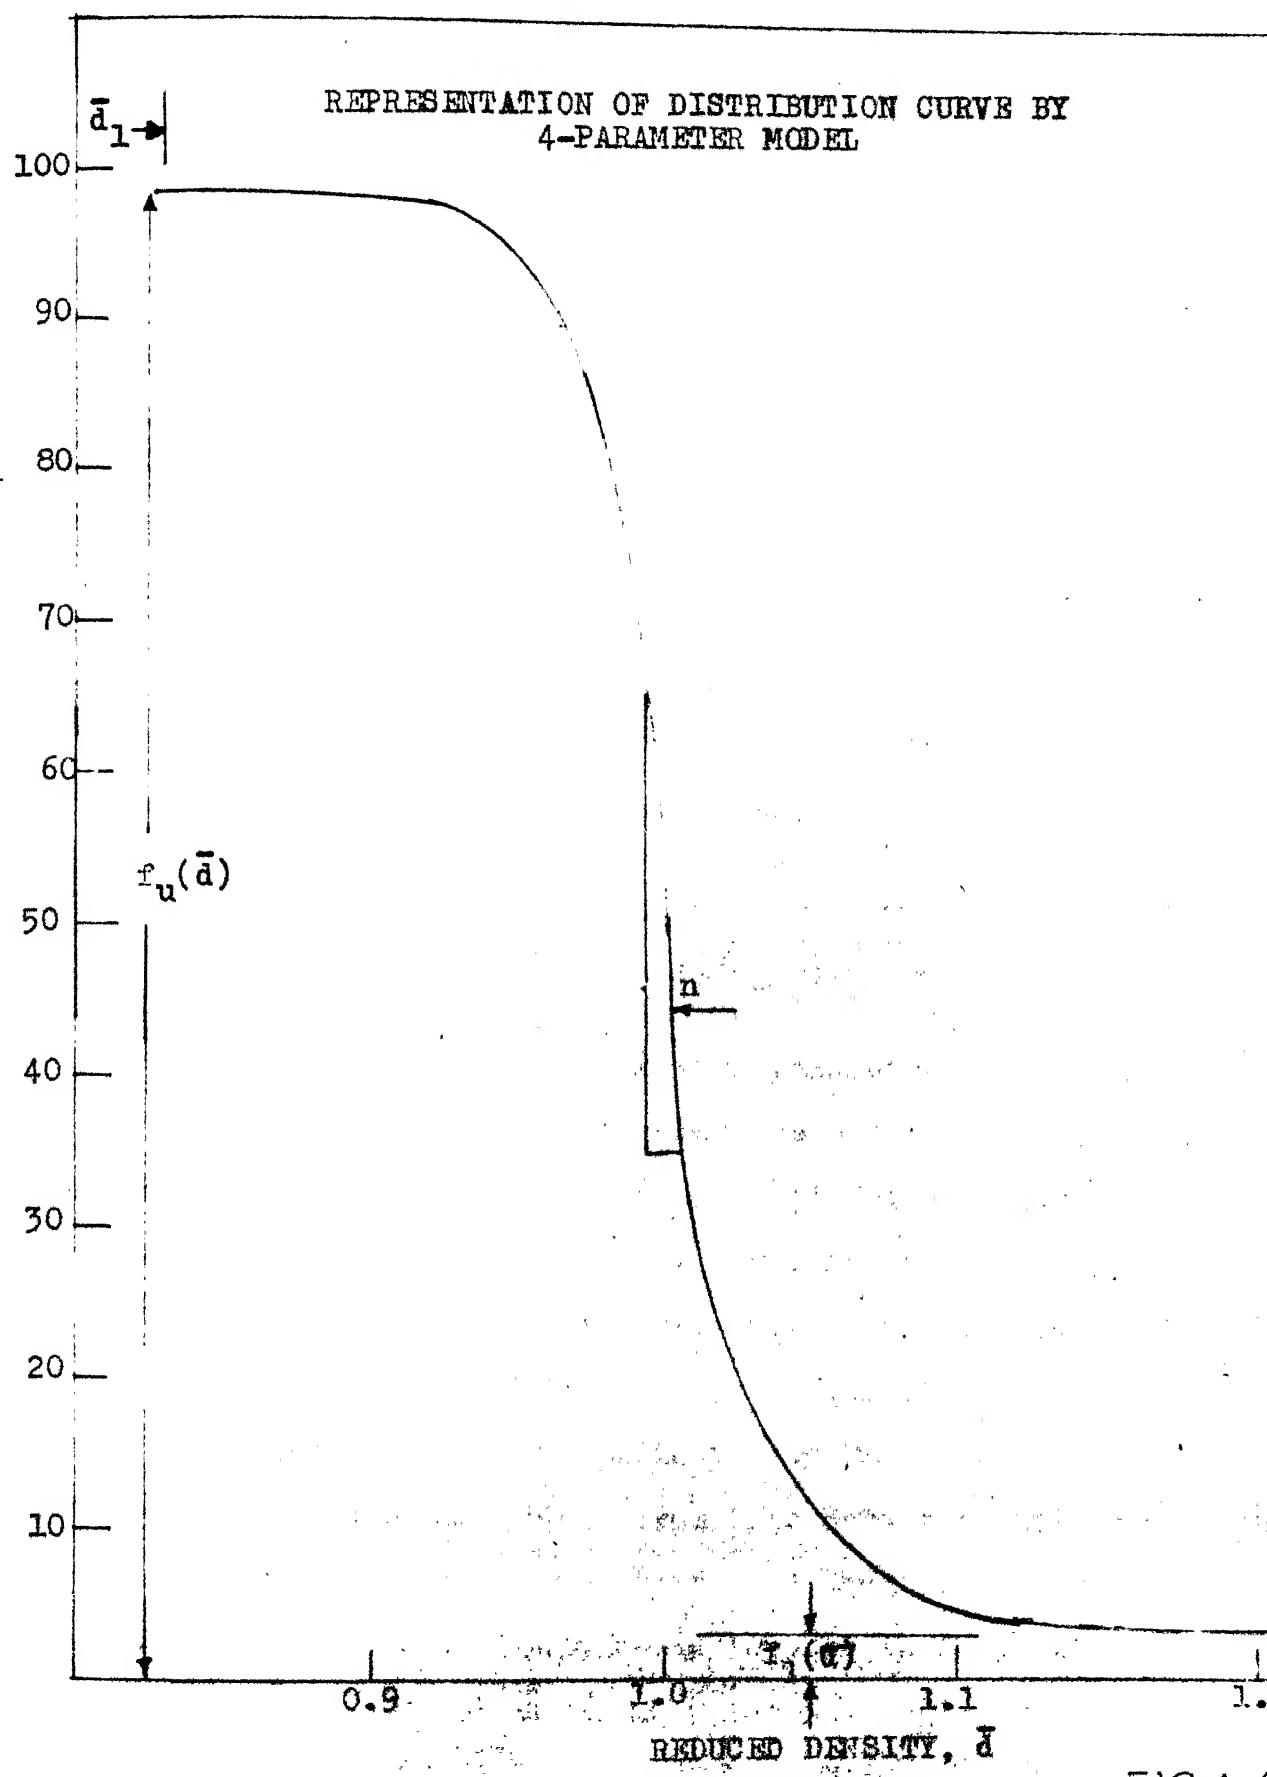


FIG. 4

CHAPTER 5

METHODOLOGY

In the Chapter 4, we have developed a 2-parameter and a 4-parameter model for the analysis of coal cleaning operation. The 2-parameter model is

$$f(\bar{d}) = \frac{1}{1 + \left(\frac{\bar{d} - \bar{d}_1}{1 - \bar{d}_1}\right)^n} \quad (4.16)$$

where \bar{d}_1 and n are the two parameters that must be determined from the experimental data. The 4-parameter model is,

$$f(\bar{d}) = f_1 + \frac{f_u - f_1}{1 + \left(\frac{f_u - 0.5}{0.5 - f_1}\right) \left(\frac{\bar{d} - \bar{d}_1}{1 - \bar{d}_1}\right)^n} \quad (4.22)$$

where \bar{d}_1 , n , f_u and f_1 are the four parameters to be determined.

The parameters in our models were estimated from the rather extensive data provided by Gottfried and Jacobsen [13], where \bar{d} and $f(\bar{d})$ values for various sizes ranges of coal processed in different plants are given. The breakdown of the data are given in the following Table 5.1.

Our objective is to estimate the values of 2 and 4 parameters in the two models from this data that will represent the physical situation, such that $f(\bar{d})$ calculated using 2- or 4-parameter model should be as 'close' to $f(\bar{d})$ experimental (which is available in data) as possible.

TABLE 5.1: GENERALIZED DISTRIBUTION DATA [13]

S.No.	Equipment	Feed sizes, in.
1.	Dense medium vessel	6x4, 4x2, 2x1, 1x1/2, 1/2x1/4 and composite feed (6x1/4).
2.	Baum jig	6x $\frac{3}{8}$, 3x1 $\frac{5}{8}$, 1 $\frac{5}{8}$ x1/2, 1/2x1/4, 1/4x8 mesh, 8x14 mesh, 14x68 mesh and composite feed (6 x 48 mesh).
3.	Dense medium cyclone	3/4x1/2, 1/2x3/8, 3/8x1/4, 1/4x8mesh, 8x14 mesh, 14x28 mesh and composite feed (3/4 x 28 mesh).
4.	Hydrocyclone	1/4x4mesh, 4x8mesh, 8x4mesh, 14x28 mesh, 28x48 mesh, 48x100 mesh, 100x200 mesh and composite feed (1/4 x 200 mesh).
5.	Concentrating table	3/8x1/4, 1/4x8 mesh, 8x14 mesh, 14x28 mesh, 28x48 mesh, 48x100 mesh, 100x200 mesh and composite feed (3/8 x 200 mesh).

Following the standard procedure for parameter estimation, the objective function can be written as

$$\sum_{i=1}^n (f_i(\bar{d}) - f_i(\bar{d}))^2 \quad (5.1)$$

where $i = 1, 2, \dots, n$, and n is the number of experimental points considered. By minimizing the above objective function, we can produce the best estimate of 2 and 4 parameters in our models. The optimization techniques used for the above purpose were

1. Box complex technique [14,15]
2. Rosenbrock hill climb method [16,17]

The two methods are discussed, with flow chart and computer program, in Appendix 1 and Appendix 2 respectively.

5.1 Selection of 4-Parameter Model

For a particular coal cleaning vessel and a given size range of coal, both 2-parameter and 4-parameter models were tried. Almost all the trials indicated that the 4-parameter model reproduces the experimental results better than the 2-parameter model. Example of one such case is given in Table (5.2). So we selected the 4-parameter model for future analysis in this study.

5.2 Selection of Best Weighted Objective Function

The $f(\bar{d})$ data which ranges from 0.0 per cent to 100.0 per cent may not be very accurate at both extreme ends. To

compensate for this, the weighted objective functions were also tried, namely

$$\sum_{i=1}^n W (f_i(\bar{d}) - f_i(\bar{d}))^2 \quad (5.2)$$

where the W is the weight given as

$$W = (50 - \text{Abs}(f_i(\bar{d}) - 50))/50$$

This weight will give a value of 1 when $f_i(\bar{d}) = 50$, and a value of zero at $f_i(\bar{d}) = 0$ and 100 . That is, more weightage is given to the central portion of the data than the end points in the two tails. In some trials the extreme points were heavily weighted in order to force fit the curve in the tail region.

The weightage for the extreme points can be given by just replacing W by $(1-W)$ in the objective function. For uniform weightage throughout the experimental data points, value of unity is given for W .

The extent to which the model reproduces the experimental data was determined in terms of absolute error per data point and normalized error per data point:

$$\text{Absolute error} = \frac{\sum_{i=1}^n (f_i(\bar{d}) - f_i(\bar{d}))^2}{n}$$

$$\text{Normalized error} = \frac{\sum_{i=1}^n (f_i(\bar{d}) - f_i(\bar{d}))^2}{\sum_{i=1}^n f_i(\bar{d})} \quad n$$

Many trials conducted in this manner showed that the objective function weighted uniformly gives the best reproduction of experimental results. So, we selected uniform weight, that is no weight is imposed on any part of the distribution curve. Example of uniform weight, weighted at mid portion and weighted at extreme points were given in Table 5.3.

It was also determined that the absolute error criterion in general gave better results than normalized error criterion. Example to the effect is given in Table 5.4.

For every data set, estimation of parameter was carried out for 0-100 per cent, 1-99 per cent and 2-98 per cent range of $f(\bar{d})$. As we expected, the 2-98 per cent range gave best reproduction. Example of this is given in Table 5.5.

5.3 Selection of Rosenbrock Hill Climb Method

For the 4-parameter model, and uniformly weighted objective function, both Box Complex technique and Rosenbrock Hill Climbing Method were tried for each data set. It was found that in some cases both methods give identical results. In other cases however, for box-complex method to be successful, (i) the reflection coefficient, the expansion coefficient and the contraction co-efficient had to be properly selected, (ii) moreover the success of the method was quite sensitive to the choice of the initial guess points, and (iii) also box-complex technique took more computer time than

the Rosenbrock hill climb procedure. Consequently, Rosenbrock hill climb procedure was used for estimating the 4-parameters in our model. An example to this effect is given in Table 5.6.

The maximum and minimum values of the 4-parameters should be provided for the estimation of the 4-parameters. From the studies on nature of distribution curves for various sharpness index, n as in Appendix 3, n around 50 is found to give experimental conditions. So the range given for n is 0-100. Since \bar{d}_1 can be any value between 0 to minimum reduced density experimentally found, the range given for \bar{d}_1 is 0- \bar{d}_i when \bar{d}_i is the minimum reduced density in data for which the 4 parameters should be estimated. Also to give a wider choice, $f_u(\bar{d})$ is given a range between 50 - 100 per cent and $f_1(\bar{d})$ between 0 - 50 per cent.

Since the optimization technique used in the estimation of 4 parameters is heuristic sometimes we got too high n values and too low \bar{d}_1 values. Such unrealistic values are discarded and reasonable values of the 4 parameters were selected and were listed out in Appendix 4.

TABLE 5.2

4-POINT BLOCK ITERATING PROCEDURE

VALUES OF X AT THIS STAGE CYCLONE = COMP.FERR03/4** X 28-00541

X(1) = 0.9, X(2) = 10., X(3) = 99., X(4) = 1.0

SOLN. STG. = 0.005, E(1) = 0.005, E(2) = 0.05, E(3) = 0.01, E(4) = 0.005

4-PARAMETER MODEL

NUMBER OF FUNCTION EVALUATIONS = 134

VALUES OF X AT THIS STAGE

X(1) = 0.22117E+00

X(2) = 0.1140017E+02

DX(I)	FD(I)	FCAL	DIFF
0.8232	100.0000	100.0000	0.0000
0.8684	99.8000	100.0000	-0.2000
0.9132	99.2000	99.9576	-0.7576
0.9377	98.6000	99.3171	-0.7171
0.9474	98.0000	98.2838	-0.2838
0.9558	97.0000	96.4249	-0.5651
0.9658	96.0000	94.6093	-1.3907
0.9592	95.0000	92.1600	-2.8400
0.9411	90.0000	50.0000	0.0000
0.9230	19.7000	19.7495	-0.0495
0.9285	15.0000	15.2730	-0.2730
0.9352	11.2000	11.0206	-0.1094
0.9411	9.4000	8.3461	-1.0539
0.9515	7.5000	5.0554	-2.4345
0.9706	5.0000	2.0797	-2.9203
0.9800	3.9000	1.3561	-2.5339
0.9807	2.8000	0.5662	-2.2338
0.9471	1.7000	0.0966	-1.6034
0.2176	1.0000	0.0101	-0.9899

ABS.ERROR TS = 0.221181351E+01 NOR.ERROR TS = 0.17835928E+00

4-PARAMETER MODEL

NUMBER OF FUNCTION EVALUATIONS = 290

VALUES OF X AT THIS STAGE

X(1) = 0.822082E+00

X(2) = 0.125501E+02

X(3) = 0.998402E+02

X(4) = 0.262692E+01

DX(I)	FD(I)	FCAL	DIFF
0.8232	100.0000	99.8402	-0.1598
0.8684	99.8000	99.8402	-0.0402
0.9132	99.2000	99.8178	-0.6178
0.9377	98.6000	99.3848	-0.7848
0.9474	98.0000	98.5986	-0.5986
0.9558	97.0000	97.0916	-0.0816
0.9609	96.0000	95.5013	-0.4987
0.9658	95.0000	93.2938	-1.7062
0.9900	50.0000	50.0000	0.0000
0.9230	19.7000	19.2784	-0.4216
0.9285	15.0000	15.1061	-0.1061
0.9352	11.2000	11.3546	-0.1546
0.9411	9.4000	8.9879	-0.4121
0.9515	7.5000	6.2862	-1.2138
0.9706	5.0000	4.0010	-0.9990
0.9800	3.9000	3.4938	-0.4062
0.1007	2.8000	2.9577	0.1577
0.1471	1.7000	2.6749	0.9749
0.2176	1.0000	2.6310	1.6310

ABS.ERROR TS = 0.58967842E+00 NOR.ERROR TS = 0.16170142E+00

TABLE 5.3

PROBLEMS OF THE -COMP. REGION (1/444 X 200 X 200)

INITIAL CONDITIONS: $Y(1)=0.66, Y(2)=2.3, X(3)=22.0, X(4)=3.0$

INITIAL TURBULENCE: $E(1)=1.005, E(2)=0.05, E(3)=0.01, E(4)=0.005$

WEIGHTED LEAST SQUARES METHOD

WEIGHTED = EXTREMELY

$$X(1) = 0.6565795E+00$$

$$X(3) = 0.22560E+02$$

$$Y(2) = 0.242335E+01$$

$$Y(4) = 0.357443E+01$$

X(1)	FD(1)	FCAL	DIFF
0.650	93.6000	92.4199	-1.1801
0.720	90.3000	91.1371	0.8371
0.7720	86.3000	87.7123	1.4123
0.8200	81.2000	81.5466	0.3466
0.8610	76.1000	74.7869	-1.3131
0.8935	71.0000	68.9026	-2.0904
0.9251	50.0000	50.3000	0.0000
0.9330	45.0000	46.1013	1.1013
0.9540	43.3000	44.7877	1.4877
0.9590	39.6000	41.2054	1.6954
0.9640	35.3000	36.1926	0.8926
0.9670	30.4000	29.3042	-1.0058
0.9720	27.3000	25.7493	-1.5507
0.9750	24.4000	22.8353	-1.5647
0.9790	21.6000	20.3324	-1.2676
0.9830	18.9000	18.2301	-0.6609
0.9880	16.3000	16.4204	0.1204
0.9930	14.2000	14.8933	0.6933
0.9960	12.6000	13.6512	1.0512
1.0200	11.6000	12.5621	0.9621

$$ABS. ERROR TS = 0.13941436E+01$$

$$NOR. ERROR TS = 0.17692886E-02$$

WEIGHTED = EXTREMELY

$$X(1) = 0.656564E+00$$

$$X(3) = 0.230975E+02$$

$$Y(2) = 0.238867E+01$$

$$Y(4) = 0.234536E+01$$

X(1)	FD(1)	FCAL	DIFF
0.6850	93.6000	92.8843	-0.7157
0.7280	90.3000	91.2088	0.9088
0.7720	86.3000	87.4084	1.1084
0.8200	81.2000	81.0233	-0.1767
0.8610	76.1000	74.2600	-1.8400
0.8935	71.0000	68.4617	-2.5383
0.9000	50.0000	50.0000	0.0000
0.9251	45.0000	46.1798	1.1708
0.9340	43.3000	44.8897	1.5897
0.9590	39.6000	41.4506	1.8506
0.9640	35.3000	36.3968	1.0968
0.9670	30.4000	29.5852	-0.8048
0.9720	27.3000	25.9689	-1.3918
0.9750	24.4000	22.9361	-1.4639
0.9790	21.6000	20.3635	-1.2365
0.9830	18.9000	18.1868	-1.7132
0.9880	16.3000	16.3002	0.0002
0.9930	14.2000	14.6979	0.4979
0.9960	12.6000	13.3872	0.7872
1.0200	11.6000	12.2316	0.6316

Y(1) = 0.564 02E+01 Y(2) = 0.230268E+01
Y(3) = 0.275354E+02 Y(4) = 0.165101E+01

FCAL	FCAL	DEFE
13.600	91.2595	-0.3495
49.3000	99.7893	0.4893
46.3000	88.9539	1.7539
51.2000	82.2036	1.2036
76.1000	75.4093	-0.5907
71.0000	69.3843	-1.6157
50.0000	50.0000	0.0000
45.0000	46.9400	1.9400
43.3000	44.7117	1.4117
39.5000	41.1899	1.5899
35.3000	36.9770	0.7770
30.1000	29.3291	-1.0709
27.3000	25.7412	-1.5598
24.5000	22.8860	-1.5121
21.5000	20.4447	-1.1553
19.9000	18.3994	-0.5096
16.3000	16.6425	0.3425
14.2000	15.1620	0.2620
12.6000	13.9590	1.3590
11.5000	12.9044	1.3044

ABR. ERROR TS = 0.15520492E+01 NOR. ERROR TS = 0.23368678E-02

SOLVING FOR ASSUMED ERROR CATEGORIES

N=17 = 5.4

TIME = 0.87 MEDIAN CYCLODE = 374.00 X 172.00

Y(1)= 0.4525	X(2)= .1079000E+02	X(3)=99.18000	X(4)= 0.00500
DF(I)	FD(I)	FCAL	DTFF
0.9160	100.00	99.18	0.82
0.9550	99.70	99.12	0.58
0.9550	99.00	99.76	0.30
0.9700	98.30	97.97	0.33
0.9710	97.80	97.14	0.66
0.9740	96.40	96.74	0.38
1.0000	50.00	50.00	0.00
1.0230	8.00	7.96	0.24
1.0250	5.40	6.68	1.28
1.0280	4.00	5.15	1.15
1.0330	3.00	3.35	0.35
1.0410	2.00	1.72	0.27
1.0500	1.20	0.95	0.35
1.0520	0.60	0.41	0.16
1.0700	0.20	0.21	0.01

STANDARD DEVIATION = 0.16866196E+00
 ABSOLUTE ERROR = 0.39825551E+00
 RELATIVE ERROR = 0.24384393E-01

Y(1)= 0.4525	X(2)= .17160000E+02	X(3)=99.99000	X(4)= 0.19200
DF(I)	FD(I)	FCAL	DTFF
0.9160	100.00	99.95	0.05
0.9550	99.70	99.80	0.10
0.9550	99.00	99.04	0.04
0.9700	98.30	98.01	0.29
0.9710	97.80	96.97	0.83
0.9740	96.40	96.53	0.13
1.0000	50.00	50.00	0.00
1.0230	8.00	7.82	0.08
1.0230	5.40	5.52	1.12
1.0280	4.00	4.08	0.98
1.0330	3.00	3.20	0.20
1.0410	2.00	1.64	0.36
1.0500	1.20	0.95	0.35
1.0500	0.60	0.47	0.13
1.0700	0.20	0.32	0.12

STANDARD DEVIATION = 0.14643861E+00
 ABSOLUTE ERROR = 0.30021973E+00
 RELATIVE ERROR = 0.42150164E-01

NUMBER OF FUNCTION EVALUATIONS = 378 X(1) = 0.1, X(2) = 10.5, X(3) = 96.5, X(4) = 0.1
 X(1) = 0.005, X(2) = 0.5, X(3) = 0.01, X(4) = 0.005
 NUMBER OF FUNCTION EVALUATIONS = 378
 X(1) = 0.1, X(2) = 100.0, X(3) = 0.151, X(4) = 0.005

NUMBER OF FUNCTION EVALUATIONS = 235 X(2) = 0.199525E+02
 X(3) = 0.2675517E+02 X(4) = 0.560143E-02

DX(I)	FD(I)	FCAL	DIFF
0.3020	1.0000000	98.5561	-1.3439
0.3100	9.000000	98.6474	-0.5526
0.3200	9.900000	98.5773	-0.1227
0.3300	9.9.0000	98.4105	-0.2105
0.3400	97.3000	97.8438	-0.5498
0.3490	95.8600	97.5507	-0.7507
0.3720	95.1000	95.5701	-0.1701
0.3750	50.0000	50.0000	0.0000
0.3800	5.3000	5.3415	-0.7415
0.3830	4.4000	4.8112	-0.4112
0.3870	3.4000	3.5646	-0.1646
0.3930	2.0000	1.5076	-0.3924
0.3960	1.0000	0.5247	-0.3753
0.39750	0.5000	0.2783	-0.2217

NUMBER OF FUNCTION EVALUATIONS = 31051035E+00 NOR. ERROR TS = 0.29065136E-01

 > 1.0 % & < 99.0 % CONSIDERED

NUMBER OF FUNCTION EVALUATIONS = 1573 X(2) = 0.193301E+02
 X(3) = 0.21265E+02 X(4) = 0.934575E+00

DX(I)	FD(I)	FCAL	DIFF
0.9500	98.7000	98.3618	-0.3382
0.9560	98.2000	98.1242	-0.0758
0.9630	97.3000	97.4557	0.1557
0.9650	95.8000	95.1260	-0.3250
0.9720	95.1000	95.0822	-0.0178
0.9800	50.0000	50.0000	0.0000
0.9830	5.3000	5.5226	-0.2226
0.9830	4.4000	4.4336	-0.0336
0.9870	3.4000	3.3691	-0.0309
0.9880	2.0000	1.8191	-0.1809

NUMBER OF FUNCTION EVALUATIONS = 33533126E-01 NOR. ERROR TS = 0.10113375E-02

 > 2.0 % & < 98.0 % CONSIDERED

NUMBER OF FUNCTION EVALUATIONS = 237 X(2) = 0.111061E+02
 X(3) = 0.976599E+02 X(4) = 0.221371E+00

DX(I)	FD(I)	FCAL	DIFF
0.9630	97.3000	97.0963	-0.2037
0.9650	96.8000	96.8662	0.0662
0.9720	95.1000	95.2470	0.1470
1.0000	50.0000	50.0000	0.0000
1.0300	5.3000	5.5028	-0.2028
1.0330	4.4000	4.3743	-0.0257
1.0370	3.4000	3.2490	-0.1511

1917 5.6

Y(1)=5.0, Y(2)=5.0, Y(3)=95.0, Y(4)=2.0
 Y(5)=7.0, P01=0.005, P(2)=0.01, P(4)=0.15

卷之三

PERIOD	END PT	END L	PERC
1-100	100.0000	99.9512	-0.0388
1-150	99.7000	99.8269	0.1259
1-200	99.2000	99.1422	0.1422
1-250	99.3000	98.1943	-0.1157
1-300	97.9000	97.2050	-0.5950
1-350	95.4000	96.7834	0.3834
1-400	50.0000	50.0000	0.0000
1-450	9.9000	7.5042	-1.2058
1-500	5.4100	6.2542	0.8542
1-550	4.0000	4.7764	0.7764
1-600	3.0000	3.0059	0.9959
1-650	2.0000	1.5538	-0.3492
1-700	1.0000	0.9295	-0.2705
1-750	0.6000	0.5975	-0.0025
1-800	0.2000	0.4624	-0.2624

ANALYSIS IS 1.0E-0.27375307E+00 NOR,ERROR IS 0.12605103E+00

BOY COMPLIANCE TECHNIQUE

```

4112= 2.27179500E+02
4122= 2.87325734E+02
4132= 2.82228999E+02
4142= 2.82812554E+02

```

THEORY OF SELECTED EVALUATION 209

$\alpha(t)$	$F_0(t)$	F_{CAT}	$DTEF$
0.9460	100.00	99.80	-0.11
0.9550	99.70	99.64	-0.06
0.9650	99.00	98.71	-0.29
0.9700	98.30	97.60	-0.70
0.9730	97.80	96.53	-1.27
0.9740	96.40	95.00	-0.31
0.9800	95.00	95.00	0.00
0.9239	8.90	8.58	-2.05
0.9250	8.40	8.44	-0.28
0.9260	8.00	8.34	-0.34
0.9330	3.00	2.89	-0.11
0.9410	2.00	1.76	-0.25
0.9500	1.20	1.00	-0.40
0.9600	0.60	0.20	-0.00
0.9700	0.20	1.00	0.00

CHAPTER 6

RESULTS

The theoretical model developed in Chapter 4 for coal cleaning processes was tested on computer using the rather extensive data provided by Gottfried and Jacobsen [13]. Based on the trials reported in Chapter 5 on methodology, it was decided to use Rosenbrock hill climb method for the estimation of 4 parameters in the model. From the estimated values of the parameters for a given size of raw coal feed in a coal cleaning equipment, the absolute error, standard deviation and the range of washed coal percentage, $f(\bar{d})$ covered were computed. The mathematical representation of the distribution curves suggested recently by Gottfried [12], by Weibull function were also used to find similar absolute error, standard deviation and the range of $f(\bar{d})$ covered for the same sets of experimental data. The comparative results of both Gottfried equation and our model for all five types of coal cleaning equipment and various sizes of coal feed are given in Appendix 5. Figures 6.1 - 6.5 show the comparison between the two models.

It is evident from the above results that our model covers a wider range of washed coal percentage $f(\bar{d})$ than it is possible by Gottfried equation. Also the absolute error and standard deviation are far less in our model. Invariably even within a given range of applicability our model is found

to be better in reproducing the distribution curves. It is to be noted that in our model, unlike Gottfried equation, the distribution curves do not break sharply at the extreme points, and the disparity between the predicted and experimental points in the distributions is never very large in our model. Moreover in our model the 4 parameters have physical significance, namely,



$f_u(\bar{d})$ - Maximum washed coal percentage that can be expected for a particular size range of raw coal feed in a given coal cleaning equipment,

$f_l(\bar{d})$ - the minimum coal percentage that will be in the sink


n - the sharpness of separation


and \bar{d}_l - the minimum reduced density of the coal that will completely float in the process.

The four parameters of our coal cleaning process model have been estimated for all five types of coal cleaning equipment and all sizes of coal in the given data. The values of these parameters, the absolute error and standard deviation are given in Appendix 4. Figures 6.6 - 6.11 show the effect of feed size on sharpness index, in different coal cleaning equipments.

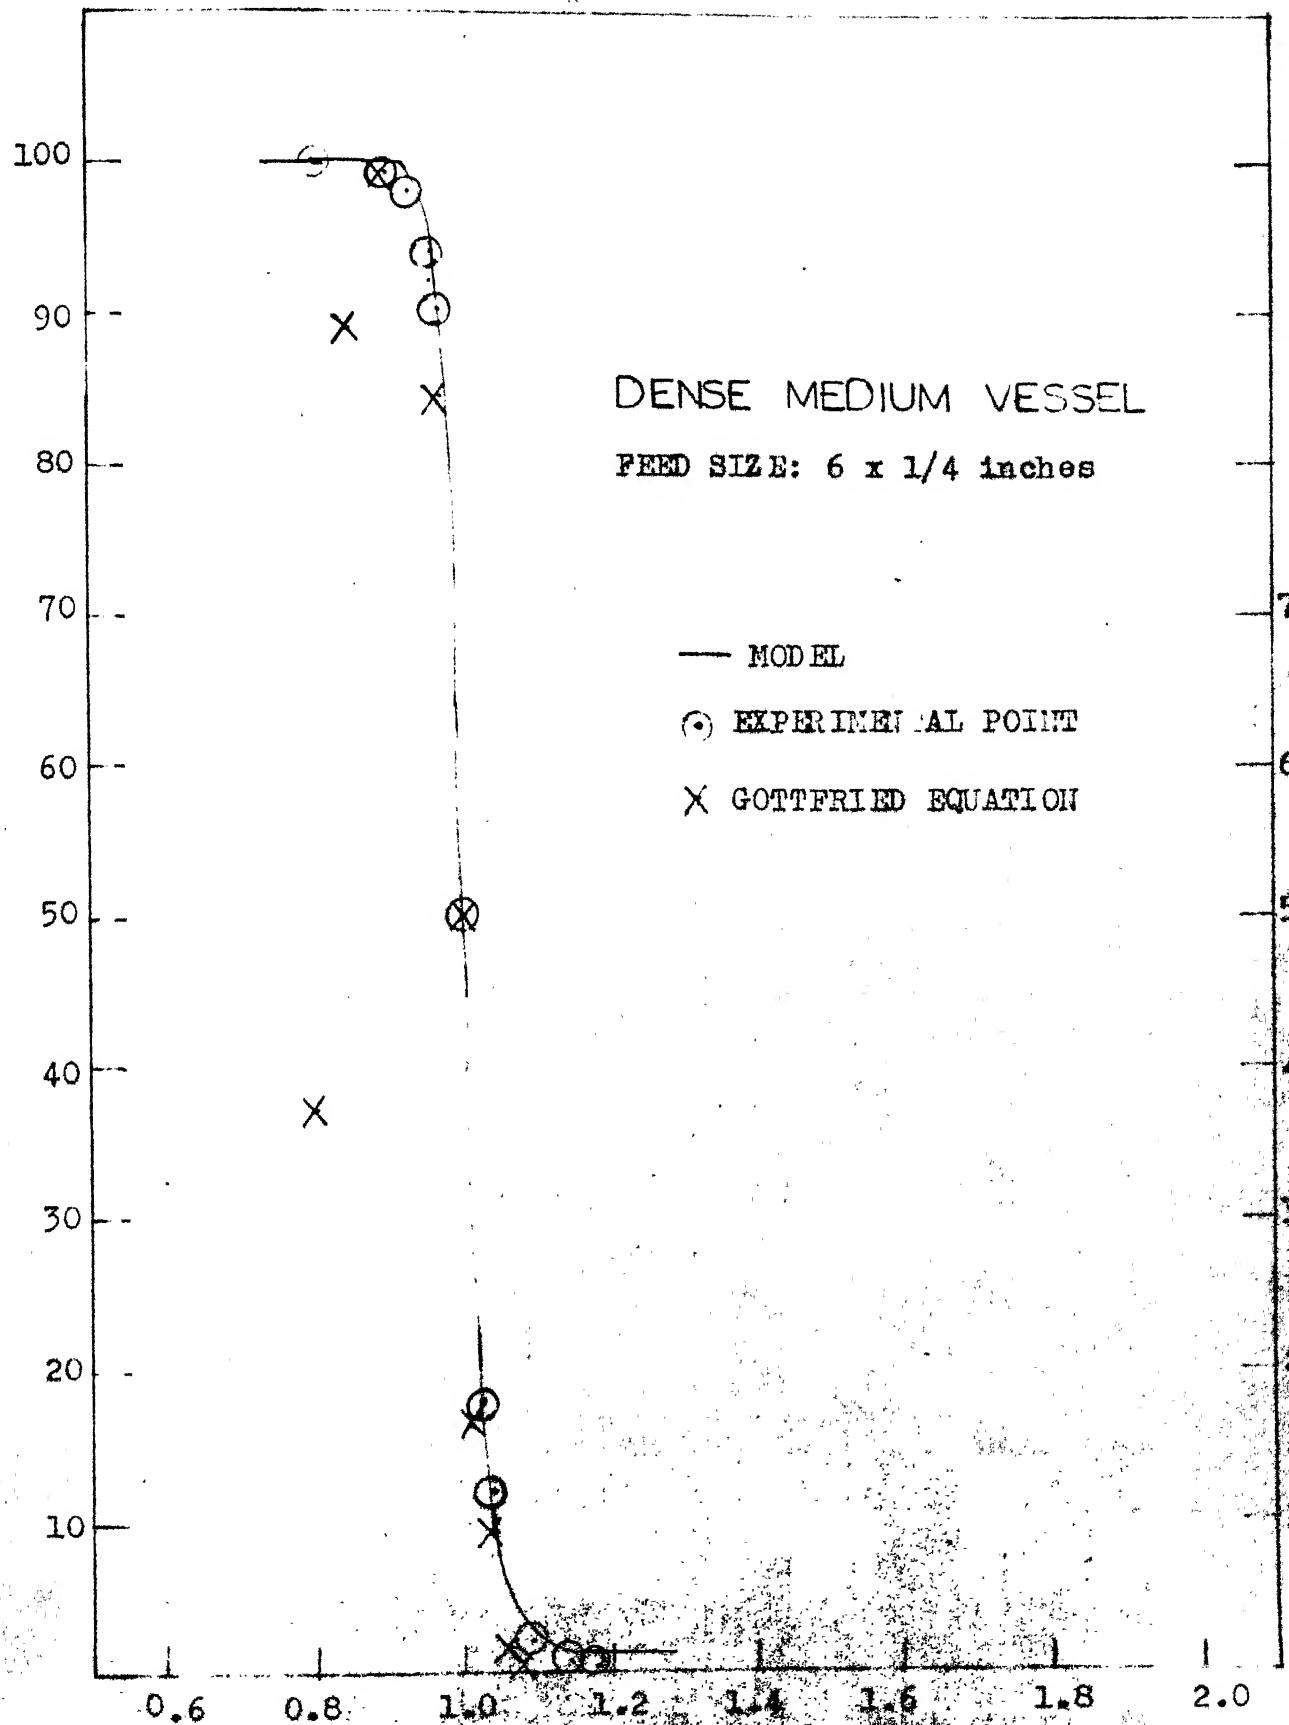



REDUCED PRICES

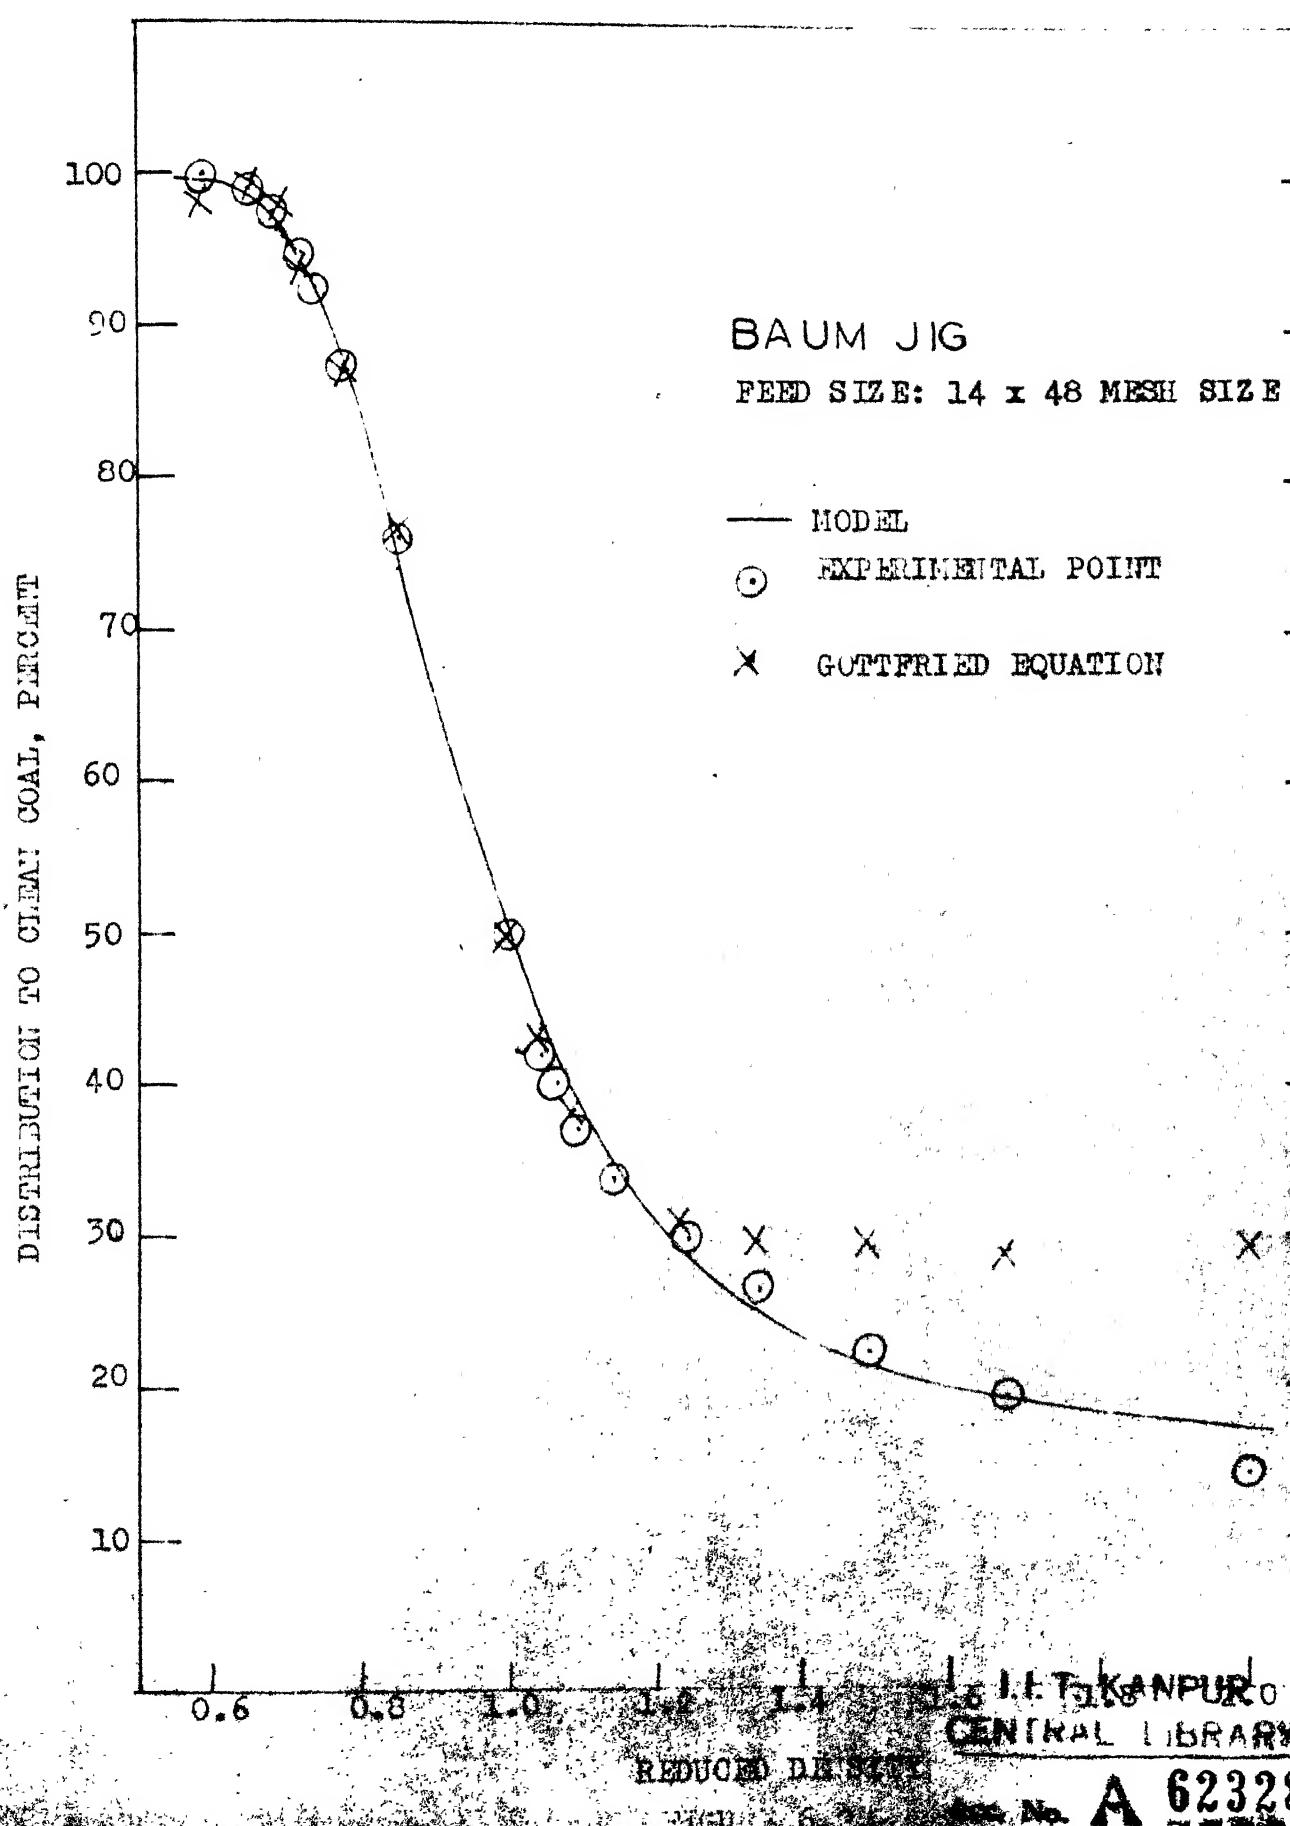

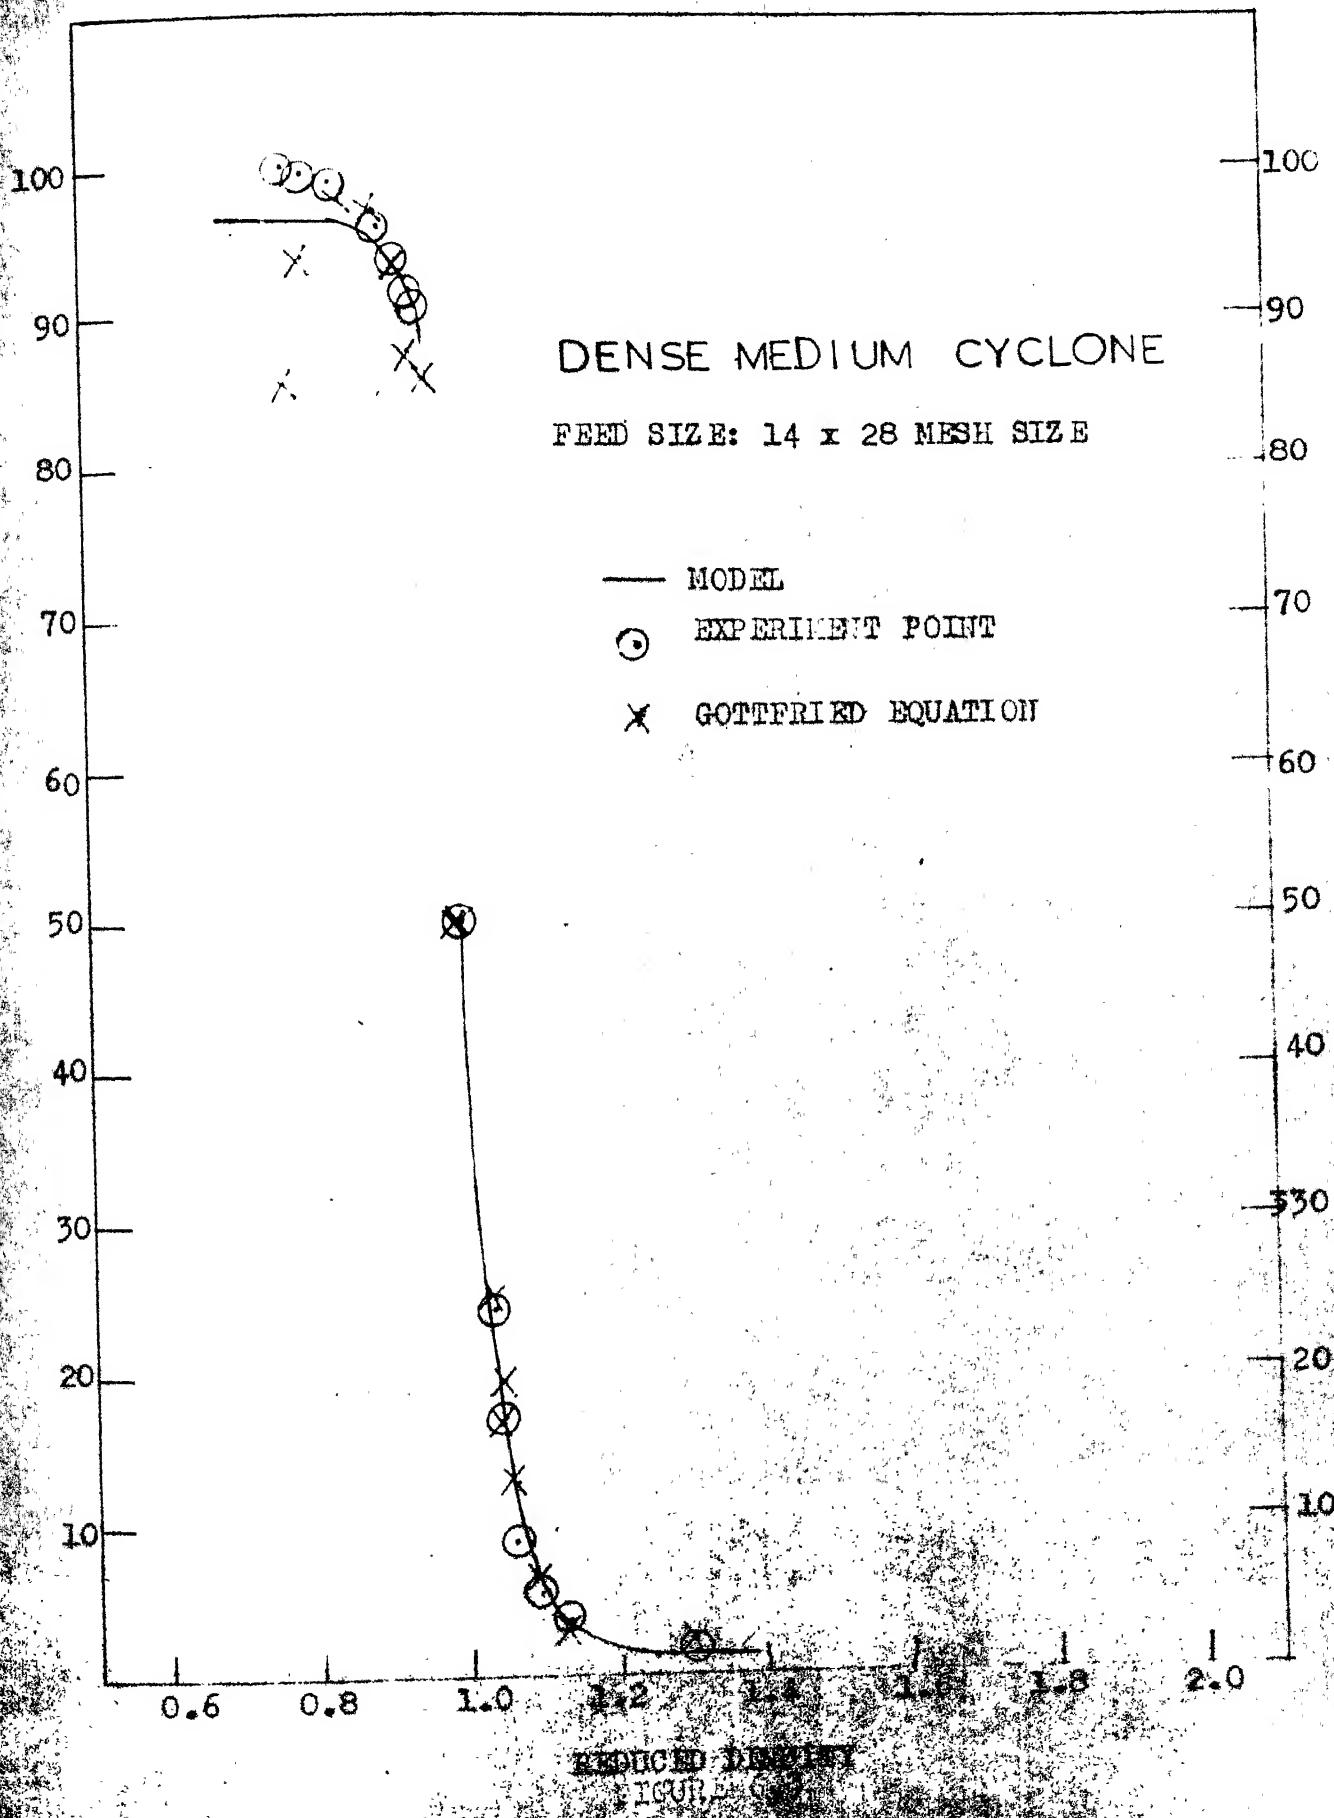



DISTRIBUTION NO. OF CLEAN COAT, PRESENT

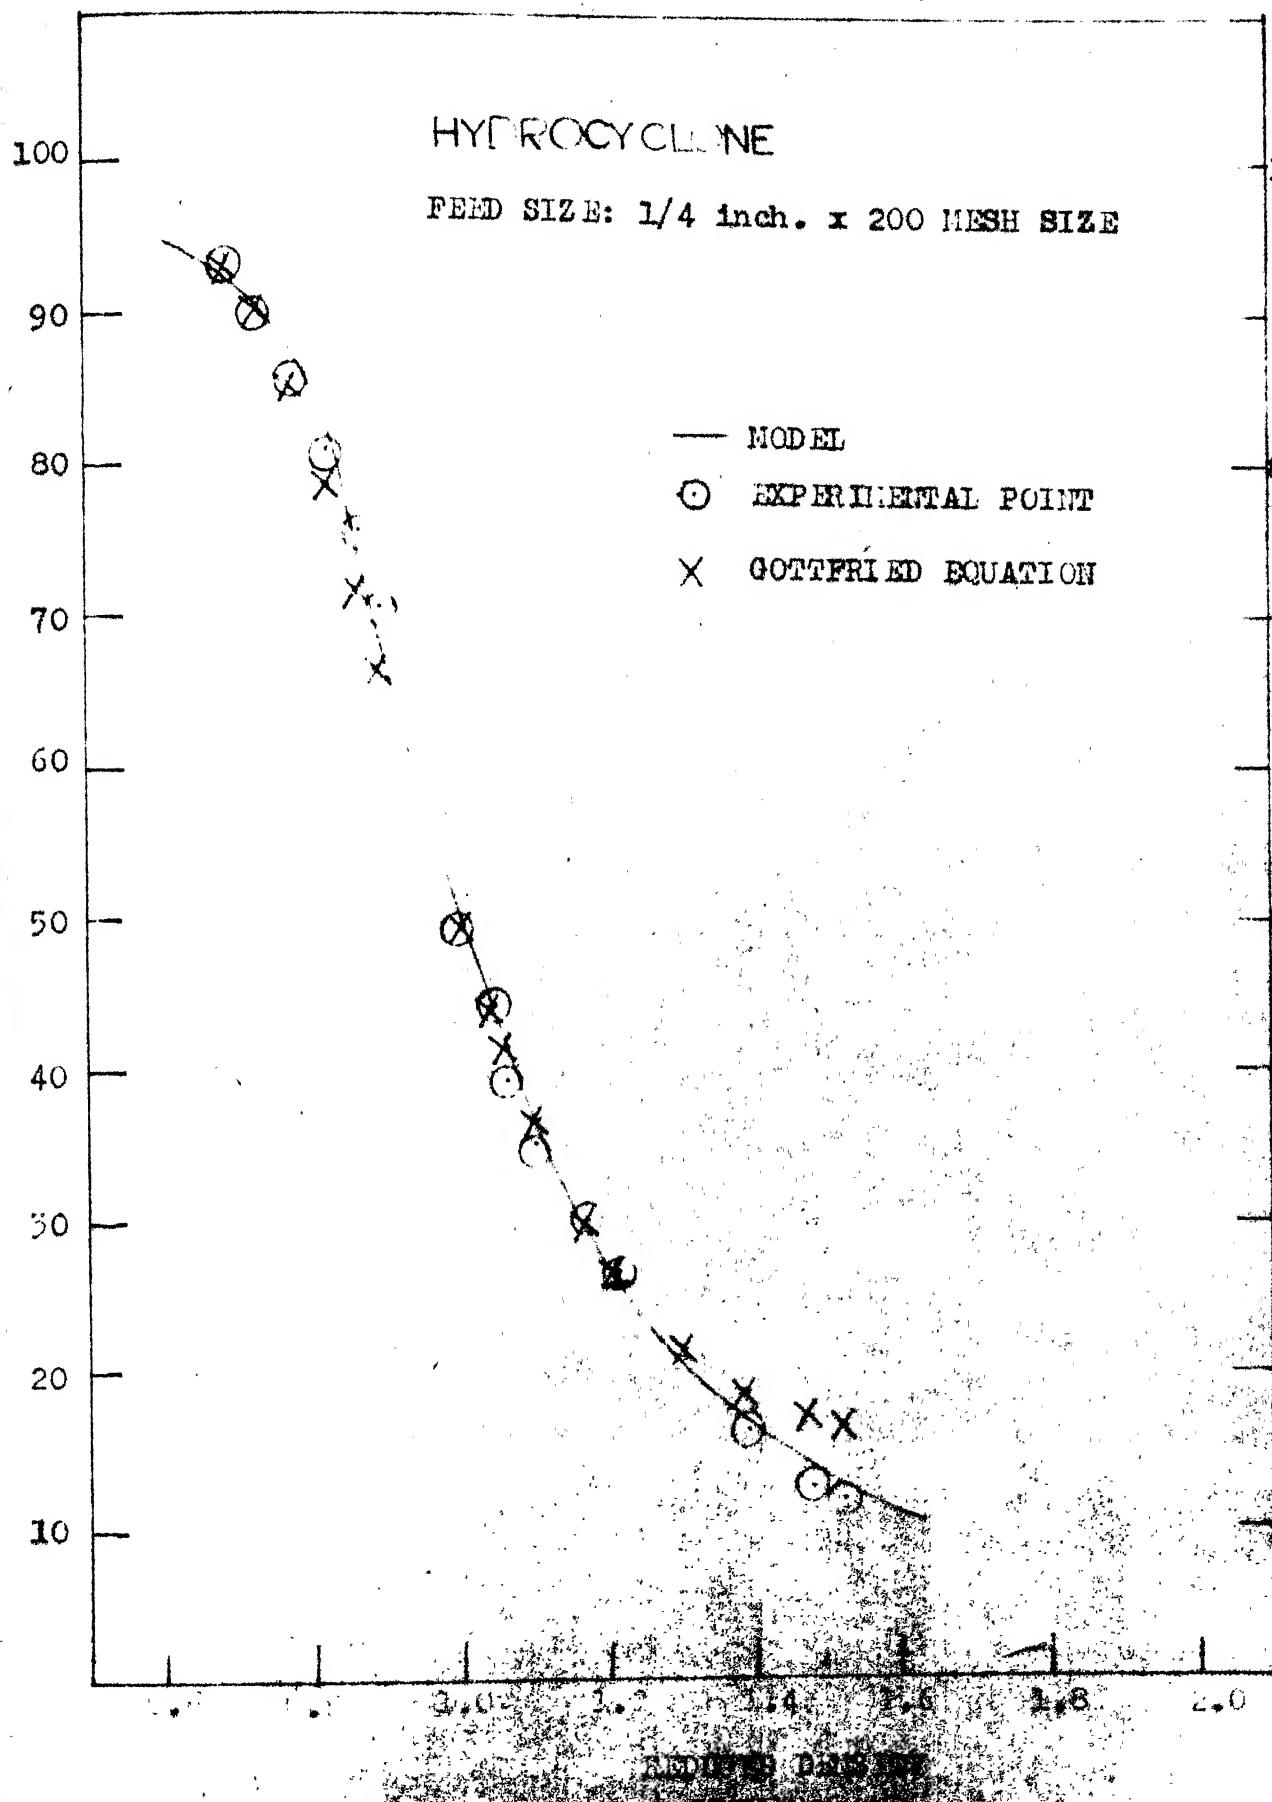

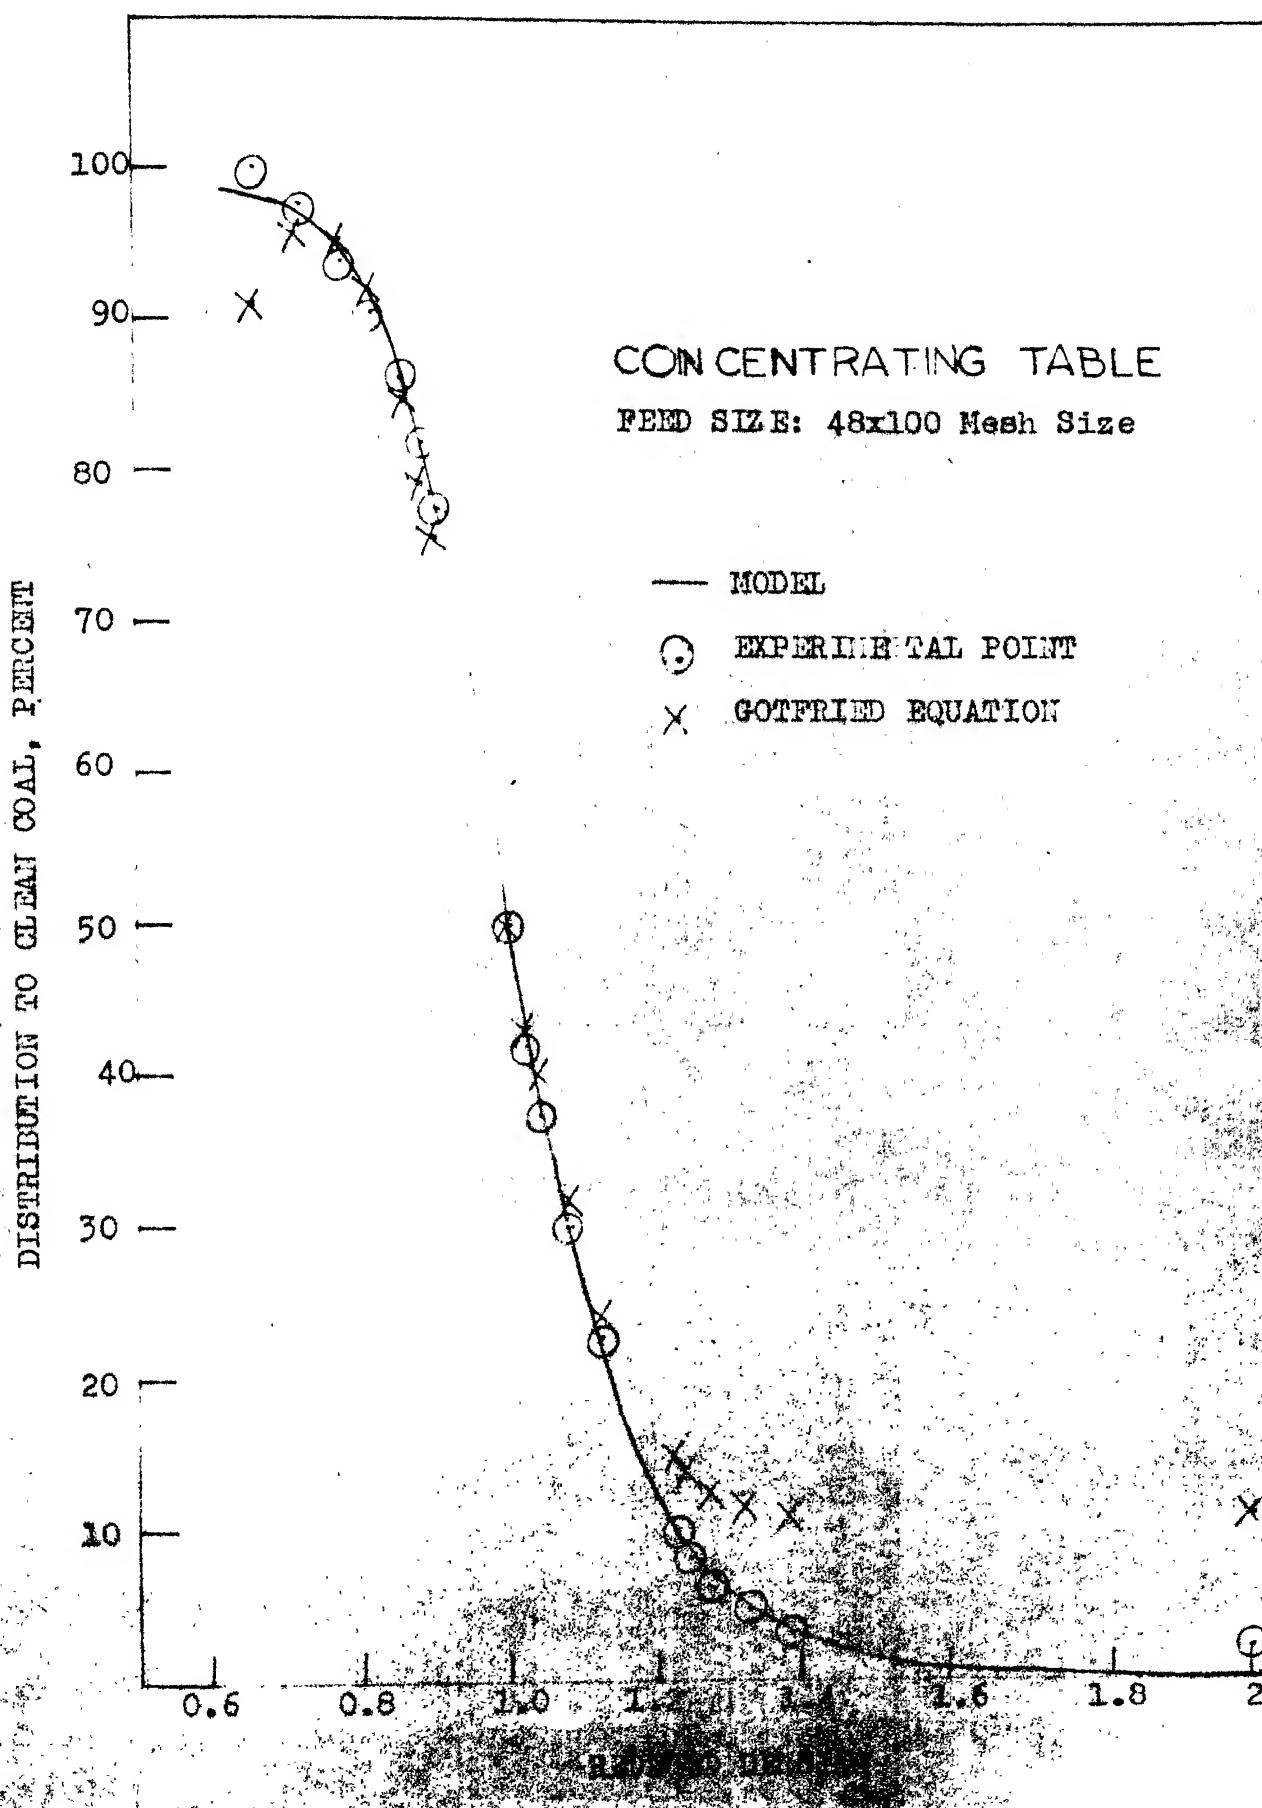

FEED SIZE, GEOMETRIC MEAN (mm)

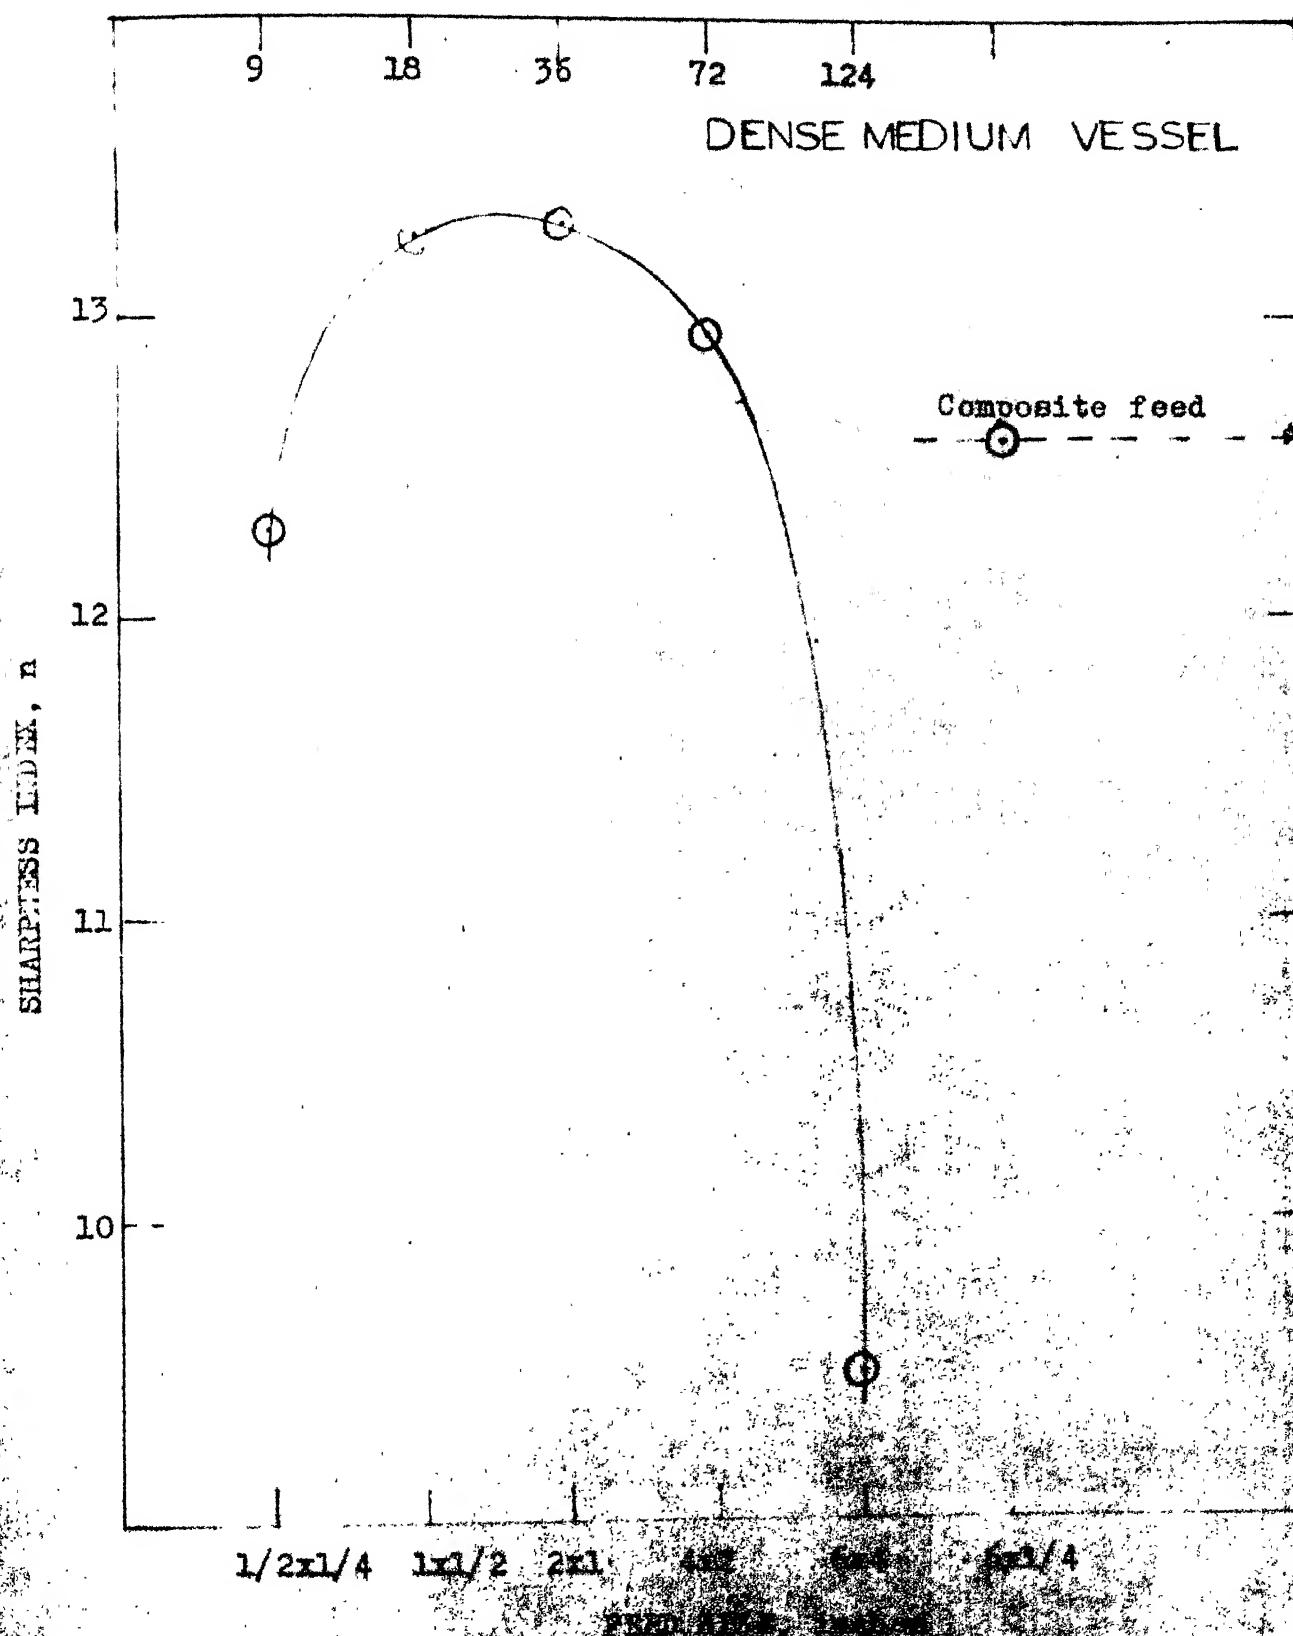

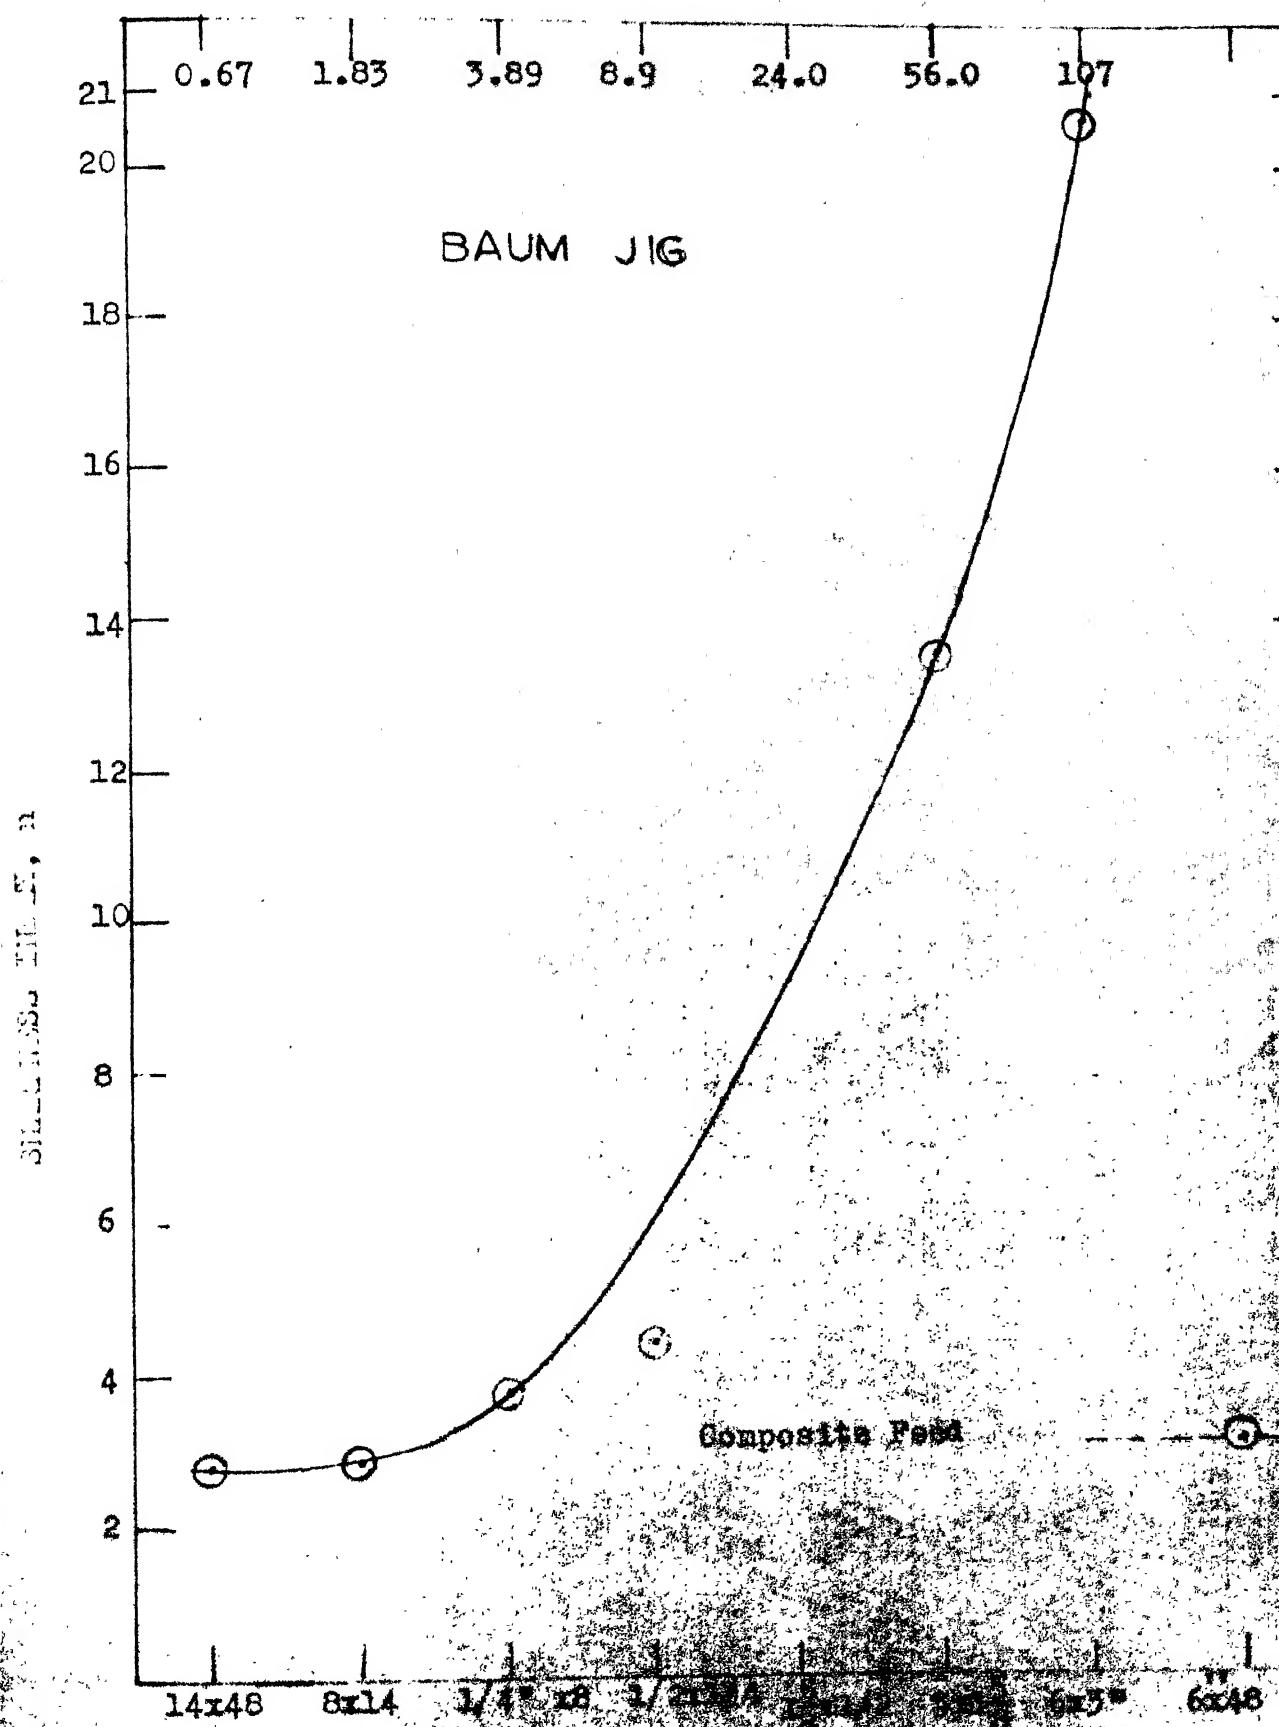



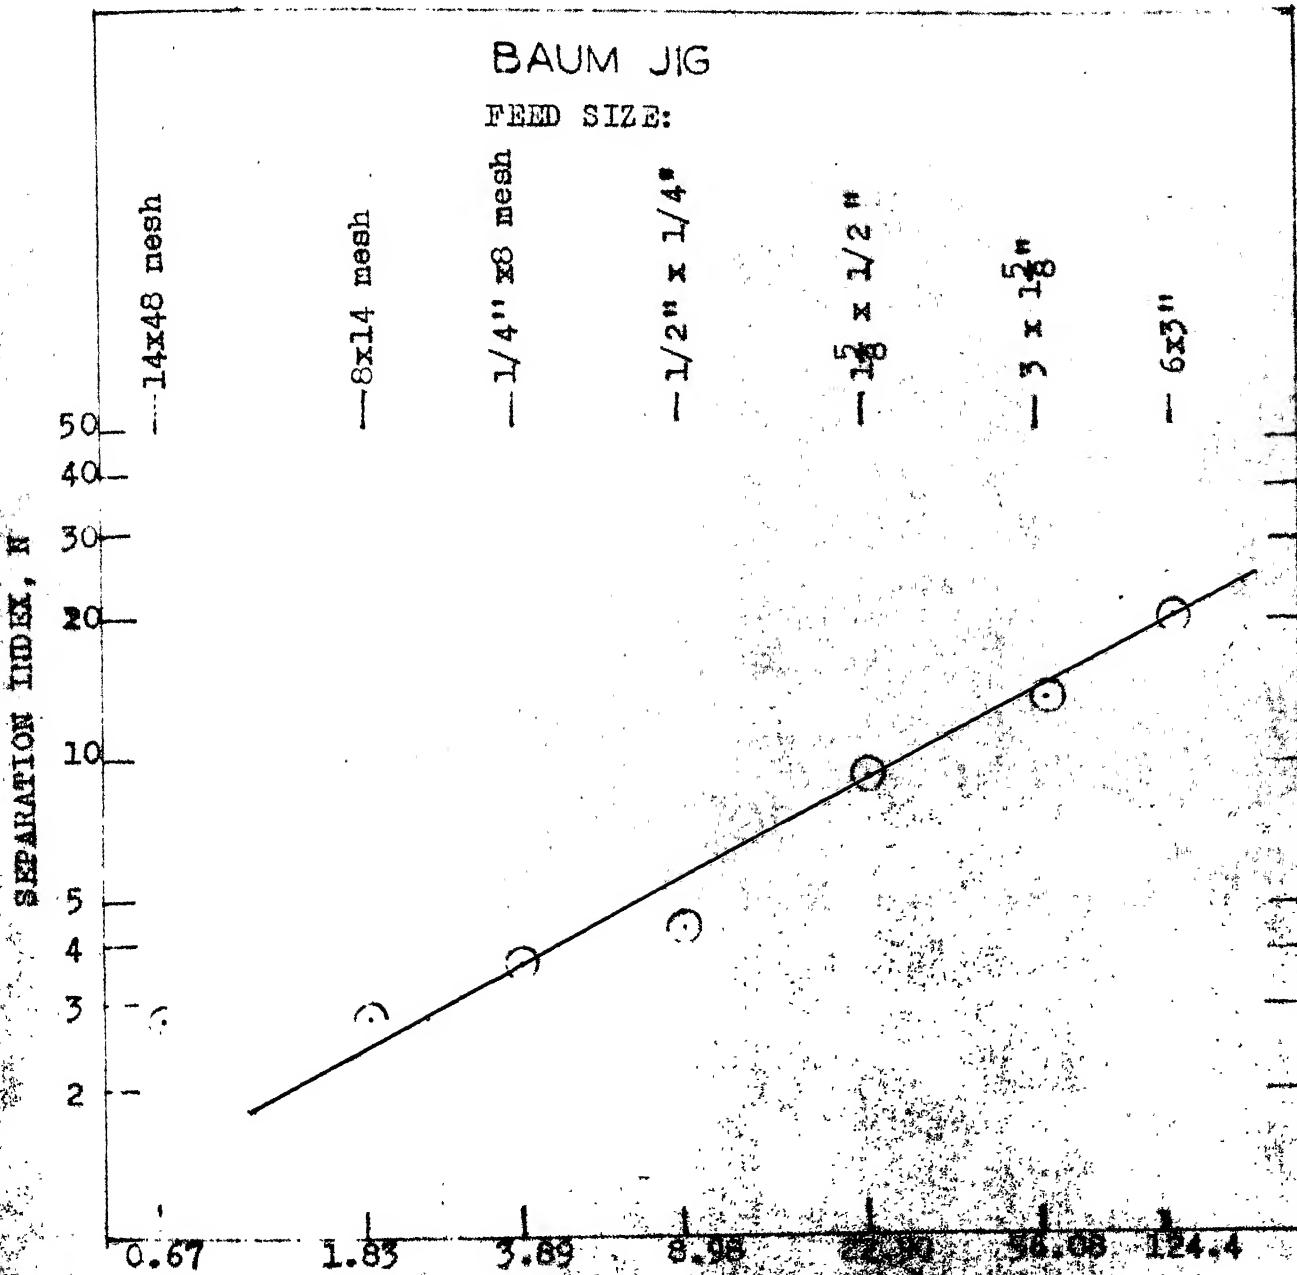


FIGURE 6-8

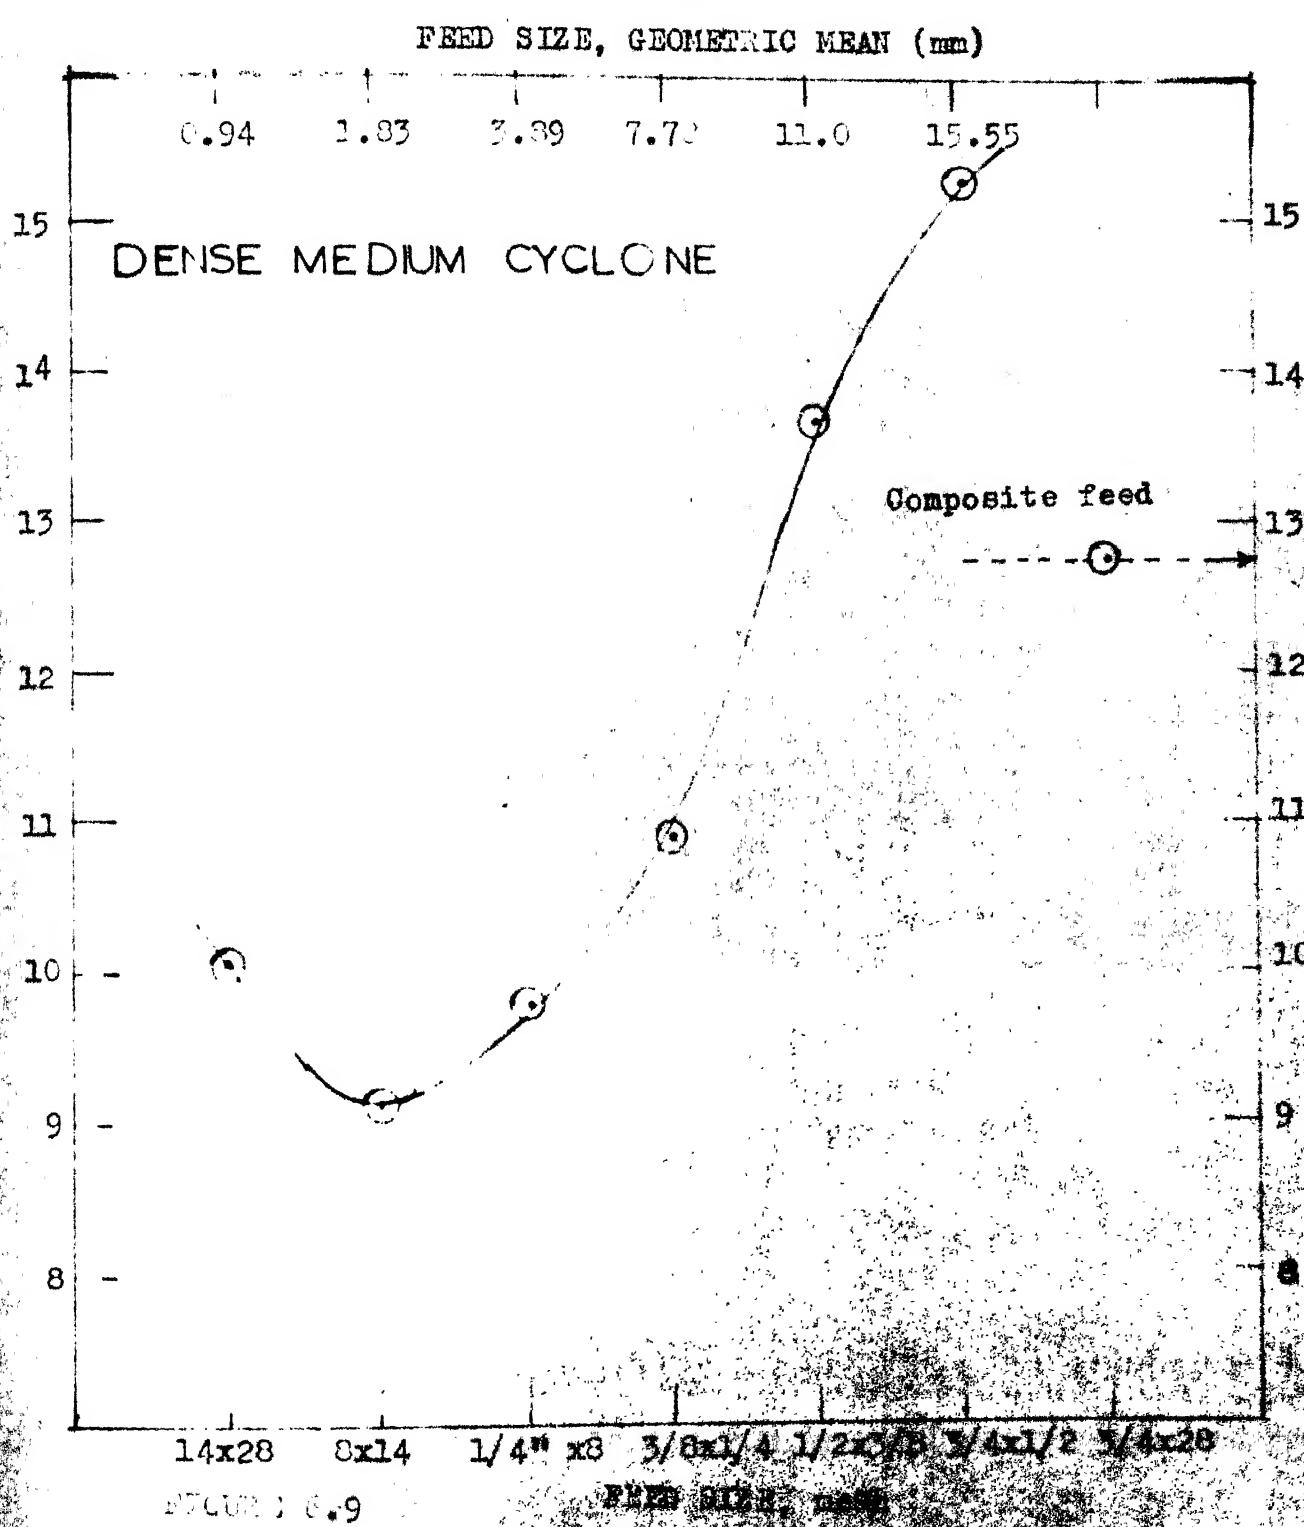

GEOMETRIC MEAN SIZE, μ

SHARPNESS INDEX, n

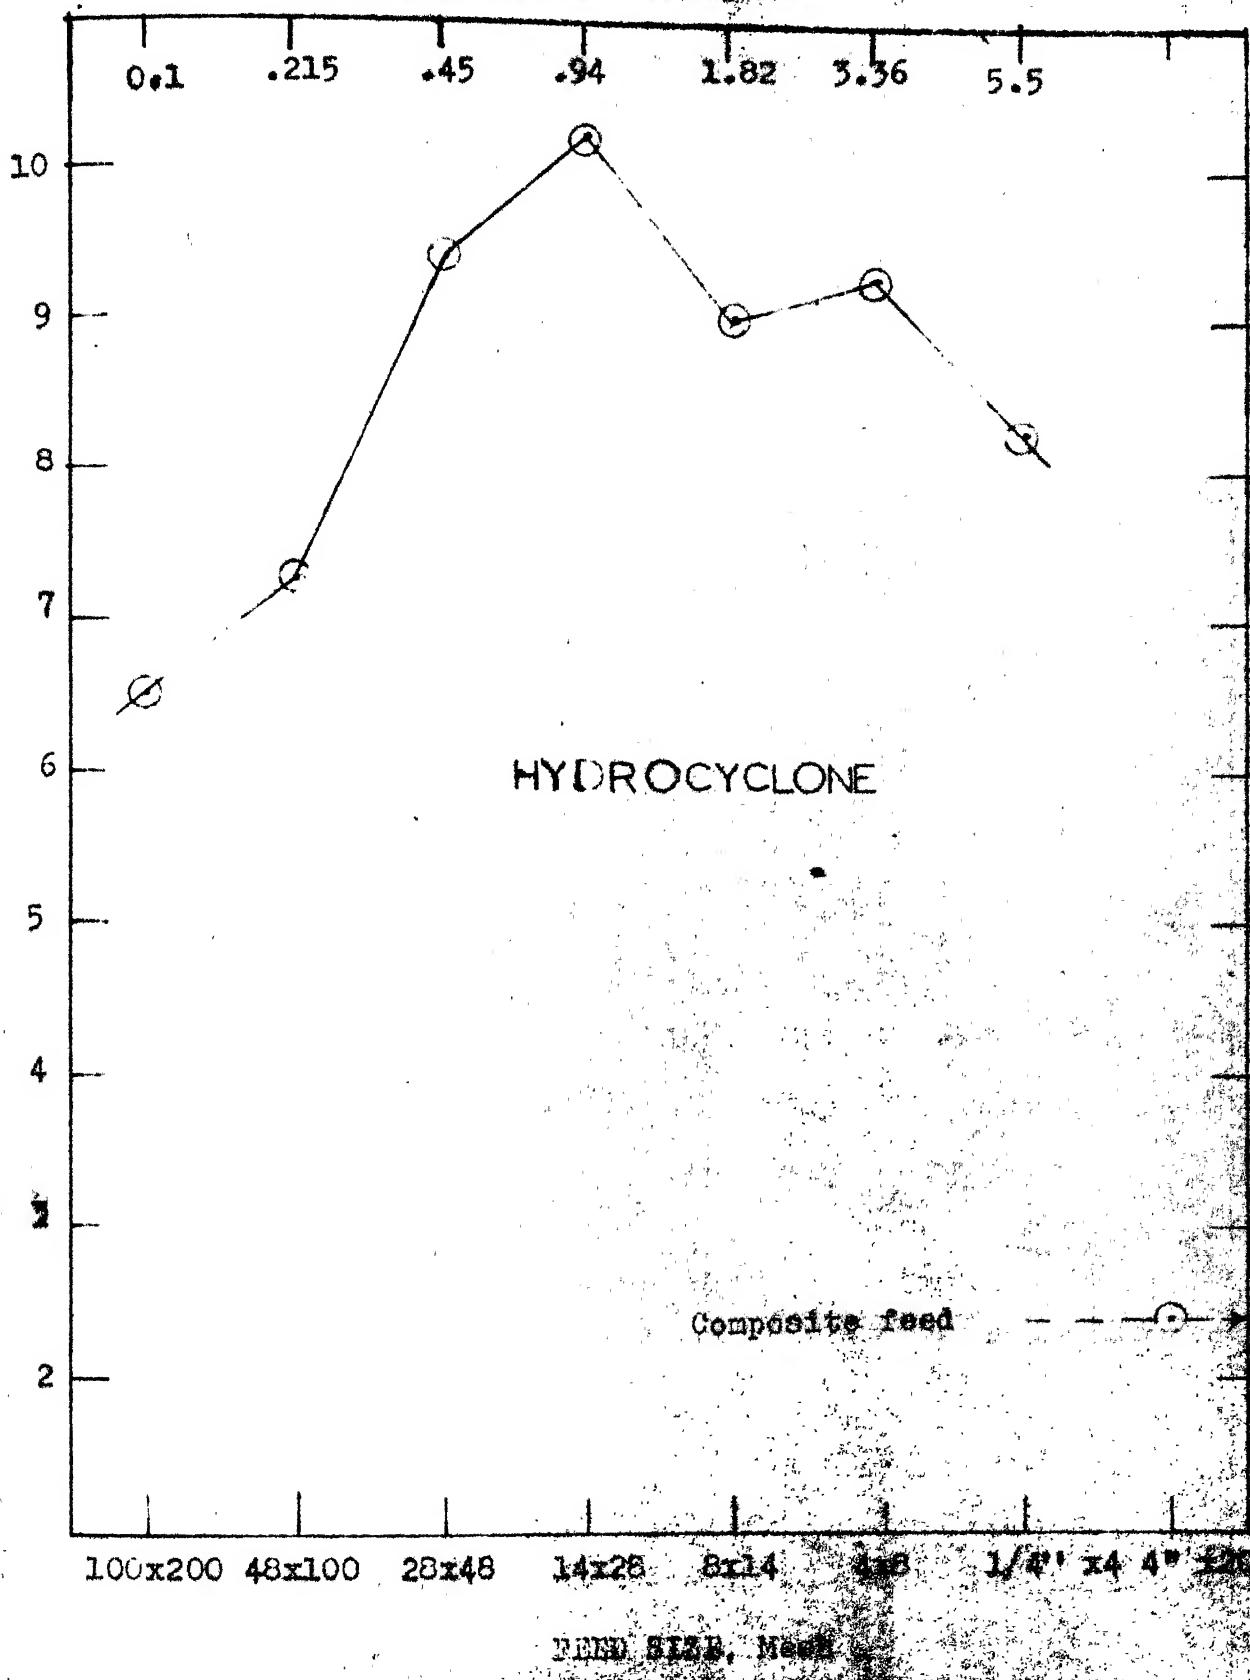

MEAN SIZE, μ

GEOMETRIC MEAN SIZE, mm


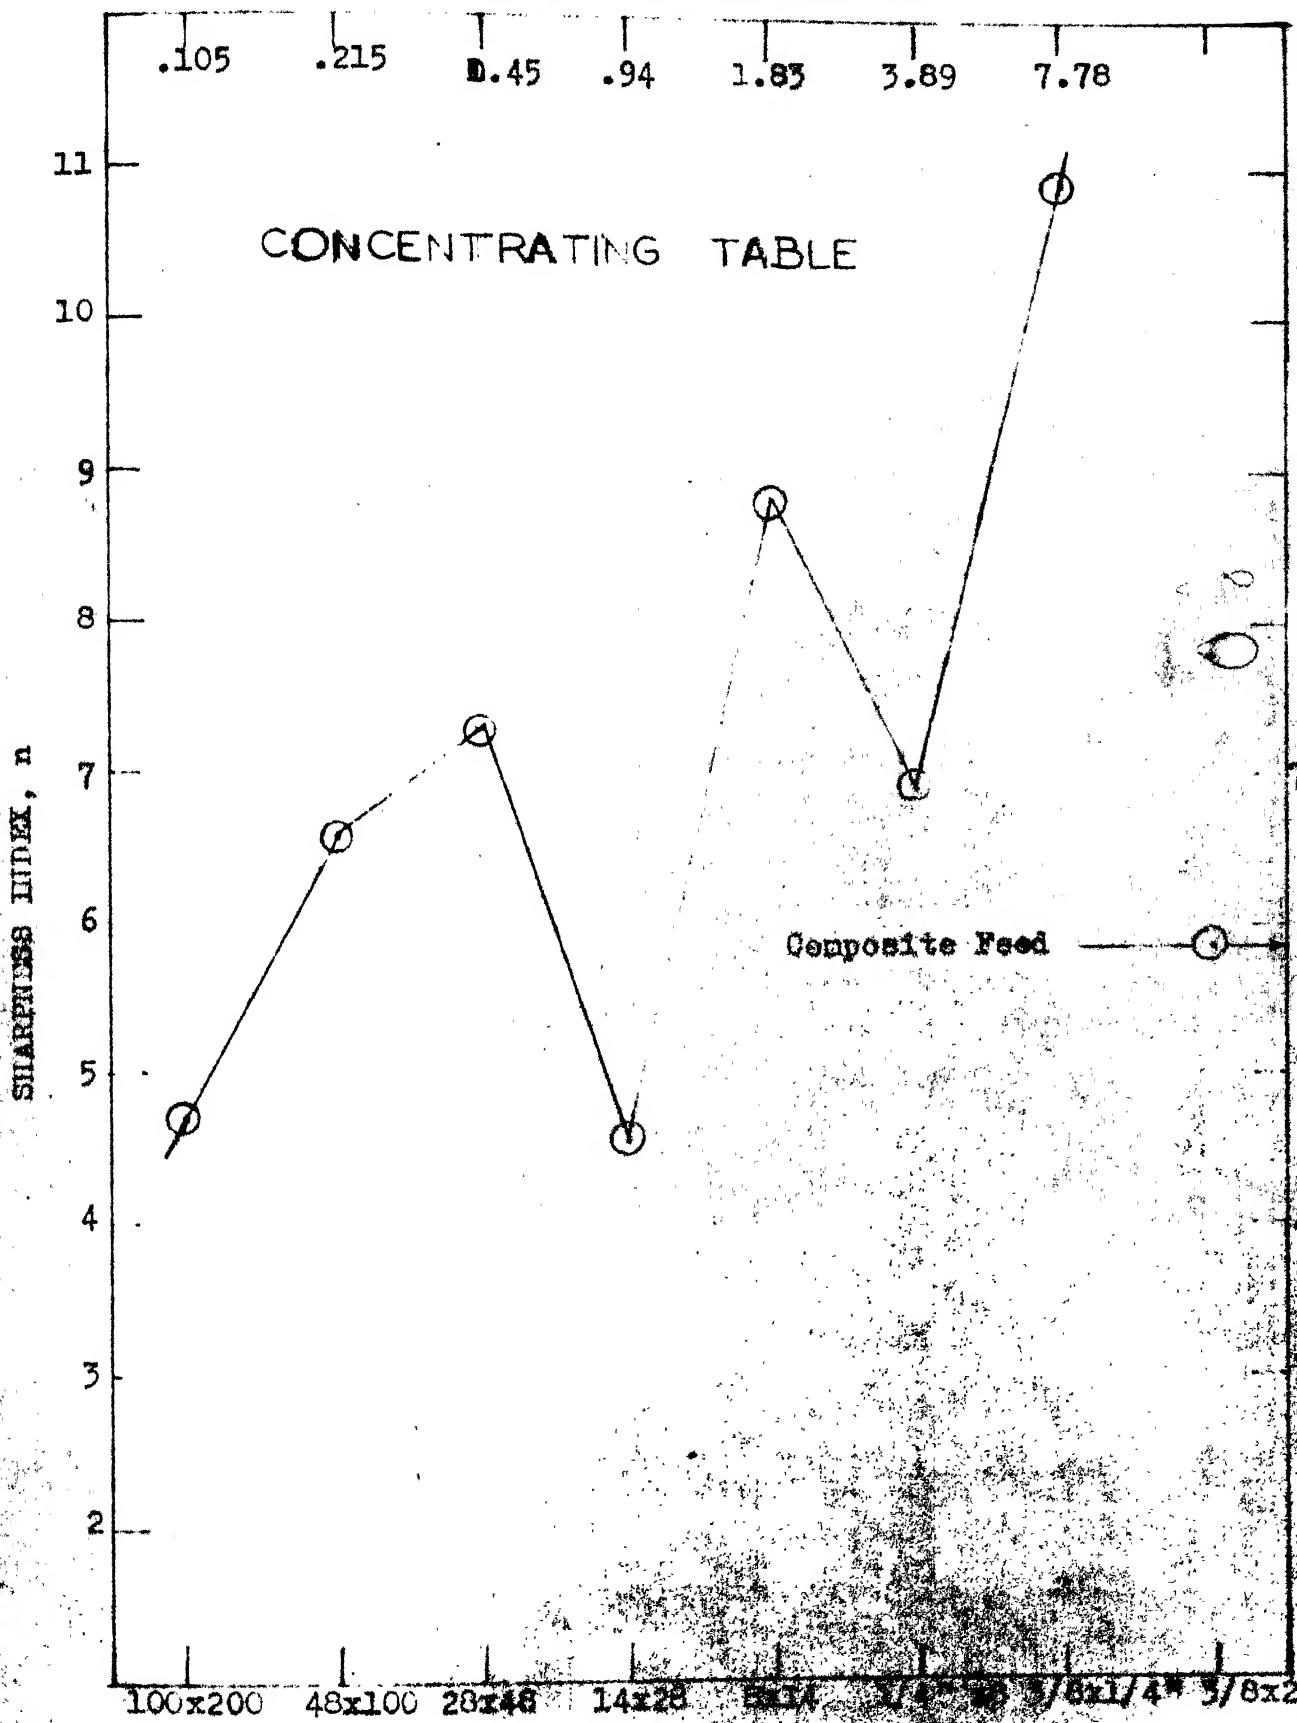


FIGURE 6

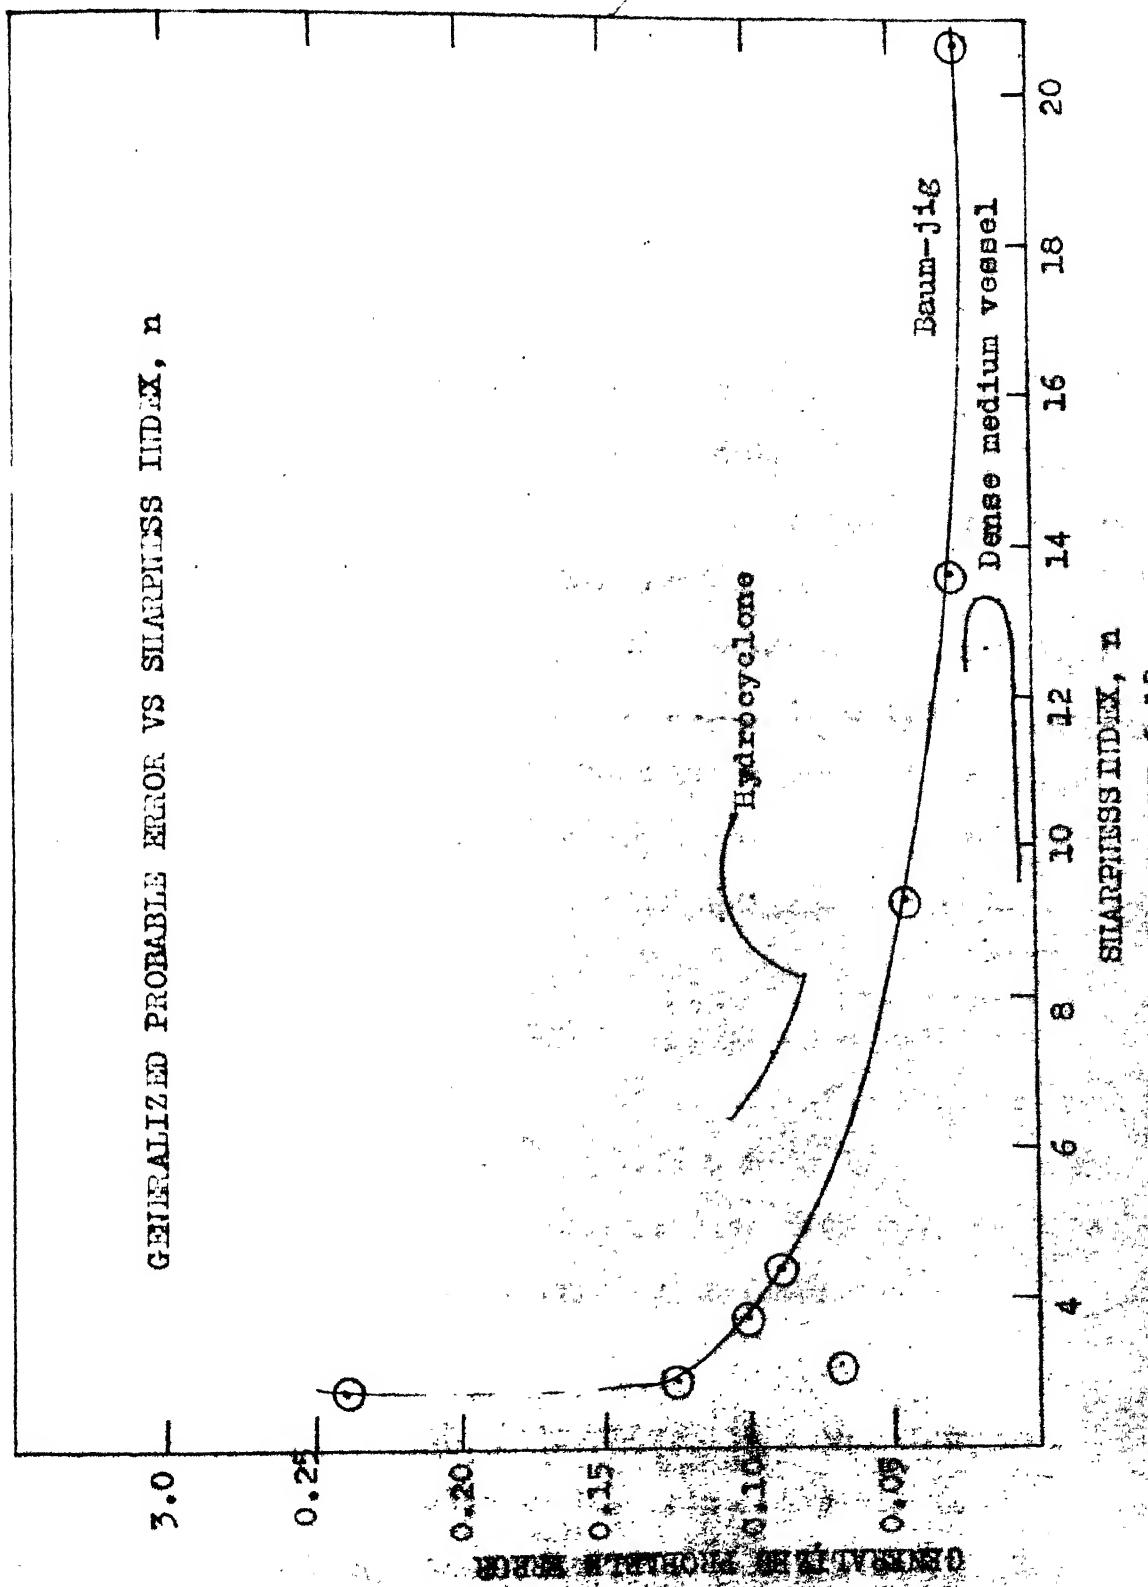

CHAPTER 7

ANALYSIS

7.1 Dense Medium Vessel

The sharpness index n varies from 12.3 to 13.3 for foods in size ranges $1/2" \times 1/4"$ to $4" \times 2"$ as given in Figure 6.6. Raw coal feed of sizes lower than $1/4"$ and greater than $4"$ have lower sharpness index. The composite feed of size $1/4" \times 6"$ has a rather high sharpness index showing the ability of dense medium vessel to handle wide size range of raw coal feed. On the otherhand, the inability of dense medium vessels to handle fine size is evident from the droping nature of sharpness index curve below $1/2"$ size. These conclusions regarding dense medium vessels are in conformity with the literature on dense medium vessel performance [9a].

$f_u(\bar{d})$ - the maximum washed coal percentage that can be expected varies from 96.5 to 99.9 and $f_l(\bar{d})$ - the minimum coal in sink varies from 0.11×10^{-5} to 3.03 per cent. The value of \bar{d}_l , the limiting reduced density varies from 0.75 to 0.94 indicating that there is no difficulty in cleaning.

7.2 Baum Jig

In agreement with the literature [9b], the sharpness index increases with increase in feed size as given in Figure 6.7. It varies from 2.8 to 20.6 over a size range 14 x 28 mesh to 6" x 3" and for a composite feed of size

\bar{d}_1 varied from 0.76 to 0.9, even difficult to wash coals can be handled by this process.

7.4 Hydrocyclone

The variation of sharpness index n with feed size is given in Figure 6.10. Here the sharpness index varies from 6.5 to 10.22, and is lower than for dense medium cyclone. The speciality of hydrocyclone in treating relatively fine 14 x 28 mesh size feed is evident by the parameter value of $n = 10.2$. Raw coal of feed size greater or less than this 28 mesh size has lower sharpness index. The composite feed of size $1/4" \times 200$ mesh has a very low value i.e. $n = 2.39$. Clearly hydrocyclone is found to be unsuitable for broad size range of raw coal feed.

Here $f_u(d)$ varied from 92.6 to 99.88 indicating somewhat less recovery than dense medium cyclone. The $f_1(\bar{d})$ varied from 0.005 to 10.9 indicating that under certain conditions more than 10 per cent of valuable coal may be lost to sink by this process. The variation of \bar{d}_1 from 0.11 to 0.5 show that hydrocyclones are not suitable for difficult to clean coals.

7.5 Concentrating Table

As shown in Figure 6.11, the sharpness index, n fluctuates sharply from 4.56 to 10.92. The underlying principles of concentrating table are somewhat different from the equipment considered earlier. It is not clear if our

model has a meaningful relevance to concentrating tables.

In any case, here $f_u(d)$ varies from 97.5 to 99.99 indicating higher recoveries of wasted coal, however, $f_1(\bar{d})$ values sometimes rise as high as 18.4, showing the unreliable nature of this process.

7.6 Generalized Probable Error:

The conventional probable error is given in Fig.2.2. In the case of generalized distribution curve as in Figure 2.4, we will have generalized probable error (GE_p) which can be simply written as

$$GE_p = 0.5 [\bar{d}_{25} - \bar{d}_{75}]$$

where \bar{d}_{25} is the reduced density at which 25 per cent of feed coal will report to clean coal product and \bar{d}_{75} is the reduced density at which 75 per cent of feed coal will report to clean coal product.

Using the numerical values of the 4 parameters of our model, generalised probable error for all feed size fractions were calculated and tabulated in Appendix 4. A plot of the generalized probable error values vs sharpness index, n is given in figure 6.12.

CHAPTER 8

CONCLUSIONS

1. A mathematical model of the coal cleaning process has been derived which generates the separation (Tromp) curve. The 4-parameter model reproduces the distribution curves with a high degree of accuracy.

2. Rosenbrock hill climb method with uniform weights to the washed coal recovery $f(\bar{d})$ data, is suitable for estimating the 4 parameters in our model.

3. The model predicts self-similar distribution curves in $d/d_{0.5}$, in agreement with the plant data.

4. The model reproduces the distribution curves better than Gottfried's mathematical representation of distribution curves by the Weibull function.

5. The estimated values of the 4 parameters have been analyzed for all coal cleaning equipments. Higher the value of sharpness index, n , more efficient is the process. For better performance, n should be high, $f_u(\bar{d})$ should be maximum $f_l(\bar{d})$ should be minimum and \bar{d}_l should be high.

6. Except for concentrating table valuable insight into the performance behaviour of all other float-sink equipment has been obtained, specially with respect to the important coal feed size variable.

REFERENCES

1. Thomas A. Hendricks, The Origin of Coal in H.H. Lowry (Editor), 'Chemistry of Coal Utilization', John Wiley and Sons, 1945, Ch.1.
2. Gilbert Theissen, Composition and Origin of Mineral Matter in Coal. In H.H. Lowry (Editor) 'Chemistry of Coal Utilization', John Wiley and Sons, 1945, Ch.14.
3. Marics A.C., The Formation, Composition and Classification of Coal. In: P.C. Pope (Editor), 'Coal-Production, Distribution, Utilization', Chapman and Hall Ltd., 1945, Ch.1.
4. H.F. Yanccy and Geer, M.R., The Cleaning of Coal In: H.H. Lowry (Editor), 'Chemistry of Coal Utilization', John Wiley and Sons, 1945, Ch.16, p.598.
5. Zachar, F.R. and Gilbert A.G., The Economics of Coal Preparation, In: Joseph W. Leonard and David R. Mitchell (Editors), 'Coal Preparation', The American Institute of Mining, Metallurgical and Petroleum Engineers, 1968, Ch.5.
6. Major E.C. Dixon, Coke and by-products Manufacture Charles Griffin and Company Ltd., 1939, Ch.2.
7. Wilkins E.T., The Preparation of Coal for the Market, In: P.C. Pope (Editor), 'Coal-Production, Distribution, Utilization', Chapman and Hall Ltd., 1945, Ch. 4.

8. Yancey, H.F. and Geor, M.R., The Cleaning of Coal In: H.H. Lowry (Editor), 'Chemistry of Coal Utilization', John Wiley and Sons, 1945, Ch.16, p.572.
9. Joseph W. Leonard and David R. Mitchell (Editors), 'Coal Preparation', The American Institute of Mining, Metallurgical and Petroleum Engineers, 1968, Ch.9 and Ch.10.
- 9(a) Palowitch E.R. and Deurbrouck, A.W., Wet Concentration of Coarse Coal, Part 1- Dense Medium Separation, In: Ref.9 page 9-3.
- 9(b) Lovell, H.L., Wet Concentration of Coarse Coal, Part 2- Hydraulic Separation, In: Ref.9 page 9-38.
- 9(c) Sokashi, H., Geor, M.R., Yancey, H.C., Wet Concentration of Fine Coal Part 1, Dense Medium Separation, In: Ref.9 page 10-3.
- 9(d) Deurobrouck, A.W. and Palowitch E.R., Wet Concentration of Fine Coal Part 2, Hydraulic Concentration, In: Ref.9 page 10.32.
10. Gokhale, K.V.G.K. and Rao, T.C. Coal and Lignite In: Ore Deposits of India. Their Distribution and Processing, Thomson Press (India) Ltd., 1973, Ch.18.
11. Geor, M.R. and Yancoy, H.F., Plant Performance and Forecasting Cleaning Results, In: Ref.9 Ch. 18.
12. Byron S. Gottfried, A Generalization of Distribution Data for Characterizing the Performance of Float-sink

Coal Cleaning Devices, International Journal of Mineral Processing, 5 (1978) 1-20.

13. Byron, S. Gottfried and Jacobsen, P.S., Generalized Distribution Curve for Characterizing the Performance of Coal Cleaning Equipment. U.S. Bureau of Mines, Rep. Invest. 8238, 1977.

14. Box, M.J., 'A New Method of Constrained Optimization and a Comparison with Other Methods', Computer Journal, 12, (1962).

15. David M. Himmelblau, Nonlinear Models, In: Process Analysis by Statistical Methods. John Wiley and Sons, Inc., 1968, Ch.6.

16. Rosenbrock, H.H., 'An Automatic Method for Finding the Greatest or Least Value of a Function', Computer Journal, Vol.3, 1960, page 168.

17. Kuester, J.I. and Mize, J.H., 'Optimization Techniques With Fortran', Mc Graw Hill, 1973, p. 386.

APPENDIX 1BOX-COMPLEX TECHNIQUE[14-15]

This method is based on the flexible geometric simplex method. Given 'N' independent variables method requires 'N+1' feasible starting cases (initial guesses). All the 'N+1' cases are randomly generated by varying the initial variable values between the upper and the lower bounds and are checked against the constraints. In this work for 4-parameter models, 5 starting cases randomly generated from the initial guess point.

Once the starting cases are provided, the search phase begins by evaluating the objective function, in our case at each of 5 points, and the worst case (for which the error is maximum) is rejected. The centroid of the remaining cases is found out and the rejected point is reflected on the opposite side of the centroid by a factor of GMR, reflection coefficient.

$$x_{i,j(\text{new})} = \text{GMR} (\bar{x}_{i,c} - \bar{x}_{i,j(\text{rejected})}) + \bar{x}_{i,c}$$

where $x_{i,j}$ is the new point of the i th parameter

$$i = 1, 2, \dots, N$$

The value of GMR is arbitrarily chosen as 1.1. If the new case violates the constraints, it is modified by either GME, expansion coefficient or GMC, contraction coefficient, so that the new case is moved towards the centroid. This

procedure of moving towards the centroid is continued until the constraints are no more violated. After every iteration the objective function is checked for convergence until it is achieved. Figure 7 is the flow chart for the program used.


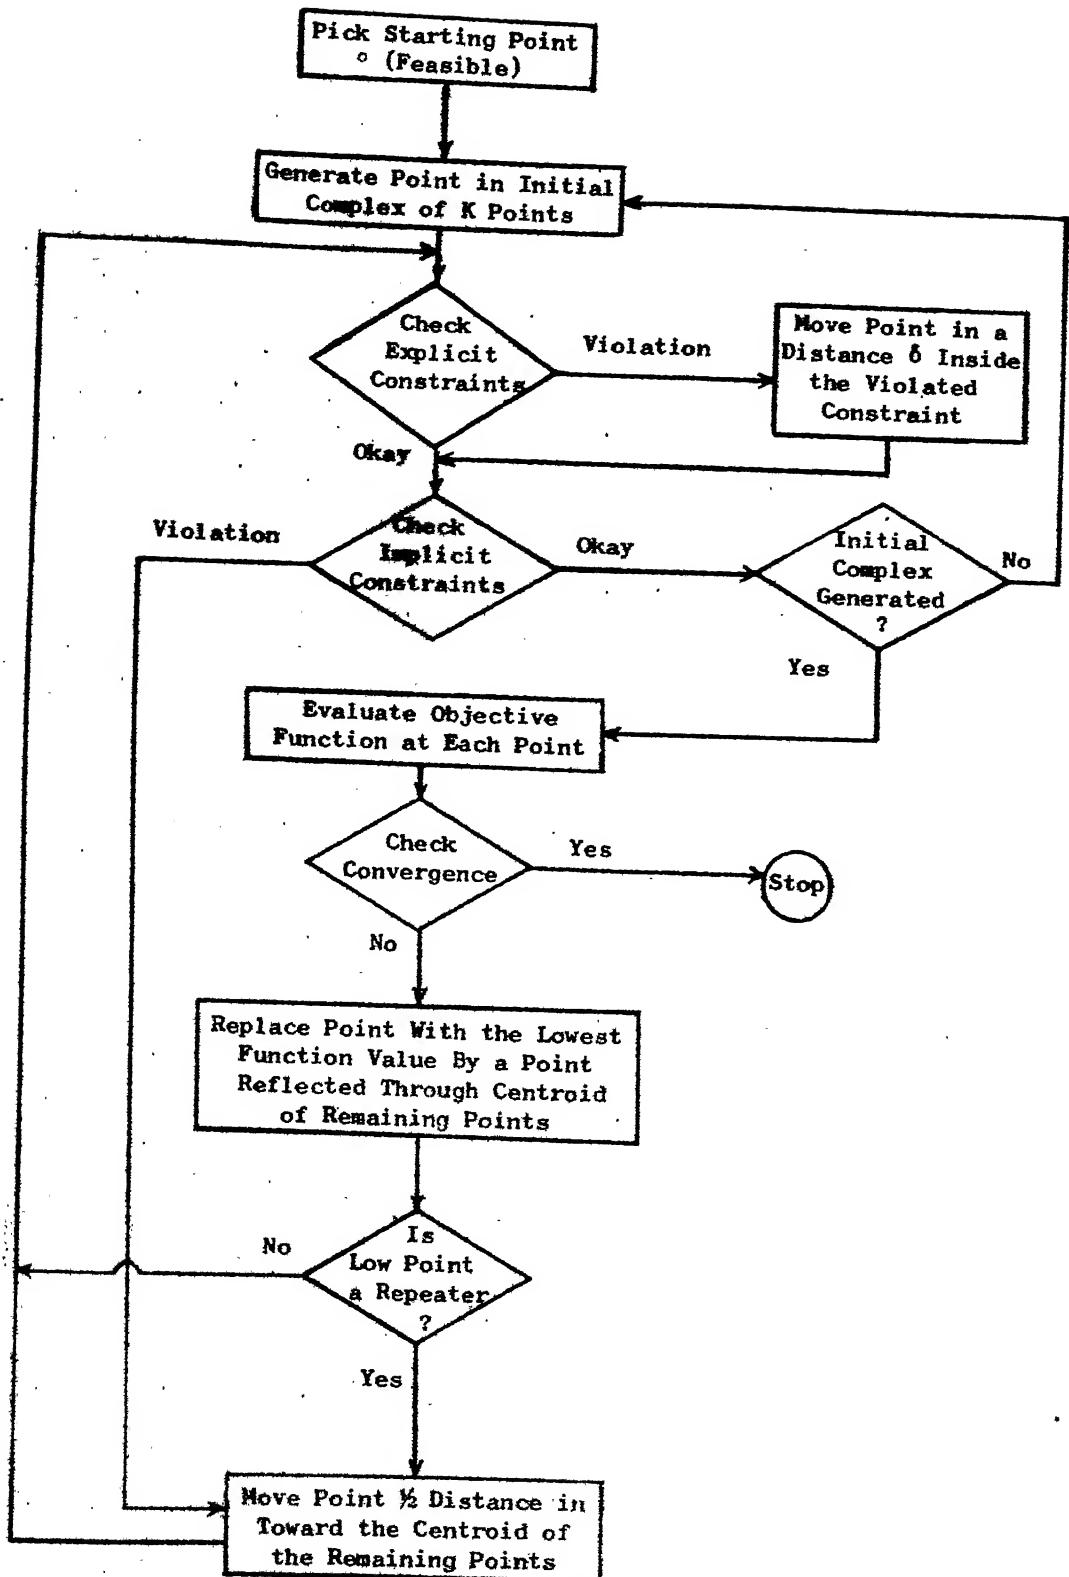


Figure 11.1. Box (COMPLEX ALGORITHM) Logic Diagram

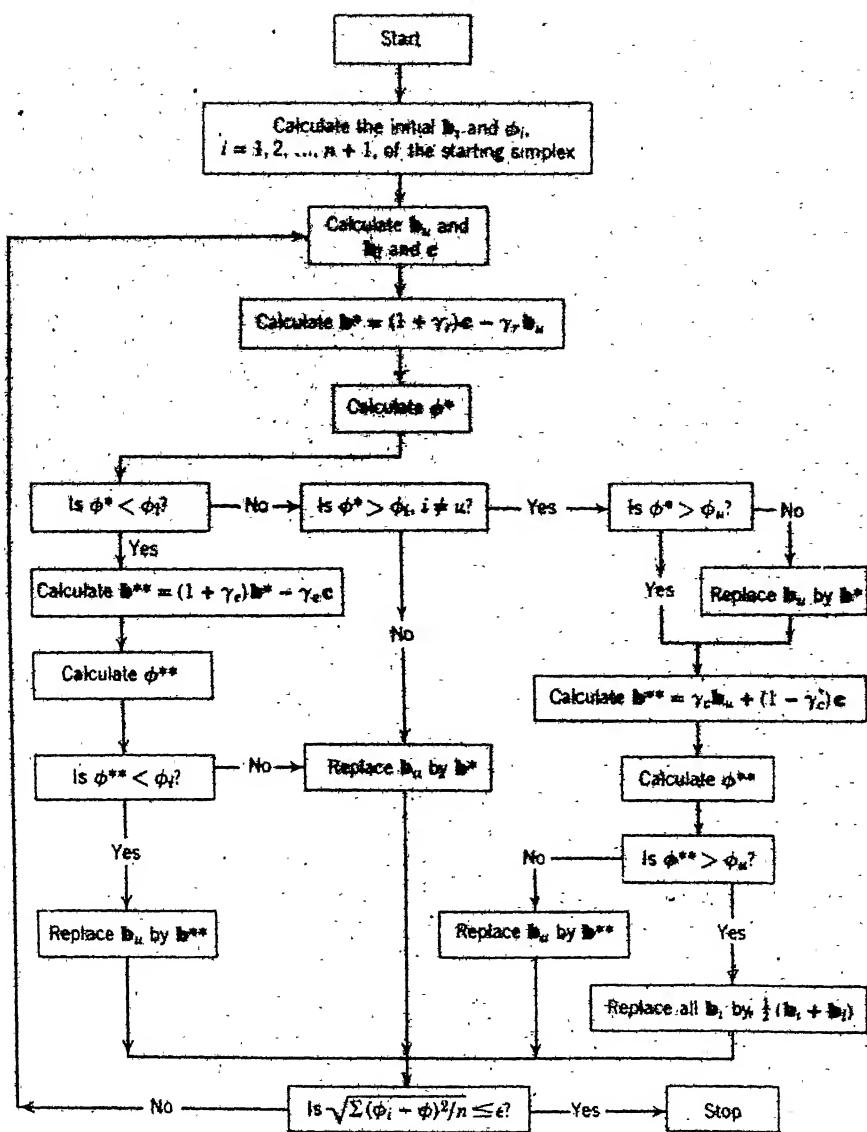

7.2 Information flow chart for flexible simplex method.


```
11  DO 12 J=1,NP
12  YR(J)=(XR(1)+CR(J))*0.5
13  GOTO 14
14  RETURN
15  END
```

```
SUBROUTINE MPLOT(A,NASA2,NASA,NLY,NLXX)
```

```
*****
```

A IS THIS A 3 DIMENSIONAL MATRTX WHOSE ELEMENTS
ARE AS FOLLOWS:

A(I,1,K)=X-CO ORDINATE

A(I,2,K)=Y-CO ORDINATE

I=1,50 (NO. OF POINTS)

K=INTEGER WHOSE VALUE DETERMINED

BY THE POINT, (TO WHICH GRAPH IT BELONGS)

NASA2: NUMBER OF GRAPHS TO BE PLOTTED

NASA : AN ARRAY CONTAINING NUMBER OF POINTS
IN EACH GRAPH.

NLY : NUMBER OF LINES IN Y-AXIS

NLXX : NUMBER OF LINES IN X-AXIS.

```
*****  
11  DO 12 J=1,NP  
12  YC(J)=0.01,V(1,J,1),SX(1,J),SY(1,J),TDC(120)  
13  DO 14 I=1,50  
14  X(I,J)=X(I,J)+ASA(I,J),TSYMB(100),TXY(1000)  
15  DO 16 K=1,100  
16  T=1.0,T2,T3,T4,T5,T6,T7,T8,T9,T10,T11,  
17  T12,T13,T14,T15,T16,T17,T18,T19,T20,T21,  
18  T22,T23,T24,T25,T26,T27,T28,T29,T30,T31,  
19  T32,T33,T34,T35,T36,T37,T38,T39,T40,T41,  
20  T42,T43,T44,T45,T46,T47,T48,T49,T50,T51,  
21  T52,T53,T54,T55,T56,T57,T58,T59,T60,T61,  
22  T62,T63,T64,T65,T66,T67,T68,T69,T70,T71,  
23  T72,T73,T74,T75,T76,T77,T78,T79,T80,T81,  
24  T82,T83,T84,T85,T86,T87,T88,T89,T90,T91,  
25  T92,T93,T94,T95,T96,T97,T98,T99,T100,T101,  
26  T102,T103,T104,T105,T106,T107,T108,T109,T110,T111  
27  T112,T113,T114,T115,T116,T117,T118,T119,T120,T121  
28  T122,T123,T124,T125,T126,T127,T128,T129,T130,T131  
29  T132,T133,T134,T135,T136,T137,T138,T139,T140,T141  
30  T142,T143,T144,T145,T146,T147,T148,T149,T150,T151  
31  T152,T153,T154,T155,T156,T157,T158,T159,T160,T161  
32  T162,T163,T164,T165,T166,T167,T168,T169,T170,T171  
33  T172,T173,T174,T175,T176,T177,T178,T179,T180,T181  
34  T182,T183,T184,T185,T186,T187,T188,T189,T190,T191  
35  T192,T193,T194,T195,T196,T197,T198,T199,T200,T201  
36  T202,T203,T204,T205,T206,T207,T208,T209,T210,T211  
37  T212,T213,T214,T215,T216,T217,T218,T219,T220,T221  
38  T222,T223,T224,T225,T226,T227,T228,T229,T230,T231  
39  T232,T233,T234,T235,T236,T237,T238,T239,T240,T241  
40  T242,T243,T244,T245,T246,T247,T248,T249,T250,T251  
41  T252,T253,T254,T255,T256,T257,T258,T259,T260,T261  
42  T262,T263,T264,T265,T266,T267,T268,T269,T270,T271  
43  T272,T273,T274,T275,T276,T277,T278,T279,T280,T281  
44  T282,T283,T284,T285,T286,T287,T288,T289,T290,T291  
45  T292,T293,T294,T295,T296,T297,T298,T299,T300,T301  
46  T302,T303,T304,T305,T306,T307,T308,T309,T310,T311  
47  T312,T313,T314,T315,T316,T317,T318,T319,T320,T321  
48  T322,T323,T324,T325,T326,T327,T328,T329,T330,T331  
49  T332,T333,T334,T335,T336,T337,T338,T339,T340,T341  
50  T342,T343,T344,T345,T346,T347,T348,T349,T350,T351  
51  T352,T353,T354,T355,T356,T357,T358,T359,T360,T361  
52  T362,T363,T364,T365,T366,T367,T368,T369,T370,T371  
53  T372,T373,T374,T375,T376,T377,T378,T379,T380,T381  
54  T382,T383,T384,T385,T386,T387,T388,T389,T390,T391  
55  T392,T393,T394,T395,T396,T397,T398,T399,T400,T401  
56  T402,T403,T404,T405,T406,T407,T408,T409,T410,T411  
57  T412,T413,T414,T415,T416,T417,T418,T419,T420,T421  
58  T422,T423,T424,T425,T426,T427,T428,T429,T430,T431  
59  T432,T433,T434,T435,T436,T437,T438,T439,T440,T441  
60  T442,T443,T444,T445,T446,T447,T448,T449,T450,T451  
61  T452,T453,T454,T455,T456,T457,T458,T459,T460,T461  
62  T462,T463,T464,T465,T466,T467,T468,T469,T470,T471  
63  T472,T473,T474,T475,T476,T477,T478,T479,T480,T481  
64  T482,T483,T484,T485,T486,T487,T488,T489,T490,T491  
65  T492,T493,T494,T495,T496,T497,T498,T499,T500,T501  
66  T502,T503,T504,T505,T506,T507,T508,T509,T510,T511  
67  T512,T513,T514,T515,T516,T517,T518,T519,T520,T521  
68  T522,T523,T524,T525,T526,T527,T528,T529,T530,T531  
69  T532,T533,T534,T535,T536,T537,T538,T539,T540,T541  
70  T542,T543,T544,T545,T546,T547,T548,T549,T550,T551  
71  T552,T553,T554,T555,T556,T557,T558,T559,T560,T561  
72  T562,T563,T564,T565,T566,T567,T568,T569,T570,T571  
73  T572,T573,T574,T575,T576,T577,T578,T579,T580,T581  
74  T582,T583,T584,T585,T586,T587,T588,T589,T590,T591  
75  T592,T593,T594,T595,T596,T597,T598,T599,T600,T601  
76  T602,T603,T604,T605,T606,T607,T608,T609,T610,T611  
77  T612,T613,T614,T615,T616,T617,T618,T619,T620,T621  
78  T622,T623,T624,T625,T626,T627,T628,T629,T630,T631  
79  T632,T633,T634,T635,T636,T637,T638,T639,T640,T641  
80  T642,T643,T644,T645,T646,T647,T648,T649,T650,T651  
81  T652,T653,T654,T655,T656,T657,T658,T659,T660,T661  
82  T662,T663,T664,T665,T666,T667,T668,T669,T670,T671  
83  T672,T673,T674,T675,T676,T677,T678,T679,T680,T681  
84  T682,T683,T684,T685,T686,T687,T688,T689,T690,T691  
85  T692,T693,T694,T695,T696,T697,T698,T699,T700,T701  
86  T702,T703,T704,T705,T706,T707,T708,T709,T710,T711  
87  T712,T713,T714,T715,T716,T717,T718,T719,T720,T721  
88  T722,T723,T724,T725,T726,T727,T728,T729,T730,T731  
89  T732,T733,T734,T735,T736,T737,T738,T739,T740,T741  
90  T742,T743,T744,T745,T746,T747,T748,T749,T750,T751  
91  T752,T753,T754,T755,T756,T757,T758,T759,T760,T761  
92  T762,T763,T764,T765,T766,T767,T768,T769,T770,T771  
93  T772,T773,T774,T775,T776,T777,T778,T779,T780,T781  
94  T782,T783,T784,T785,T786,T787,T788,T789,T790,T791  
95  T792,T793,T794,T795,T796,T797,T798,T799,T800,T801  
96  T802,T803,T804,T805,T806,T807,T808,T809,T810,T811  
97  T812,T813,T814,T815,T816,T817,T818,T819,T820,T821  
98  T822,T823,T824,T825,T826,T827,T828,T829,T830,T831  
99  T832,T833,T834,T835,T836,T837,T838,T839,T840,T841  
100 T842,T843,T844,T845,T846,T847,T848,T849,T850,T851  
101 T852,T853,T854,T855,T856,T857,T858,T859,T860,T861  
102 T862,T863,T864,T865,T866,T867,T868,T869,T870,T871  
103 T872,T873,T874,T875,T876,T877,T878,T879,T880,T881  
104 T882,T883,T884,T885,T886,T887,T888,T889,T890,T891  
105 T892,T893,T894,T895,T896,T897,T898,T899,T900,T901  
106 T902,T903,T904,T905,T906,T907,T908,T909,T910,T911  
107 T912,T913,T914,T915,T916,T917,T918,T919,T920,T921  
108 T922,T923,T924,T925,T926,T927,T928,T929,T930,T931  
109 T932,T933,T934,T935,T936,T937,T938,T939,T940,T941  
110 T942,T943,T944,T945,T946,T947,T948,T949,T950,T951  
111 T952,T953,T954,T955,T956,T957,T958,T959,T960,T961  
112 T962,T963,T964,T965,T966,T967,T968,T969,T970,T971  
113 T972,T973,T974,T975,T976,T977,T978,T979,T980,T981  
114 T982,T983,T984,T985,T986,T987,T988,T989,T990,T991  
115 T992,T993,T994,T995,T996,T997,T998,T999,T1000,T1001  
116 T1002,T1003,T1004,T1005,T1006,T1007,T1008,T1009,T10010,T10011  
117 T10012,T10013,T10014,T10015,T10016,T10017,T10018,T10019,T10020,T10021  
118 T10022,T10023,T10024,T10025,T10026,T10027,T10028,T10029,T10030,T10031  
119 T10032,T10033,T10034,T10035,T10036,T10037,T10038,T10039,T10040,T10041  
120 T10042,T10043,T10044,T10045,T10046,T10047,T10048,T10049,T10050,T10051  
121 T10052,T10053,T10054,T10055,T10056,T10057,T10058,T10059,T10060,T10061  
122 T10062,T10063,T10064,T10065,T10066,T10067,T10068,T10069,T10070,T10071  
123 T10072,T10073,T10074,T10075,T10076,T10077,T10078,T10079,T10080,T10081  
124 T10082,T10083,T10084,T10085,T10086,T10087,T10088,T10089,T10090,T10091  
125 T10092,T10093,T10094,T10095,T10096,T10097,T10098,T10099,T100100,T100101  
126 T100102,T100103,T100104,T100105,T100106,T100107,T100108,T100109,T100110,T100111  
127 T100112,T100113,T100114,T100115,T100116,T100117,T100118,T100119,T100120,T100121  
128 T100122,T100123,T100124,T100125,T100126,T100127,T100128,T100129,T100130,T100131  
129 T100132,T100133,T100134,T100135,T100136,T100137,T100138,T100139,T100140,T100141  
130 T100142,T100143,T100144,T100145,T100146,T100147,T100148,T100149,T100150,T100151  
131 T100152,T100153,T100154,T100155,T100156,T100157,T100158,T100159,T100160,T100161  
132 T100162,T100163,T100164,T100165,T100166,T100167,T100168,T100169,T100170,T100171  
133 T100172,T100173,T100174,T100175,T100176,T100177,T100178,T100179,T100180,T100181  
134 T100182,T100183,T100184,T100185,T100186,T100187,T100188,T100189,T100190,T100191  
135 T100192,T100193,T100194,T100195,T100196,T100197,T100198,T100199,T100200,T100201  
136 T100202,T100203,T100204,T100205,T100206,T100207,T100208,T100209,T100210,T100211  
137 T100212,T100213,T100214,T100215,T100216,T100217,T100218,T100219,T100220,T100221  
138 T100222,T100223,T100224,T100225,T100226,T100227,T100228,T100229,T100230,T100231  
139 T100232,T100233,T100234,T100235,T100236,T100237,T100238,T100239,T100240,T100241  
140 T100242,T100243,T100244,T100245,T100246,T100247,T100248,T100249,T100250,T100251  
141 T100252,T100253,T100254,T100255,T100256,T100257,T100258,T100259,T100260,T100261  
142 T100262,T100263,T100264,T100265,T100266,T100267,T100268,T100269,T100270,T100271  
143 T100272,T100273,T100274,T100275,T100276,T100277,T100278,T100279,T100280,T100281  
144 T100282,T100283,T100284,T100285,T100286,T100287,T100288,T100289,T100290,T100291  
145 T100292,T100293,T100294,T100295,T100296,T100297,T100298,T100299,T100300,T100301  
146 T100302,T100303,T100304,T100305,T100306,T100307,T100308,T100309,T100310,T100311  
147 T100312,T100313,T100314,T100315,T100316,T100317,T100318,T100319,T100320,T100321  
148 T100322,T100323,T100324,T100325,T100326,T100327,T100328,T100329,T100330,T100331  
149 T100332,T100333,T100334,T100335,T100336,T100337,T100338,T100339,T100340,T100341  
150 T100342,T100343,T100344,T100345,T100346,T100347,T100348,T100349,T100350,T100351  
151 T100352,T100353,T100354,T100355,T100356,T100357,T100358,T100359,T100360,T100361  
152 T100362,T100363,T100364,T100365,T100366,T100367,T100368,T100369,T100370,T100371  
153 T100372,T100373,T100374,T100375,T100376,T100377,T100378,T100379,T100380,T100381  
154 T100382,T100383,T100384,T100385,T100386,T100387,T100388,T100389,T100390,T100391  
155 T100392,T100393,T100394,T100395,T100396,T100397,T100398,T100399,T100400,T100401  
156 T100402,T100403,T100404,T100405,T100406,T100407,T100408,T100409,T100410,T100411  
157 T100412,T100413,T100414,T100415,T100416,T100417,T100418,T100419,T100420,T100421  
158 T100422,T100423,T100424,T100425,T100426,T100427,T100428,T100429,T100430,T100431  
159 T100432,T100433,T100434,T100435,T100436,T100437,T100438,T100439,T100440,T100441  
160 T100442,T100443,T100444,T100445,T100446,T100447,T100448,T100449,T100450,T100451  
161 T100452,T100453,T100454,T100455,T100456,T100457,T100458,T100459,T100460,T100461  
162 T100462,T100463,T100464,T100465,T100466,T100467,T100468,T100469,T100470,T100471  
163 T100472,T100473,T100474,T100475,T100476,T100477,T100478,T100479,T100480,T100481  
164 T100482,T100483,T100484,T100485,T100486,T100487,T100488,T100489,T100490,T100491  
165 T100492,T100493,T100494,T100495,T100496,T100497,T100498,T100499,T100500,T100501  
166 T100502,T100503,T100504,T100505,T100506,T100507,T100508,T100509,T100510,T100511  
167 T100512,T100513,T100514,T100515,T100516,T100517,T100518,T100519,T100520,T100521  
168 T100522,T100523,T100524,T100525,T100526,T100527,T100528,T100529,T100530,T100531  
169 T100532,T100533,T100534,T100535,T100536,T100537,T100538,T100539,T100540,T100541  
170 T100542,T100543,T100544,T100545,T100546,T100547,T100548,T100549,T100550,T100551  
171 T100552,T100553,T100554,T100555,T100556,T100557,T100558,T100559,T100560,T100561  
172 T100562,T100563,T100564,T100565,T100566,T100567,T100568,T100569,T100570,T100571  
173 T100572,T100573,T100574,T100575,T100576,T100577,T100578,T100579,T100580,T100581  
174 T100582,T100583,T100584,T100585,T100586,T100587,T100588,T100589,T100590,T100591  
175 T100592,T100593,T100594,T100595,T100596,T100597,T100598,T100599,T100600,T100601  
176 T100602,T100603,T100604,T100605,T100606,T100607,T100608,T100609,T100610,T100611  
177 T100612,T100613,T100614,T100615,T100616,T100617,T100618,T100619,T100620,T100621  
178 T100622,T100623,T100624,T100625,T100626,T100627,T100628,T100629,T100630,T100631  
179 T100632,T100633,T100634,T100635,T100636,T100637,T100638,T100639,T100640,T100641  
180 T100642,T100643,T100644,T100645,T100646,T100647,T100648,T100649,T100650,T100651  
181 T100652,T100653,T100654,T100655,T100656,T100657,T100658,T100659,T100660,T100661  
182 T100662,T100663,T100664,T100665,T100666,T100667,T100668,T100669,T100670,T100671  
183 T100672,T100673,T100674,T100675,T100676,T100677,T100678,T100679,T100680,T100681  
184 T100682,T100683,T100684,T100685,T100686,T100687,T100688,T100689,T100690,T100691  
185 T100692,T100693,T100694,T100695,T100696,T100697,T100698,T100699,T100700,T100701  
186 T100702,T100703,T100704,T100705,T100706,T100707,T100708,T100709,T100710,T100711  
187 T100712,T100713,T100714,T100715,T100716,T100717,T100718,T100719,T100720,T100721  
188 T100722,T100723,T100724,T100725,T100726,T100727,T100728,T100729,T100730,T100731  
189 T100732,T100733,T100734,T100735,T100736,T100737,T100738,T100739,T100740,T100741  
190 T100742,T100743,T100744,T100745,T100746,T100747,T100748,T100749,T100750,T100751  
191 T100752,T100753,T100754,T100755,T100756,T100757,T100758,T100759,T100760,T100761  
192 T100762,T100763,T100764,T100765,T100766,T100767,T100768,T100769,T100770,T100771  
193 T100772,T100773,T100774,T100775,T100776,T100777,T100778,T100779,T100780,T100781  
194 T100782,T100783,T100784,T100785,T100786,T100787,T100788,T100789,T100790,T100791  
195 T100792,T100793,T100794,T100795,T100796,T100797,T100798,T100799,T100800,T100801  
196 T100802,T100803,T100804,T100805,T100806,T100807,T100808,T100809,T100810,T100811  
197 T100812,T100813,T100814,T100815,T100816,T100817,T100818,T100819,T100820,T100821  
198 T100822,T100823,T100824,T100825,T100826,T100827,T100828,T100829,T100830,T100831  
199 T100832,T100833,T100834,T100835,T100836,T100837,T100838,T100839,T100840,T100841  
200 T100842,T100843,T100844,T100845,T100846,T100847,T100848,T100849,T100850,T100851  
201 T100852,T100853,T100854,T100855,T100856,T100857,T100858,T100859,T100860,T100861  
202 T100862,T100863,T100864,T100865,T100866,T100867,T100868,T100869,T100870,T100871  
203 T100872,T100873,T100874,T100875,T100876,T100877,T100878,T100879,T100880,T100881  
204 T100882,T100883,T100884,T100885,T100886,T100887,T100888,T100889,T100890,T100891  
205 T100892,T100893,T100894,T100895,T100896,T100897,T100898,T100899,T100900,T100901  
206 T100902,T100903,T100904,T100905,T100906,T100907,T100908,T100909,T100910,T100911  
207 T100912,T100913,T100914,T100915,T100916,T100917,T100918,T100919,T100920,T100921  
208 T100922,T100923,T100924,T100925,T100926,T100927,T100928,T100929,T100930,T100931  
209 T100932,T100933,T100934,T100935,T100936,T100937,T100938,T100939,T100940,T100941  
210 T100942,T100943,T100944,T100945,T100946,T100947,T100948,T100949,T100950,T100951  
211 T100952,T100953,T100954,T100955,T100956,T100957,T100958,T100959,T10
```


APPENDIX 2

ROSEN BROCK HILL CLIMB METHOD [16-17]

Unlike the Box-Complex technique this method requires only one feasible starting case (Initial guesses). In this method the initial guesses is chosen and the appropriate constraints are posed on all the variables. Once the feasible starting case is given, initial step sizes, E_i ($i=1, 2, \dots, N$) are picked up and the objective function is evaluated. Then the first variable \bar{X}_1 is stepped a distance ' E_1 ' parallel to the axis and the objective function is evaluated. The current best objective function is defined by a value of F_0 where the constraints are satisfied and ' H ' the current best objective function value for a point where the constraints are satisfied in addition to the boundary zones are not violated. ' H ' and ' F_0 ' are initially set equal to the objective function value at the starting point. If in the current point objective function evaluation, H is worse than F_0 , or if the constraints are violated, then the trial is a failure and the value of ' E_1 ', is decreased by a factor of 0.5 and the direction of movement is reversed. Also if there is function improvement then E_1 is increased by three times its original value and the search is carried out in the next direction.

On the otherhand, if the current point lies within a boundary zone, the objective function is modified as follows:

$$F_{(\text{new})} = F_{(\text{old})} - (F_{(\text{old})} - H) (3 P_w - 4 P_w^2 + 2 P_w^2)$$

$$\text{where } P_w = \frac{G_K + (H_K - G_K) 10^{-4} - X_K}{(H_K - G_K) 10^{-4}}$$

For lower zone, where G_K is lower constraint and H_K is upper constraint.

$$\text{and } P_w = \frac{X_K - (H_K - (H_K - G_K) 10^{-4})}{(H_K - G_K) 10^{-4}}$$

For upper zone,

At the inner edge of the boundary zone, $P_w = 0$, that is the function is unaltered ($F_{(\text{new})} = F_{(\text{old})}$). Then the function value is replaced by the best current function value in the feasible region and not in the boundary zone. For the function which improves as the constraints is approached, the modified function has an optimum in the boundary zone.

After search in all the coordinate directions, it is checked for convergence. If convergence is not achieved then it is checked for one success and one failure in each direction and if it is not so then the whole procedure is repeated. On the other hand, if one success and one failure is achieved in each direction, then the axes are rotated according to the equation,

$$M_{i,j}^{(K+1)} = \frac{D_{i,j}^{(K)}}{\left[\sum_{l=1}^N (D_{l,j}^{(K)})^2 \right]^{1/2}}$$

where $D_{i,1}^{(K)} = A_{i,1}^{(K)}$

$$D_{i,j}^{(K)} = A_{i,j}^{(K)} - \sum_{l=1}^{j-1} \left[\sum_{n=1}^i M_{n,l}^{(K+1)} \right]$$

$$A_{i,j}^{(K)} = \sum_{l=j}^N d_i^{(K)} M_{i,l}^{(K)}, \quad j = 2, 3, \dots, N$$

Also i = variable index ($i = 1, 2, \dots, N$)

j = direction index ($j = 1, 2, \dots, N$)

K = stage index


d_i = sum of distance moved in the ' i ' direction since last rotation of axes.

$M_{i,j}$ = direction vector component normalized.

After rotating the axes the search is made in each of the x direction using the new coordinate axis.

$$x_{i(\text{new})}^{(K)} = x_{i(\text{old})}^{(K)} + E_j^{(K)} M_{i,j}^{(K)}$$

The above procedure is repeated until convergence is achieved. Figure 8 is the flow chart for the program used.

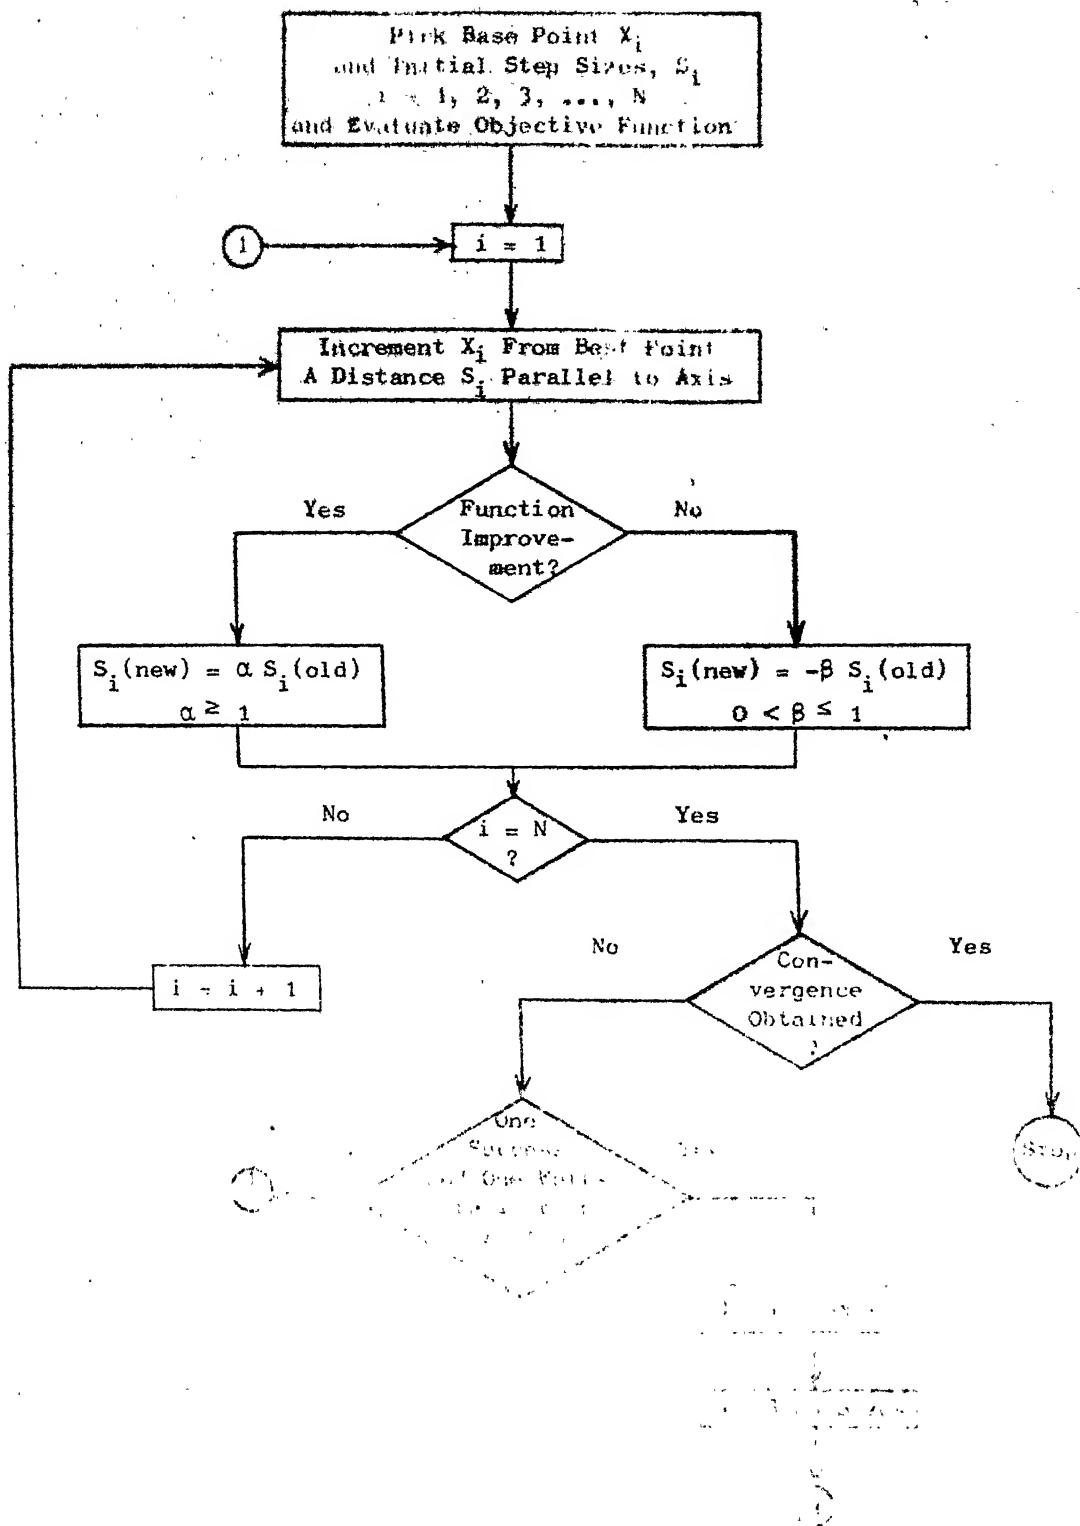

***** HILL 264 PARAMETER MODEL *****
PATH LINE PROGRAM FOR ROSENBOCK HILL, CALIF.

NASA1 : NUMBER OF GRAPHS TO BE PLOTTED.
 NASA2 : AN ARRAY CONTAINING NUMBER OF POINTS
 TO EACH GRAPH.
 NLY : NUMBER OF LINES IN Y-AXIS.
 NLYX : NUMBER OF LINES IN X-AXIS.

 DIMENSION X(1000), Y(1000), SX(11), SY(11), TBC(120)
 DIMENSION A(50,2,10), NASA(10), TSYMB(10), TMY(1000)
 DIMENSION TBC(120), TBL(120), TMY(1000), TMB(200)

100 COMPUTING
TYPE91,(TLL(I),I=1,MX)
TYPE92,(SX(I),I=1,MX)
DO 79 JIK=1,N
Y(JIK)=XXX(JIK)
79 END

EFFECT OF SHARPNESS INDEX ON DISTRIBUTION CURVE - " $F(D) = 1. / (+D^{**N})$ "

N=	1,000	5,000	10,000	50,000	100,000	200,000	500,000
D(I) FD(I) = CALCULATED FOR THE ABOVE SHARPNESS INDEX N							
0.500	66.667	96.970	99.902	100.000	100.000	100.000	100.000
0.600	62.500	92.785	99.399	100.000	100.000	100.000	100.000
0.700	58.824	85.611	97.253	100.000	100.000	100.000	100.000
0.750	57.143	80.821	94.669	100.000	100.000	100.000	100.000
0.770	56.497	78.698	93.173	100.000	100.000	100.000	100.000
0.790	55.866	76.470	91.351	99.999	100.000	100.000	100.000
0.810	55.249	74.147	89.160	99.997	100.000	100.000	100.000
0.830	54.645	71.741	86.568	99.991	100.000	100.000	100.000
0.850	54.054	69.266	83.551	99.970	100.000	100.000	100.000
0.870	53.476	66.737	80.101	99.905	100.000	100.000	100.000
0.890	52.910	64.168	76.230	99.706	99.999	100.000	100.000
0.900	52.632	62.874	74.147	99.487	99.997	100.000	100.000
0.910	52.356	61.575	71.973	99.112	99.992	100.000	100.000
0.920	52.083	60.274	69.716	98.477	99.976	100.000	100.000
0.930	51.813	58.973	67.386	97.413	99.930	100.000	100.000
0.940	51.546	57.673	64.994	95.664	99.795	100.000	100.000
0.950	51.282	56.377	62.549	92.855	99.411	99.996	100.000
0.960	51.020	55.085	60.066	88.505	98.341	99.972	100.000
0.970	50.761	53.800	57.556	82.097	95.461	99.774	100.000
0.980	50.505	52.523	55.034	73.305	88.291	98.272	99.000
1.000	50.000	50.000	50.000	50.000	50.000	50.000	50.000
1.050	48.780	43.931	38.039	8.021	0.755	0.006	0.000
1.100	47.619	38.307	27.826	0.845	0.007	0.000	0.000
1.150	46.512	33.208	19.819	0.092	0.000	0.000	0.000
1.200	45.455	28.667	13.905	0.011	0.000	0.000	0.000
1.250	44.444	24.681	9.696	0.001	0.000	0.000	0.000
1.300	43.478	21.218	6.763	0.000	0.000	0.000	0.000
1.350	42.553	18.235	4.738	0.000	0.000	0.000	0.000
1.400	41.667	15.678	3.342	0.000	0.000	0.000	0.000
1.450	40.816	13.496	2.376	0.000	0.000	0.000	0.000
1.500	40.000	11.636	1.705	0.000	0.000	0.000	0.000
1.600	38.462	9.706	0.901	0.000	0.000	0.000	0.000
1.700	37.037	6.580	0.494	0.000	0.000	0.000	0.000
1.800	35.714	5.026	0.279	0.000	0.000	0.000	0.000
1.900	34.483	3.882	0.163	0.000	0.000	0.000	0.000
2.000	33.333	3.030	0.098	0.000	0.000	0.000	0.000

APPENDIX -3

EFFICACY OF SHARPNESS INDEX AND LIMITING REDUCED PLASTICITY IN DISTORTION
 $F(D) = 1 / (1 + ((D - D_L) / (1 - D_L)))^{**N}$

SHARPNESS INDEX "TS" : 2.0

INPUT : 0.50 0.60 0.70 0.80 0.90

D(T) F(D(T))=CALCULATED FOR THE ABOVE VALUES OF T AND TS

0.500	100.000	94.118	89.231	80.769	5.882
0.600	96.154	100.000	90.000	50.000	10.000
0.700	95.207	94.118	100.000	80.000	20.000
0.750	80.000	87.671	97.297	94.118	30.769
0.770	77.423	84.701	94.837	97.800	37.175
0.790	74.828	81.591	91.743	99.751	45.249
0.810	72.233	78.393	88.149	99.751	55.249
0.830	69.657	75.153	94.191	97.800	67.114
0.850	67.114	71.910	80.000	94.118	80.000
0.870	64.576	68.699	75.694	89.087	91.743
0.880	62.171	65.547	71.372	83.160	99.010
0.891	60.741	62.476	67.114	76.775	99.010
0.902	58.341	59.502	62.981	70.299	91.743
0.913	55.957	58.055	60.976	67.114	86.207
0.924	53.249	56.637	59.016	64.000	80.000
0.935	51.159	55.249	57.107	60.976	73.529
0.947	53.090	53.990	55.249	58.055	67.114
0.958	52.040	52.562	53.444	55.249	60.976
0.969	51.010	51.265	51.694	52.562	55.249
1.000	50.000	50.000	50.000	50.000	50.000
1.050	45.249	44.138	42.353	39.024	30.769
1.1	40.984	39.024	36.000	30.769	20.000
1.150	37.175	34.595	30.769	24.615	13.793
1.20	33.794	30.769	25.471	20.000	10.000
1.25	30.769	27.469	22.930	16.495	7.547
1.30	28.031	24.615	20.000	13.793	5.882
1.35	25.707	22.145	17.561	11.679	4.706
1.40	22.585	20.000	15.517	10.000	3.846
1.45	21.592	18.130	13.793	8.649	3.200
1.50	20.000	16.495	12.329	7.547	2.703
1.600	17.123	13.793	10.000	5.882	2.000
1.700	14.793	11.679	8.257	4.706	1.538
1.800	12.887	10.000	6.923	3.846	1.220
1.900	11.312	8.649	5.882	3.200	0.990
2.000	10.000	7.547	5.882	2.703	0.920

APPENDIX -3

SHARPNESS INDEX N TS : 4.0

MPT : 0.50 0.60 0.70 0.80 0.90

DC(I) FD(I)-CALCULATED FOR THE ABOVE VALUES OF N AND TS

0.500	100.000	99.611	98.505	96.495	93.389
0.600	99.840	100.000	98.780	97.000	91.220
0.700	97.504	99.611	100.000	94.118	85.882
0.750	94.118	98.061	99.923	90.511	76.495
0.770	92.163	96.841	99.704	99.940	75.933
0.790	89.834	95.156	99.197	99.999	70.563
0.810	87.126	92.939	98.225	99.999	60.383
0.830	84.051	90.146	96.594	99.949	50.639
0.850	80.639	86.761	94.118	90.611	44.118
0.870	76.931	82.849	90.653	98.522	39.197
0.890	72.958	78.353	86.141	95.061	39.990
0.910	68.677	73.149	80.639	91.617	39.990
0.930	64.511	68.341	74.323	84.853	39.197
0.950	60.512	65.703	70.942	80.639	37.504
0.970	56.312	63.044	67.465	75.964	34.118
0.990	52.262	60.383	63.932	70.942	38.527
1.010	58.156	57.734	60.383	65.703	30.639
1.030	54.073	55.111	56.856	60.383	20.942
1.050	52.019	52.530	53.385	55.111	20.383
1.070	50.000	50.000	50.000	50.000	50.000
1.080	40.583	38.435	35.055	29.058	16.495
1.100	32.535	29.058	24.036	16.495	5.882
1.150	25.933	21.860	16.495	9.635	2.496
1.200	20.654	16.495	11.473	5.882	1.220
1.250	15.195	12.542	9.132	3.755	0.662
1.300	13.739	9.635	5.982	2.496	0.389
1.350	10.693	7.485	4.341	1.718	0.243
1.400	8.697	5.882	3.263	1.220	0.160
1.450	7.127	4.675	2.496	0.888	0.109
1.500	5.982	3.755	1.939	0.662	0.077
1.600	4.094	2.496	1.220	0.389	0.042
1.700	2.926	1.718	0.803	0.243	0.024
1.800	2.141	1.220	0.550	0.160	0.015
1.900	1.661	0.883	0.389	0.109	0.010
2.000	1.220	0.662	0.283	0.077	0.010

APPENDIX - 3

SHARPNESS INDEX N TS : 6.0

MODE: 0.50 0.60 0.70 0.80 0.90

D(I) FD(I)=CALCULATED FOR THE ABOVE VALUES OF N AND TS

0.500 100.000 99.976 99.929 99.971 100.04

0.600 99.994 100.000 99.963 99.999 0.137

0.700 99.592 99.976 100.020 99.462 1.538

0.750 98.462 99.723 99.998 99.976 9.071

0.770 97.581 99.414 99.984 99.999 17.162

0.790 96.333 98.864 99.927 100.000 36.081

0.810 94.625 97.949 99.758 100.000 65.298

0.830 92.366 96.512 99.342 99.999 89.474

0.850 89.474 94.375 98.462 99.976 98.462

0.870 85.295 91.359 95.795 99.817 99.927

0.890 81.610 97.313 93.938 99.176 100.000

0.910 77.517 92.191 89.474 97.306 100.000

0.930 73.148 76.029 83.121 92.987 99.927

0.950 68.217 72.614 79.230 89.474 99.592

0.970 63.040 60.023 74.912 84.891 98.462

0.990 57.253 65.298 70.237 79.230 95.542

1.010 52.176 61.486 65.298 72.614 89.474

1.030 46.912 57.634 60.204 65.299 79.230

1.050 43.127 53.790 55.068 57.634 65.298

1.070 39.290 50.000 50.000 50.000 50.000

1.090 35.081 33.033 28.395 20.770 8.071

1.110 25.088 20.770 15.109 9.071 1.538

1.130 17.162 12.890 9.071 3.364 0.408

1.150 11.724 8.071 4.458 1.538 0.137

1.170 8.071 5.151 2.566 0.765 0.054

1.190 5.625 3.364 1.538 0.408 0.024

1.210 3.978 2.250 0.957 0.231 0.012

1.230 2.856 1.538 0.616 0.137 0.006

1.250 2.081 1.074 0.408 0.085 0.004

1.270 1.538 0.765 0.277 0.054 0.002

1.290 0.874 0.408 0.137 0.024 0.001

1.310 0.521 0.231 0.073 0.012 0.000

1.330 0.323 0.137 0.041 0.005 0.000

1.350 0.201 0.085 0.024 0.004 0.000

1.370 0.127 0.041 0.015 0.002 0.000

APPENDIX -3

STIFFNESS INDEX N TS : 8.0

NROT: 0.50 0.60 0.70 0.80 0.90

D(I) F(D(I))-CALCULATED FOR THE ABOVE VALUES OF N AND TS

0.500	100.000	99.998	96.245	3.755	0.002
0.600	100.000	100.000	99.985	50.000	0.015
0.700	99.935	99.998	100.000	99.611	0.389
0.750	99.611	99.961	100.000	99.998	3.755
0.770	99.282	99.894	99.999	100.000	12.920
0.790	98.736	99.742	99.993	100.000	31.811
0.810	97.963	99.426	99.967	100.000	69.907
0.830	96.525	98.819	99.876	100.000	94.549
0.850	94.549	97.725	99.611	99.998	99.611
0.870	91.781	95.869	98.948	99.977	99.993
0.890	87.991	92.968	97.477	99.932	100.000
0.91	83.152	88.185	94.549	99.170	100.000
0.93	77.956	82.332	89.337	96.912	99.993
0.95	72.533	78.586	85.633	94.549	99.935
0.97	67.077	74.426	81.131	90.900	99.611
0.99	65.084	69.907	75.856	85.633	98.348
0.99	62.120	65.106	69.907	78.586	94.549
0.99	58.993	60.117	63.459	69.907	85.633
0.99	54.032	55.046	56.739	60.117	69.907
1.00	50.000	50.000	50.000	50.000	50.000
1.05	31.811	28.014	22.562	14.367	3.755
1.10	19.859	14.367	9.100	3.755	0.389
1.15	10.920	7.259	3.755	1.124	0.065
1.20	5.746	3.755	1.652	0.389	0.015
1.25	3.755	2.015	0.777	0.152	0.004
1.30	2.275	1.124	0.389	0.065	0.002
1.35	1.413	0.650	0.205	0.031	0.001
1.40	0.890	0.389	0.114	0.015	0.000
1.45	0.585	0.240	0.065	0.008	0.000
1.50	0.360	0.152	0.039	0.004	0.000
1.55	0.182	0.065	0.015	0.002	0.000
1.60	0.091	0.031	0.007	0.001	0.000
1.65	0.048	0.015	0.003	0.000	0.000
1.70	0.026	0.008	0.002	0.000	0.000
1.75	0.015	0.004	0.001	0.000	0.000

APPENDIX - 3

SHARPNESS INDEX N TS : 10.0

NODT: 0.50 0.60 0.70 0.80 0.90

DODT	FD(I) - CALCULATED FOR THE ABOVE VALUES OF N AND TS				
	100.000	100.000	99.995	1.705	0.000
0.500	100.000	100.000	99.995	1.705	0.000
0.600	100.000	100.000	99.996	50.000	0.002
0.700	99.990	100.000	100.000	99.992	0.003
0.750	99.992	99.995	100.000	100.000	1.705
0.770	99.990	99.981	100.000	100.000	6.763
0.790	99.971	99.942	99.999	100.000	27.826
0.810	99.968	99.941	99.996	100.000	74.147
0.830	99.956	99.906	99.977	100.000	97.253
0.850	97.253	99.099	99.902	100.000	99.902
0.870	95.217	98.074	99.660	99.997	99.999
0.890	93.213	96.143	98.972	99.966	100.000
0.910	91.214	92.750	97.253	99.747	100.000
0.930	89.210	87.255	93.444	98.672	99.999
0.950	87.217	83.551	90.364	97.253	99.990
0.970	85.217	79.172	86.095	94.669	99.902
0.990	83.216	74.147	80.706	90.304	99.399
0.994	84.994	68.560	74.147	83.551	97.253
0.998	80.966	62.549	66.595	74.147	90.304
0.999	85.034	56.296	58.385	62.549	74.147
1.000	50.000	50.000	50.000	50.000	50.000
1.050	27.326	23.544	17.632	9.696	1.705
1.100	13.915	9.696	5.331	1.705	0.098
1.150	6.763	3.975	1.705	0.370	0.010
1.200	2.242	1.705	0.601	0.098	0.002
1.250	1.705	0.773	0.233	0.030	0.000
1.300	1.901	0.370	0.098	0.010	0.000
1.350	0.494	0.186	0.044	0.004	0.000
1.400	0.279	0.098	0.021	0.002	0.000
1.450	0.163	0.053	0.010	0.001	0.000
1.500	0.098	0.030	0.005	0.000	0.000
1.600	0.038	0.010	0.002	0.000	0.000
1.700	0.016	0.004	0.001	0.000	0.000
1.800	0.007	0.002	0.000	0.000	0.000
1.900	0.003	0.001	0.000	0.000	0.000
2.000	0.002	0.000	0.000	0.000	0.000

APPENDIX -3

STIFFNESS INDEX X TS : 12.0

APPENDIX -3
STIFFNESS INDEX X TS : 12.0

DCI	0.50	0.60	0.70	0.80	0.90
FDI(CALCULATED FOR THE ABOVE VALUES OF APPENDIX -3)					
0.500	100.000	100.000	99.235	97.765	96.000
0.600	100.000	100.000	100.000	98.000	96.000
0.700	99.998	100.000	100.000	99.976	99.924
0.750	99.976	99.999	100.000	100.000	99.765
0.770	99.939	99.997	100.000	100.000	99.116
0.790	99.865	99.997	100.000	100.000	94.164
0.810	99.672	99.998	99.999	100.000	77.977
0.830	99.271	99.997	99.996	100.000	98.635
0.850	98.631	99.996	99.976	100.000	99.976
0.870	97.821	99.997	99.890	100.000	100.000
0.890	96.872	97.935	99.585	99.993	100.000
0.910	95.7	95.516	98.635	99.923	100.000
0.930	94.138	90.952	96.040	99.434	100.000
0.950	92.291	87.547	93.570	98.635	99.998
0.960	91.077	83.235	89.915	96.930	99.976
0.970	90.117	77.977	84.777	93.570	99.783
0.975	87.754	71.820	77.977	87.547	98.635
0.980	86.117	64.920	69.591	77.977	93.570
0.985	85.031	57.537	60.032	64.920	77.977
0.990	83.280	50.000	50.000	50.000	50.000
0.995	81.164	49.570	43.590	6.430	0.765
1.000	79.085	46.430	3.070	0.765	0.024
1.010	74.116	2.143	0.765	0.121	0.002
1.020	7.733	0.765	0.217	0.024	0.000
1.025	7.765	0.294	0.069	0.006	0.000
1.030	0.354	0.121	0.024	0.002	0.000
1.035	0.171	0.053	0.009	0.001	0.000
1.040	0.086	0.024	0.004	0.000	0.000
1.045	0.045	0.012	0.002	0.000	0.000
1.050	0.024	0.006	0.001	0.000	0.000
1.060	0.008	0.002	0.000	0.000	0.000
1.070	0.003	0.001	0.000	0.000	0.000
1.080	0.001	0.000	0.000	0.000	0.000
1.090	0.000	0.000	0.000	0.000	0.000
1.100	0.000	0.000	0.000	0.000	0.000

LISTING OF NUMERIC VALUES TO BE USED IN OUR MODEL

VESSEL	DL	N	FU	FL	GPE
FEED SIZE					
DENSE MEDIUM VESSEL					
6 X 4	0.9428	9.5	96.53	0.469	0.00985
4 X 2	0.8890	12.95	96.52	0.005	0.00985
2 X 1	0.8440	13.27	96.47	0.005	0.0135
1 X 1/2	0.7737	13.26	99.99	0.2E-05	0.0188
1/2 X 1/4	0.7500	12.3	96.99	3.03	0.02415
COMPOSITE	0.8045	12.59	99.99	1.63	0.01745
RAIM JIG					
6 X 3	0.5310	20.647	94.13	0.005	0.027
3 X 13/8	0.6730	13.60	99.6	5.17	0.0286
13/8 X 1/2	0.6302	9.27	99.995	2.27	0.0453
1/2 X 1/4	0.6670	4.42	99.42	5.39	0.0916
1/4 X 8	0.6819	3.73	99.99	4.03	0.101
8 X 14	0.6856	2.84	99.88	0.43	0.125
14 X 28	0.5979	2.796	99.52	15.05	0.241
COMPOSITE	0.8179	3.132	99.80	3.92	0.069
DENSE MEDIUM CYCLONE					
1/4 X 1/2	0.8730	15.23	99.88	0.248	0.0092
1/4 X 3/8	0.8730	13.45	99.18	0.295	0.0105
3/8 X 1/4	0.9010	10.80	97.67	0.1097	0.0103
1/4 X 8	0.8760	9.799	99.97	2.49	0.0143
8 X 14	0.2230	4.67	98.27	2.85	0.0219
14 X 28	0.7580	10.34	96.38	1.414	0.0283
COMPOSITE	0.9213	12.744	99.99	2.89	0.016
W.D. CYCLONE					
1/4 X 4	1.1115	8.259	98.24	0.005	0.0798
1 X 3	1.135	9.29	97.63	0.005	0.0982
8 X 14	1.2198	9.0	92.59	0.963	0.1081
14 X 28	0.11	10.22	92.68	0.065	0.106
28 X 48	1.1505	9.42	92.93	0.005	0.109
18 X 100	0.4700	7.23	94.84	4.544	0.0918
100 X 200	0.5000	6.49	99.88	10.91	0.1033
COMPOSITE	0.6660	2.39	92.63	3.18	0.1823
CONCENTRATING TABLE					
3/8 X 1/4	0.7310	10.97	97.47	0.1E-05	0.02796
1/4 X 8	0.7513	6.87	99.39	0.005	0.04022
8 X 14	0.5700	8.81	99.99	1.02	0.04182
14 X 28	0.7450	4.56	99.99	0.998	0.06292
28 X 48	0.5119	7.28	98.77	2.31	0.07741
48 X 100	0.4575	6.53	98.10	0.005	0.0937
100 X 200	0.6059	4.69	99.99	18.445	0.151
COMPOSITE	0.7279	5.95	98.64	3.67	0.05503

FEED SIZE FRACTION IS IN INCHES AND MESH

DL = LIQUIDATING REDUCED DENSITY

N = SHARPNESS INDEX

FU = MAXIMUM FEED REPORTING TO CLEAN COAL PRODUCT

FL = MINIMUM COAL REPORTING TO REFUSE

GPE = GENERALIZED PROBABLE ERROR

APPENDIX - 4

COMPARISON OF ABSOLUTE ERROR AND STANDARD DEVIATION BETWEEN
GOTTFRIED EQUATION AND OUR MODEL

VESSEL		FEED SIZE FRACTION		ABSOLUTE ERROR GOTTFRIED		STANDARD DEVIATION GOTTFRIED	
DENSE MEDIUM VESSEL		6 X 4	2	0.15E+38	0.6600000000000000	0.6600000000000000	0.6600000000000000
		4 X 2		3.1893	0.0000000000000000	0.0000000000000000	0.0000000000000000
		2 X 1		1.5997	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1 X 1/2		1.4244	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1/2 X 1/4		1.4234	0.0000000000000000	0.0000000000000000	0.0000000000000000
		COMPOSITE		315.56	0.0000000000000000	0.0000000000000000	0.0000000000000000
BAUM JIG		6 X 3		328.7	0.47419	0.47419	0.47419
		3 X 1 3/8		329.1655	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1 3/8 X 1/2		383.773	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1/4 X 1/4		2.88.177	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1/4 X 1/8		2.12.896	0.0000000000000000	0.0000000000000000	0.0000000000000000
		8 X 1/4		1.21.73	0.0000000000000000	0.0000000000000000	0.0000000000000000
		14 X 28		1.36.03	0.0000000000000000	0.0000000000000000	0.0000000000000000
		COMPOSITE			0.0000000000000000	0.0000000000000000	0.0000000000000000
DENSE MEDIUM CYCLONE		3/4 X 1/2		3.7228	0.47419	0.47419	0.47419
		3/4 X 3/8		4.49.459	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1/4 X 1/4		4.84.162	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1/4 X 1/8		1.15.37	0.0000000000000000	0.0000000000000000	0.0000000000000000
		8 X 1/4		1.16.72	0.0000000000000000	0.0000000000000000	0.0000000000000000
		14 X 28		8.21.62	0.0000000000000000	0.0000000000000000	0.0000000000000000
		COMPOSITE			0.0000000000000000	0.0000000000000000	0.0000000000000000
HYDRO CYCLONE		1/4 X 4		10.5	0.47419	0.47419	0.47419
		1/4 X 2		10.79.45	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1/4 X 1/4		10.87.45	0.0000000000000000	0.0000000000000000	0.0000000000000000
		1/4 X 1/8		2.12.80.0	0.0000000000000000	0.0000000000000000	0.0000000000000000
		28 X 28		2.28.00.0	0.0000000000000000	0.0000000000000000	0.0000000000000000
		COMPOSITE			0.0000000000000000	0.0000000000000000	0.0000000000000000
CONCENTRATING TABLE		3/8 X 1/4		2.573	0.47419	0.47419	0.47419
		3/8 X 1/8		1.36.459	0.0000000000000000	0.0000000000000000	0.0000000000000000
		8 X 1/4		1.10.459	0.0000000000000000	0.0000000000000000	0.0000000000000000
		12.8 X 28		1.48.459	0.0000000000000000	0.0000000000000000	0.0000000000000000
		48 X 120		1.100.459	0.0000000000000000	0.0000000000000000	0.0000000000000000
		COMPOSITE			0.0000000000000000	0.0000000000000000	0.0000000000000000

TABUE = 5.3.10

DATA USED : LIQUEFIED MEDIUM VESSEL - COMPOSITE FIBER 6675 X 174 **

USING GOTFRIED EQUATION

$$\begin{aligned} X(1) &= 3.7838 \quad X(2) = 1.7926000E+03 \quad X(3) = 0.97920 \\ X(4) &= 0.9071 \quad X(5) = 1.0710000E+01 \end{aligned}$$

FC(I)	FC(I)	FC(I)	DIFF
0.8056	100.00	37.35	62.65
0.8500	99.70	50.70	19.92
0.9000	99.10	48.99	1.11
0.9300	98.00	42.05	5.55
0.9580	94.10	42.25	1.85
0.9700	90.10	34.61	5.19
1.0000	50.00	40.06	5.94
1.0270	17.00	16.88	1.02
1.0370	12.00	2.36	2.64
1.0520	5.00	1.87	3.13
1.0680	2.10	1.09	1.01
1.1466	0.70	1.07	-0.37
1.1751	0.30	1.07	-0.77

ABSOLUTE ERROR IN FULL RANGE = 0.31517986E+03

STD. DEVIATION IN FULL RANGE = 0.51249379E+01

ABSOLUTE ERROR WITH IN RANGE = 0.71783169E+01

STD. DEVIATION WITH IN RANGE = 0.11164167E+01

FC(I) = 5.3.10 COMPILED TS 1.071 % = 97.920 %

5.3.10 C GFR MODEL

$$\begin{aligned} X(1) &= 0.8045 \quad X(2) = 1.2530000E+02 \quad X(3) = 99.99000 \\ X(4) &= 1.6268 \end{aligned}$$

FC(I)	FC(I)	FC(I)	DIFF
0.8500	100.00	99.99	0.01
0.9500	99.70	99.99	-0.29
1.0000	99.10	99.98	-0.88
1.0500	98.00	99.61	-1.61
1.0626	94.10	95.38	-1.28
1.0700	90.10	88.91	1.19
1.0880	50.00	50.00	0.00
1.1227	17.00	17.32	0.56
1.1370	12.00	11.31	0.69
1.1620	5.00	4.51	0.49
1.1700	2.10	2.50	-0.40
1.1751	0.70	1.73	-1.03
1.1751	0.30	1.66	-1.36

ABSOLUTE ERROR IN FULL RANGE = 0.81633634E+00

STD. DEVIATION IN FULL RANGE = 0.26082183E+00

ABSOLUTE ERROR WITH IN RANGE = 0.77036728E+00

STD. DEVIATION WITH IN RANGE = 0.29256856E+00

FC(I) = RANGE COVERED TS 1.627 % = 99.990 %

DATA USED : BAUMJTG = 1/2 " x 1/4 " ST2R CPER

USING GOLDBECK EQUATION.

$$X(1) = 1.7488 \quad X(2) = .78043000E+01 \quad X(3) = 0.98870$$

$$X(4) = 0.7998 \quad X(5) = .88248000E+01$$

DCD	FC(T)	FCAL	DTFC
0.7400	100.00	89.82	10.18
0.7630	99.76	94.24	5.46
0.7850	99.90	95.99	1.91
0.8110	97.10	97.26	-0.16
0.8350	94.50	94.44	0.01
0.8500	92.20	91.82	0.38
0.8650	89.20	89.59	0.51
1.0000	50.00	50.00	0.00
1.0580	27.50	29.57	-2.07
1.0980	25.00	27.00	-2.80
1.1000	22.00	25.07	-3.07
1.1450	10.70	20.92	-1.22
1.1880	16.00	16.50	0.40
1.2320	14.50	13.45	1.05
1.3160	11.50	10.53	0.87
1.4180	8.60	9.18	0.58
1.5530	6.10	6.56	-2.76
1.7400	4.00	5.93	-4.93

$$\text{ABSOLUTE ERROR IN FULL RANGE} = 0.10772549E+02$$

$$\text{STANDARD DEVIATION IN FULL RANGE} = 0.79603974E+01$$

$$\text{ABSOLUTE ERROR WITH IN RANGE} = 1.31285733E+01$$

$$\text{STANDARD DEVIATION WITH IN RANGE} = 0.56853500E+00$$

FC(T) = RANGE COVERED IS 8.825 % = 88.870 %

USING DUE EQUATION

$$X(1) = 0.6876 \quad X(2) = .14200000E+01 \quad X(3) = 99.42000$$

$$X(4) = 5.3940$$

DCD	FC(T)	FCAL	DTFC
0.7400	100.00	98.29	0.71
0.7630	99.70	99.00	0.70
0.7850	99.90	99.37	0.53
0.8110	97.10	96.93	0.17
0.8350	94.50	94.62	-0.12
0.8650	92.20	92.57	-0.37
1.0000	80.00	80.00	0.00
1.0580	50.00	51.00	-0.00
1.0980	27.50	29.20	-0.70
1.1000	25.00	26.45	-1.45
1.1450	22.00	24.59	-1.79
1.1880	12.70	12.91	-0.21
1.2320	16.00	15.82	0.08
1.3160	14.50	12.93	1.57
1.4180	8.60	7.67	0.93
1.5530	6.10	5.50	-0.40
1.7400	4.00	5.96	-1.96

$$\text{ABSOLUTE ERROR IN FULL RANGE} = 0.104930139E+01$$

$$\text{STANDARD DEVIATION IN FULL RANGE} = 0.2484423694E+00$$

$$\text{ABSOLUTE ERROR WITH IN RANGE} = 0.937576578E+00$$

$$\text{STANDARD DEVIATION WITH IN RANGE} = 0.258725179E+00$$

FC(T) = RANGE COVERED IS 5.333 % = 99.420 %

TABLE - 5.3.2

SOLVED : TANJIG - 14 X 16 4534 SIZE

USTNG GOTPTED EQUATION

$$X(1) = 2.4415 \quad X(2) = .84770000E-01 \quad X(3) = 9.58574$$

$$X(4) = 0.6079 \quad X(5) = .29301000E+00$$

T(1)	FD(T)	FCAL	DIFF
0.5980	100.00	97.92	2.08
0.6120	99.60	97.97	1.63
0.6440	99.00	97.73	1.27
0.6420	97.50	95.58	1.92
0.7200	94.80	94.21	0.59
0.7400	92.50	92.43	0.07
0.7800	87.30	87.78	-0.48
0.8500	76.00	76.75	-0.75
1.0000	50.00	49.99	0.01
1.0460	42.20	43.55	-1.35
1.0640	40.00	41.11	-1.41
1.0940	37.60	38.35	-0.75
1.1460	34.30	34.41	-0.11
1.2420	29.80	30.72	-0.92
1.3380	26.70	29.59	-2.89
1.4900	22.90	29.31	-6.41
1.5780	19.30	29.30	-10.00
2.1660	14.30	29.30	-15.00

ABSOLUTE ERROR IN FULL RANGE = 0.21724075E+02

STANDARD DEVIATION IN FULL RANGE = 0.11304365E+01

ABSOLUTE ERROR WITH IN RANGE = 0.37181508E+00

STANDARD DEVIATION WITH IN RANGE = 0.41756799E+00

TOTAL PERCENT ERROR IS 29.301 % = 62.674 %

SL G 63R 400E1

$$X(1) = 0.5879 \quad X(2) = .27951300E+01 \quad X(3) = 90.52260$$

$$X(4) = 19.0469$$

T(1)	FD(T)	FCAL	DIFF
0.5980	100.00	99.52	0.48
0.6120	99.60	99.48	0.32
0.6440	99.00	99.07	-0.07
0.6420	97.50	97.64	-0.14
0.7200	94.80	94.83	-0.03
0.7400	92.50	92.74	-0.24
0.7700	87.30	87.39	-0.09
0.8500	76.00	75.40	0.60
1.0000	50.00	50.00	0.00
1.0460	42.20	44.13	-1.93
1.0640	40.00	42.11	-2.11
1.0940	37.50	39.07	-1.47
1.1460	34.30	34.65	-0.35
1.2420	29.80	29.77	1.03
1.3380	26.70	24.91	1.79
1.4900	22.90	21.23	1.67
1.5780	19.30	18.80	0.50
2.1660	14.30	16.91	-2.61

ABSOLUTE ERROR IN FULL RANGE = 0.14087595E+01

STANDARD DEVIATION IN FULL RANGE = 0.28786938E+00

ABSOLUTE ERROR WITH IN RANGE = 0.12144255E+01

STANDARD DEVIATION WITH IN RANGE = 0.29452449E+00

TOTAL PERCENT ERROR IS 15.047 % = 99.523 %

TABLE - 5.3.5
 DATA SET : FUSE LEDIUM CYCLONE = 9 X 14 KFH SIZE (PER)

USING GOTTERED EQUATION

X(1)= 2.6972 X(2)= .16777000E-02 X(3)= 0.97000
 X(4)= 0.9145 X(5)= .18855600E-01

O(I)	FD(I)	FCAL	DIFF
0.8300	100.00	51.07	48.93
0.8600	99.70	60.67	19.03
0.8800	99.40	63.19	6.22
0.9010	98.60	68.32	0.18
0.9250	96.92	70.65	-1.75
0.9420	95.10	75.75	-0.65
0.9550	92.30	80.23	2.57
0.9580	92.00	89.50	3.50
1.0000	50.00	50.01	0.01
1.0300	20.00	21.92	-1.92
1.0370	15.60	17.19	-1.56
1.0570	10.00	7.90	2.10
1.0750	7.30	3.99	3.31
1.1020	5.00	2.17	2.83
1.1130	2.90	1.89	1.01
1.1750	1.60	1.89	-0.29
1.2220	0.60	1.89	-1.29

ABSOLUTE ERROR IN FULL RANGE = 0.16760241E+03
 STANDARD DEVIATION IN FULL RANGE = 0.32365330E+01
 ABSOLUTE ERROR WITH IN RANGE = 0.47992528E+01
 STANDARD DEVIATION WITH IN RANGE = 0.69276711E+00

FD(1) = RANGE COVERED IS 1.885 % = 97.000 %

TESTING OUR MODEL

X(1)= 0.8290 X(2)= .90670000E+01 X(3)=98.27000
 X(4)= 2.8500

O(I)	FD(I)	FCAL	DIFF
0.8300	100.00	98.27	1.73
0.8600	99.70	99.27	1.43
0.8800	99.40	98.27	1.13
0.9010	98.60	98.23	0.37
0.9250	96.92	97.75	-0.85
0.9420	95.10	95.04	-0.94
0.9550	92.30	92.51	0.29
0.9580	92.00	91.24	0.76
1.0000	50.00	50.00	0.00
1.0300	20.00	20.41	-0.41
1.0370	15.60	16.39	-0.79
1.0570	10.00	9.25	0.75
1.0750	7.30	6.38	1.12
1.1020	5.00	4.17	0.83
1.1130	2.90	3.26	-0.36
1.1750	1.60	3.01	-1.41
1.2220	0.60	2.90	-2.30

ABSOLUTE ERROR IN FULL RANGE = 0.11420280E+01
 STANDARD DEVIATION IN FULL RANGE = 0.26716428E+00
 ABSOLUTE ERROR WITH IN RANGE = 0.51786109E+00
 STANDARD DEVIATION WITH IN RANGE = 0.22756561E+00

FD(1) = RANGE COVERED IS 2.850 % = 98.270 %

24000 - 5.3.6

DATA SHEET : PLEASE READ THE CYCLES = 11 X 28 PAPER SIZE

USING GOTFRID EQUATION

$X(1) = 3.2237 \quad X(2) = .25115000E-02 \quad X(3) = -.95759$
 $X(4) = .8603 \quad X(5) = .23930000E-01$

OC(1)	FD(1)	PCAF	LTFR
1.7750	100.00	85.44	14.56
1.8000	99.00	93.70	5.81
1.8350	98.00	97.26	9.92
1.8500	98.00	93.14	11.16
1.9000	95.00	97.00	11.20
1.9250	93.00	92.72	11.96
1.9400	91.00	87.79	11.93
1.9443	91.00	86.91	11.99
1.0000	50.00	50.00	11.00
1.0350	24.30	25.15	11.85
1.0450	17.00	19.55	12.55
1.0500	13.30	17.00	13.70
1.0600	8.90	12.88	13.98
1.0700	5.50	5.37	13.00
1.1250	3.50	2.79	11.81
1.3000	1.40	2.39	11.99

$A = 0.20525571E+02$
 $B = 0.11697741E+01$
 $C = 0.79273723E+01$
 $D = 0.93851966E+00$

100% + 10% = 110% \times 2,393.8 = 95,750.8

S13-2012-00051

X(1)= .7548 X(2)= .10040000E+02 X(3)=96.38000

FC11	FC1(I)	FCAB	DIFF
77.61	100.00	95.38	3.62
80.00	99.60	96.78	3.22
93.67	98.80	95.38	3.42
86.72	98.30	95.37	3.93
94.42	95.80	95.95	-0.15
92.26	93.70	94.24	-0.54
77.77	91.70	91.46	0.24
75.77	91.70	90.24	0.76
50.00	50.00	50.00	0.00
24.30	24.30	21.60	2.70
17.00	17.00	16.51	0.49
13.30	13.30	14.44	-1.14
8.90	8.90	11.28	-2.18
5.50	5.50	5.40	0.10
3.60	3.60	2.91	0.69
1.40	1.40	1.44	-0.04

RESIDUAL ERROR IN FULL RANGE = 0.30045999E+01
SINGLE PRECISION IN FULL RANGE = 0.44755632E+01
DOUBLE PRECISION WITH IN RANGE = 0.13664018E+01
SINGLE PRECISION WITH IN RANGE = 0.36964872E+01

END - RANGE COVERED IS 1.414 % = 96,380 %

TABLE - 5.3.3

DATA 1530 : HYDROCYCLONE = 14 X 28 MESH SIZE

USING GOTFRTED EQUATION

$$X(1) = 3.4993 \quad X(2) = .90573000E+01 \quad X(3) = 7.78264$$

$$X(4) = 0.5782 \quad X(5) = .39173000E+01$$

0(I)	FD(I)	FCAL	DIFF
0.3000	100.00	73.56	26.44
0.3800	98.90	79.90	19.00
0.4600	96.80	82.51	14.19
0.5760	94.10	82.87	11.23
0.6180	92.50	82.56	9.54
0.6990	88.10	82.34	5.76
0.8000	86.60	78.51	2.09
0.8910	71.30	69.26	2.04
0.9400	64.00	61.55	2.45
0.9560	61.00	58.66	2.34
1.0000	50.00	50.00	0.00
1.0740	32.60	31.51	-1.91
1.1010	27.90	29.14	-1.24
1.1530	20.00	20.01	-0.01
1.1980	14.00	13.88	0.12
1.2510	6.30	7.14	-0.84
1.3220	4.10	5.48	-1.38
1.3600	3.00	4.66	-1.66
1.7740	1.00	3.92	-2.92

$$\text{ABSOLUTE ERROR IN FULL RANGE} = 0.81715391E+02$$

$$\text{STANDARD DEVIATION IN FULL RANGE} = 0.21306675E+01$$

$$\text{ABSOLUTE ERROR WITH IN RANGE} = 0.23443764E+01$$

$$\text{STANDARD DEVIATION WITH IN RANGE} = 0.51037855E+00$$

FCAL = RANGE COVERED IS 3.917 % = 78.954 %

USING OUR MODEL

$$Z(1) = 0.1100 \quad Z(2) = .10220000E+02 \quad Z(3) = 92.68000$$

$$Z(4) = 0.0650$$

0(I)	FD(I)	FCAL	DIFF
0.3000	100.00	92.68	7.32
0.3800	98.90	92.68	6.22
0.4600	96.80	92.67	4.13
0.5760	94.10	92.57	1.53
0.6180	92.50	92.42	0.08
0.6990	88.10	91.53	-3.43
0.8000	80.60	87.16	-6.56
0.8910	71.30	75.68	-4.38
0.9400	64.00	65.34	-1.34
0.9560	61.00	61.44	-0.44
1.0000	50.00	50.00	0.00
1.0740	32.60	31.64	0.96
1.1010	27.90	26.05	1.85
1.1530	20.00	17.46	2.54
1.1980	14.00	12.16	1.84
1.2510	6.30	6.24	0.06
1.3220	4.10	4.46	-0.36
1.3600	3.00	3.31	-0.31
1.7740	1.00	0.22	0.78

ABSOLUTE ERROR IN FULL RANGE = 0.10663753E+02

STANDARD DEVIATION IN FULL RANGE = 0.76969520E+00

ABSOLUTE ERROR WITH IN RANGE = 0.50632425E+01

STANDARD DEVIATION WITH IN RANGE = 0.65809479E+00

FCAL = RANGE COVERED IS 0.065 % = 92.680 %

TOL. = 5.3.4

15.4483 = COMBINE(15.4483 X 260 (EPS))

LISTING OF PERTurbed EQUATIONS

$$X(1) = 1.7907 \quad X(2) = .18142002E+02 \quad X(3) = -78.314$$

$$X(4) = 0.5742 \quad X(5) = .15448000E+00$$

EQN	FD(E)	FCAL	DIFF
1.5556	93.60	93.57	-0.03
1.7284	96.30	96.52	-0.52
1.7724	86.30	85.96	-0.40
1.8200	81.20	79.72	-2.18
1.8610	76.10	72.41	-3.66
1.6935	71.00	67.03	-3.97
1.0000	50.00	49.99	-0.01
1.0400	45.00	44.36	-0.64
1.0340	43.30	45.17	-1.87
1.0590	39.60	41.88	-2.28
1.1000	35.30	37.00	-1.70
1.1670	30.40	30.42	-0.02
1.2120	27.30	26.94	-0.36
1.2550	24.40	24.23	-0.17
1.2940	21.30	22.03	-0.43
1.3210	19.30	20.30	-1.40
1.3510	16.30	19.95	-2.65
1.3770	14.20	17.94	-3.74
1.3970	12.30	17.22	-4.62
1.4220	10.50	16.69	-5.09

$$1.55433315E+01 = 1.55433315E+01$$

$$0.55456629E+00 = 0.55456629E+00$$

$$0.38788027E+01 = 0.38788027E+01$$

$$0.56953633E+00 = 0.56953633E+00$$

TOL = 0.0001 PERTURBED LS 15.4483 = 78.314 *

LISTING OF PERTurbed EQUATIONS

$$X(1) = 1.6650 \quad X(2) = .23900000E+01 \quad X(3) = 92.63280$$

$$X(4) = 3.1735$$

EQN	FD(E)	FCAL	DIFF
1.5556	93.60	92.55	-1.05
1.7284	96.30	91.20	-0.90
1.7724	86.30	87.68	-1.38
1.8200	81.20	81.43	-0.23
1.8610	76.10	74.65	1.45
1.6935	71.00	68.78	2.22
1.1000	50.00	50.00	0.00
1.0400	45.00	43.97	1.03
1.0340	43.30	44.82	-1.52
1.0590	39.60	41.35	-1.75
1.1000	35.30	36.28	-0.98
1.1670	30.40	29.49	0.91
1.2120	27.30	25.84	1.46
1.2550	24.40	22.91	1.49
1.2940	21.60	20.19	1.21
1.3210	18.90	18.27	0.63
1.3510	16.30	16.44	-0.14
1.3770	14.20	14.89	-0.69
1.3970	12.30	13.62	-1.02
1.4220	10.50	12.51	-0.91

$$1.13871824E+01 = 1.13871824E+01$$

$$0.27620289E+00 = 0.27620289E+00$$

$$0.1418015E+01 = 0.1418015E+01$$

$$0.27906605E+00 = 0.27906605E+00$$

TABLE - 5.3.7

100% ISOTOPIC CONCENTRATING TABLE - 48 X 100 INCH SIZE
USING GOTFRID EQUATION

$$X(1) = 2.2239 \quad X(2) = .63174000E+01 \quad X(3) = 7.85373$$

$$X(4) = 0.7426 \quad X(5) = 1.0650000E+01$$

FC(I)	FD(I)	FCAL	DIFF
1.6330	100.00	91.30	8.70
1.7200	97.70	95.73	1.97
1.7300	94.10	95.13	-1.03
1.8200	90.30	91.57	-0.77
0.8620	86.20	84.84	1.36
0.8880	82.30	79.33	2.97
0.9040	78.00	75.53	2.47
1.0000	50.00	49.94	0.01
1.0260	42.00	42.35	-1.35
1.0400	37.50	32.99	-2.49
1.0790	30.00	31.60	-1.60
1.1250	23.70	23.93	-0.13
1.2200	10.00	14.56	-4.56
1.2700	8.00	13.54	-5.54
1.2700	6.00	12.53	-6.53
1.3000	4.00	11.45	-7.45
1.3000	3.00	10.90	-7.90
1.3000	2.00	10.65	-8.65

$$\text{AVERAGE ERROR IN FULL RANGE} = 0.22087852E+02$$

$$\text{STANDARD DEVIATION IN FULL RANGE} = 0.11338621E+01$$

$$\text{AVERAGE ERROR WITHIN RANGE} = 0.36453957E+01$$

$$\text{STANDARD DEVIATION WITHIN RANGE} = 0.77946528E+00$$

FC(I) = RANGE COVERED IS 10.650 % - 85.379 %

USING OUR MODEL

$$X(1) = 0.4575 \quad X(2) = .65343900E+01 \quad X(3) = 98.10000$$

$$X(4) = 0.7050$$

FC(I)	FD(I)	FCAL	DIFF
1.6330	100.00	97.94	2.06
1.7200	97.70	97.29	0.41
1.7300	94.10	95.94	-0.94
1.8200	90.30	91.77	-0.97
0.8620	86.20	85.95	0.25
0.8880	82.30	80.92	1.38
0.9040	78.00	77.28	0.72
1.0000	50.00	50.00	0.00
1.0260	42.00	42.54	-0.54
1.0400	37.50	38.76	-1.26
1.0790	30.00	29.38	0.62
1.1250	23.70	20.75	2.95
1.2200	10.00	9.92	0.08
1.2700	8.00	8.51	-0.51
1.2700	6.00	6.78	-0.78
1.3000	4.00	4.70	-0.70
1.3000	3.00	3.08	-0.08
1.3000	2.00	3.12	1.88

$$\text{AVERAGE ERROR IN FULL RANGE} = 0.13687461E+01$$

$$\text{STANDARD DEVIATION IN FULL RANGE} = 0.28375073E+00$$

$$\text{AVERAGE ERROR WITHIN RANGE} = 0.11984480E+01$$

$$\text{STANDARD DEVIATION WITHIN RANGE} = 0.27368413E+00$$

FC(I) = RANGE COVERED IS 0.005 % - 98.101 %

02620

TABLE - 5.3.8

DATA USED

100 X 200 GRID SIZE

USING DERIVED EQUATION

$$Y(1) = 4.9932 \quad X(2) = .26097200E+02 \quad X(3) = 0.64E72$$

$$X(4) = 6.6841 \quad X(5) = .30329000E+00$$

DC(I)	FD(I)	FCAL	DIFF
0.6360	100.00	95.43	4.57
0.6410	99.80	95.50	4.30
0.6837	99.20	95.50	3.70
0.7210	98.10	95.50	2.60
0.7600	96.90	95.44	1.46
0.8000	94.70	94.98	-0.28
0.8360	91.90	92.50	-1.50
0.8520	90.00	92.24	-2.24
0.9010	80.00	84.53	-4.53
1.0000	50.00	50.02	-0.02
1.0250	45.00	41.48	3.52
1.0620	40.00	31.41	5.59
1.124	33.90	30.94	2.96
1.271	29.20	30.83	-1.63
1.321	24.30	30.83	-6.53
1.41	21.00	30.83	-9.93
1.4690	17.70	30.83	-13.13
1.5000	12.00	30.83	-18.83

$$\text{ABSOLUTE ERROR IN FULL RANGE} = 0.44140594E+02$$

$$\text{STD. DEVIATION IN FULL RANGE} = 0.16113676E+01$$

$$\text{ABSOLUTE ERROR WITH IN RANGE} = 0.131042078E+02$$

$$\text{STD. DEVIATION WITH IN RANGE} = 0.208999268E+01$$

Y(5) = 4.9932 DATA COVERED IS 30.829 % - 61.672 %

USING OUR MODEL

$$Y(1) = 4.9959 \quad X(2) = .46925000E+01 \quad X(3) = 99.99420$$

$$X(4) = 18.4450$$

DC(I)	FD(I)	FCAL	DIFF
0.6360	100.00	99.99	0.01
0.6410	99.80	99.99	-0.19
0.6837	99.20	99.94	-0.74
0.7210	98.10	99.54	-1.44
0.7600	96.90	99.45	-1.55
0.8000	94.70	95.59	-0.89
0.8360	91.90	90.91	1.09
0.8520	90.00	87.91	2.09
0.9010	80.00	76.38	3.62
1.0000	50.00	50.00	0.00
1.0250	45.00	44.43	0.57
1.0620	40.00	38.43	1.57
1.124	33.90	30.58	3.32
1.271	29.20	25.31	3.89
1.321	24.30	21.49	2.81
1.41	21.00	20.32	1.58
1.4690	17.70	19.11	-1.41
1.5000	12.00	18.58	-6.58

$$\text{ABSOLUTE ERROR IN FULL RANGE} = 0.60615262E+01$$

$$\text{STD. DEVIATION IN FULL RANGE} = 0.59712676E+00$$

$$\text{ABSOLUTE ERROR WITH IN RANGE} = 0.42533776E+01$$

$$\text{STD. DEVIATION WITH IN RANGE} = 0.55119206E+00$$

Y(5) = 4.9959 DATA COVERED IS 18.445 % - 97.994 %